

VEGAFLEX 80 two-wire 4 ... 20 mA HART SIL

HW version, available since	Description
1.0.3 06/2023	Modifications compared to HW version 1.0.2: <ul style="list-style-type: none"> – Update of the HF signal generation due to discontinued components
1.0.2 05/2019	Modifications compared to HW version 1.0.1: <ul style="list-style-type: none"> – Cause for the failure of individual instruments with error message F040/8000 "Failure in the electronics" due to too low signal amplitude <ul style="list-style-type: none"> ○ Adaptation of the filter damping to increase the signal amplitude
1.0.1 09/2015	Modifications compared to HW version 1.0.0: <ul style="list-style-type: none"> – Cause for the failure of individual instruments with error message F040/8000 "Failure in the electronics" with temperatures < -2 °C removed <ul style="list-style-type: none"> ○ Improved timing when synchronizing the HF signals

Legend:

Name	Description
HW version	Compatibility version.Function extension version.Error correction version
available since	Month/Year