

# Operating Instructions

**Radar sensor for continuous level  
measurement of bulk solids**

## **VEGAPULS 67**

HART and accumulator pack



Document ID: 40795



# VEGA

## Contents

<b>1</b>	<b>About this document .....</b>	<b>4</b>
1.1	Function .....	4
1.2	Target group .....	4
1.3	Symbols used.....	4
<b>2</b>	<b>For your safety .....</b>	<b>5</b>
2.1	Authorised personnel .....	5
2.2	Appropriate use.....	5
2.3	Warning about incorrect use.....	5
2.4	General safety instructions .....	5
2.5	EU conformity.....	6
2.6	NAMUR recommendations .....	6
2.7	Radio license for Europe .....	6
2.8	Radio license for USA .....	6
2.9	Radio license for Canada .....	7
2.10	Installation and operation in the USA and Canada .....	9
2.11	Environmental instructions .....	9
<b>3</b>	<b>Product description .....</b>	<b>10</b>
3.1	Configuration.....	10
3.2	Principle of operation.....	11
3.3	Packaging, transport and storage.....	11
3.4	Accessories and replacement parts .....	12
<b>4</b>	<b>Mounting.....</b>	<b>14</b>
4.1	General instructions .....	14
4.2	Collar or adapter flange .....	15
4.3	Mounting strap .....	15
4.4	Mounting instructions .....	17
<b>5</b>	<b>Connecting to power supply.....</b>	<b>27</b>
5.1	Connection of the battery charger .....	27
5.2	Wiring plan .....	27
5.3	Switch-on phase.....	29
<b>6</b>	<b>Set up with the display and adjustment module .....</b>	<b>30</b>
6.1	Insert display and adjustment module .....	30
6.2	Adjustment system .....	31
6.3	Measured value indication - Selection of national language .....	32
6.4	Parameter adjustment .....	33
6.5	Saving the parameterisation data .....	49
<b>7</b>	<b>Setup with PACTware.....</b>	<b>50</b>
7.1	Connect the PC.....	50
7.2	Parameter adjustment .....	50
7.3	Saving the parameterisation data .....	52
<b>8</b>	<b>Set up with other systems .....</b>	<b>53</b>
8.1	DD adjustment programs .....	53
8.2	Field Communicator 375, 475 .....	53
<b>9</b>	<b>Diagnosis, asset management and service .....</b>	<b>54</b>
9.1	Maintenance .....	54

9.2	Measured value and event memory .....	54
9.3	Asset Management function.....	55
9.4	Rectify faults.....	58
9.5	Exchanging the electronics module.....	61
9.6	Software update .....	61
9.7	How to proceed if a repair is necessary.....	62
<b>10</b>	<b>Dismount.....</b>	<b>63</b>
10.1	Dismounting steps.....	63
10.2	Disposal .....	63
<b>11</b>	<b>Supplement .....</b>	<b>64</b>
11.1	Technical data .....	64
11.2	Dimensions .....	69
11.3	Industrial property rights.....	73
11.4	Trademark .....	73

### **Safety instructions for Ex areas**



Take note of the Ex specific safety instructions for Ex applications. These instructions are attached as documents to each instrument with Ex approval and are part of the operating instructions.

Editing status: 2018-11-23

# 1 About this document

## 1.1 Function

This operating instructions provides all the information you need for mounting, connection and setup as well as important instructions for maintenance, fault rectification, the exchange of parts and the safety of the user. Please read this information before putting the instrument into operation and keep this manual accessible in the immediate vicinity of the device.

## 1.2 Target group

This operating instructions manual is directed to trained personnel. The contents of this manual must be made available to the qualified personnel and implemented.

## 1.3 Symbols used



### Document ID

This symbol on the front page of this instruction refers to the Document ID. By entering the Document ID on [www.vega.com](http://www.vega.com) you will reach the document download.



### Information, tip, note

This symbol indicates helpful additional information.



**Caution:** If this warning is ignored, faults or malfunctions can result.



**Warning:** If this warning is ignored, injury to persons and/or serious damage to the instrument can result.



**Danger:** If this warning is ignored, serious injury to persons and/or destruction of the instrument can result.



### Ex applications

This symbol indicates special instructions for Ex applications.



### List

The dot set in front indicates a list with no implied sequence.



### Action

This arrow indicates a single action.



### Sequence of actions

Numbers set in front indicate successive steps in a procedure.



### Battery disposal

This symbol indicates special information about the disposal of batteries and accumulators.

## 2 For your safety

### 2.1 Authorised personnel

All operations described in this documentation must be carried out only by trained, qualified personnel authorised by the plant operator.

During work on and with the device, the required personal protective equipment must always be worn.

### 2.2 Appropriate use

The VEGAPULS 67 is a sensor for continuous level measurement. Due to the integrated accumulator the instrument is particularly suitable as a portable measuring system or test sensor for special applications.

You can find detailed information about the area of application in chapter "*Product description*".

Operational reliability is ensured only if the instrument is properly used according to the specifications in the operating instructions manual as well as possible supplementary instructions.

### 2.3 Warning about incorrect use

Inappropriate or incorrect use of this product can give rise to application-specific hazards, e.g. vessel overfill through incorrect mounting or adjustment. Damage to property and persons or environmental contamination can result. Also, the protective characteristics of the instrument can be impaired.

### 2.4 General safety instructions

This is a state-of-the-art instrument complying with all prevailing regulations and directives. The instrument must only be operated in a technically flawless and reliable condition. The operator is responsible for the trouble-free operation of the instrument. When measuring aggressive or corrosive media that can cause a dangerous situation if the instrument malfunctions, the operator has to implement suitable measures to make sure the instrument is functioning properly.

During the entire duration of use, the user is obliged to determine the compliance of the necessary occupational safety measures with the current valid rules and regulations and also take note of new regulations.

The safety instructions in this operating instructions manual, the national installation standards as well as the valid safety regulations and accident prevention rules must be observed by the user.

For safety and warranty reasons, any invasive work on the device beyond that described in the operating instructions manual may be carried out only by personnel authorised by the manufacturer. Arbitrary conversions or modifications are explicitly forbidden. For safety reasons, only the accessory specified by the manufacturer must be used.

To avoid any danger, the safety approval markings and safety tips on the device must also be observed and their meaning read in this operating instructions manual.

Depending on the instrument version, the emitting frequencies are in the C, K or W band range. The low emission power is far below the internationally approved limit values. When used correctly, the device poses no danger to health.

## 2.5 EU conformity

The device fulfils the legal requirements of the applicable EU directives. By affixing the CE marking, we confirm the conformity of the instrument with these directives.

You can find the EU conformity declaration on our website under [www.vega.com/downloads](http://www.vega.com/downloads).

## 2.6 NAMUR recommendations

NAMUR is the automation technology user association in the process industry in Germany. The published NAMUR recommendations are accepted as the standard in field instrumentation.

The device fulfils the requirements of the following NAMUR recommendations:

- NE 21 – Electromagnetic compatibility of equipment
- NE 43 – Signal level for fault information from measuring transducers
- NE 53 – Compatibility of field devices and display/adjustment components
- NE 107 – Self-monitoring and diagnosis of field devices

For further information see [www.namur.de](http://www.namur.de).

## 2.7 Radio license for Europe

The instrument was tested according to the latest issue of the following harmonized standards:

- EN 302372 - Tank Level Probing Radar

It is hence approved for use inside closed vessels in countries of the EU.

Use is also approved in EFTA countries, provided the respective standards have been implemented.

For operation inside of closed vessels, points a to f in annex E of EN 302372 must be fulfilled.

## 2.8 Radio license for USA

This approval is only valid for USA. Hence the following text is only available in the English language.

This device complies with Part 15 of the FCC Rules. Operation is subject to the following two conditions:

- This device may not cause interference, and

- This device must accept any interference, including interference that may cause undesired operation of the device

This device is approved for unrestricted use only inside closed, stationary vessels made of metal, concrete and reinforced fiberglass.

For operation outside of closed vessels, the following conditions must be fulfilled:

- This device shall be installed and maintained to ensure a vertically downward orientation of the transmit antenna's main beam. Furthermore, the use of any mechanism that does not allow the main beam of the transmitter to be mounted vertically downward is prohibited.
- This device shall be installed only at fixed locations. The LPR device shall not operate while being moved or while inside a moving container.
- Hand-held applications are prohibited.
- Marketing to residential consumers is prohibited.

Changes or modifications not expressly approved by the manufacturer could void the user's authority to operate this equipment.

## 2.9 Radio license for Canada

This approval is only valid for Canada. Hence the following texts are only available in the English/French language.

This device complies with Industry Canada's license-exempt RSS standards. Operation is subject to the following conditions:

- This device may not cause interference, and
- This device must accept any interference, including interference that may cause undesired operation of the device

This device has been approved for both closed containers and open-air environments with the following limitations:

- Closed Containers: For installations utilizing a tilt during installation: This device is limited to installation in a completely enclosed container made of metal, concrete or reinforced fiberglass to prevent RF emissions, which can otherwise interfere with aeronautical navigation, the maximum approved tilt angle is 10°.
- Open Air Environment: For operation outside of closed vessels, the following condition must be fulfilled: This device shall be installed and maintained to ensure a vertically downward orientation of the transmit antenna's main beam. Furthermore, the use of any mechanism that does not allow the main beam of the transmitter to be mounted vertically downward is prohibited.

The installation of the LPR/TLPR device shall be done by trained installers, in strict compliance with the manufacture's instructions.

This device shall be installed only at fixed locations. The LPR device shall not operate while being moved or while inside a moving container.

Hand-held applications are prohibited.

Marketing to residential consumers is prohibited.

The use of this device is on a "no-interference, no-protection" basis. That is, the user shall accept operations of high-powered radar in the same frequency band which may interfere with or damage this device.

However, devices found to interfere with primary licensing operations will be required to be removed at the user's expense.

The installer/user of this device shall ensure that it is at least 10 km from the Dominion Astrophysical Radio Observatory (DRAO) near Penticton, British Columbia. The coordinates of the DRAO are latitude 49°19'15" N and longitude 119°37'12" W. For devices not meeting this 10 km separation (e.g., those in the Okanagan Valley, British Columbia,) the installer/user must coordinate with, and obtain the written concurrence of, the Director of the DRAO before the equipment can be installed or operated. The Director of the DRAO may be contacted at 250-497-2300 (tel.) or 250-497-2355 (fax). (Alternatively, the Manager, Regulatory Standards, Industry Canada, may be contacted.)

Le présent appareil est conforme aux CNR d'Industrie Canada applicables aux appareils radio exempts de licence. L'exploitation est autorisée aux conditions suivantes :

- L'appareil ne doit pas produire de brouillage; et
- L'utilisateur de l'appareil doit accepter tout brouillage radioélectrique subi, même si le brouillage est susceptible d'en compromettre le fonctionnement.

Cet appareil est homologué pour une utilisation dans les cuves fermées et les environnements ouverts avec les restrictions suivantes :

- Cuves fermées : Pour les installations impliquant une inclinaison lors de l'installation : cet appareil ne doit être installé que dans une cuve totalement fermée en en métal, en béton ou en matière plastique renforcée de fibres de verre, pour empêcher les émissions RF susceptibles d'interférer avec la navigation aéronautique. L'angle d'inclinaison maximum autorisé est de 10°.
- Environnement ouvert : Pour l'utilisation hors des cuves fermées, la condition suivante doit être remplie : L'appareil doit être installé et entretenu de manière à garantir une orientation verticale vers le bas du faisceau principal de l'antenne émettrice. De plus, l'utilisation de tout mécanisme ne permettant pas l'orientation verticale vers le bas du faisceau principal de l'émetteur est interdite

L'installation d'un dispositif LPR ou TLPR doit être effectuée par des installateurs qualifiés, en pleine conformité avec les instructions du fabricant.

Cet appareil ne doit être installé qu'à des emplacements fixes. L'appareil LPR ne doit pas être utilisé pendant qu'il est en train d'être déplacé ou se trouve dans un conteneur en mouvement.

Les applications portables sont interdites.

La vente à des particuliers est interdite

Ce dispositif ne peut être exploité qu'en régime de non-brouillage et de non-protection, c'est-à-dire que l'utilisateur doit accepter que des radars de haute puissance de la même bande de fréquences



puissent brouiller ce dispositif ou même l'endommager. D'autre part, les capteurs de niveau qui perturbent une exploitation autorisée par licence de fonctionnement principal doivent être enlevés aux frais de leur utilisateur.

La personne qui installe/utilise ce capteur de niveau doit s'assurer qu'il se trouve à au moins 10 km de l'Observatoire fédéral de radioastrophysique (OFR) de Penticton en Colombie-Britannique. Les coordonnées de l'OFR sont : latitude N 49° 19' 15", longitude O 119° 37' 12". La personne qui installe/utilise un dispositif ne pouvant respecter cette distance de 10km (p. ex. dans la vallée de l'Okanagan [Colombie-Britannique]) doit se concerter avec le directeur de l'OFR afin d'obtenir de sa part une autorisation écrite avant que l'équipement ne puisse être installé ou mis en marche. Le directeur de l'OFR peut être contacté au 250-497-2300 (tél.) ou au 250-497-2355 (fax). (Le Directeur des Normes réglementaires d'Industrie Canada peut également être contacté).

## 2.10 Installation and operation in the USA and Canada

This information is only valid for USA and Canada. Hence the following text is only available in the English language.

Installations in the US shall comply with the relevant requirements of the National Electrical Code (ANSI/NFPA 70).

Installations in Canada shall comply with the relevant requirements of the Canadian Electrical Code.

## 2.11 Environmental instructions

Protection of the environment is one of our most important duties. That is why we have introduced an environment management system with the goal of continuously improving company environmental protection. The environment management system is certified according to DIN EN ISO 14001.

Please help us fulfil this obligation by observing the environmental instructions in this manual:

- Chapter "*Packaging, transport and storage*"
- Chapter "*Disposal*"

## 3 Product description

### 3.1 Configuration

#### Type label

The type label contains the most important data for identification and use of the instrument:

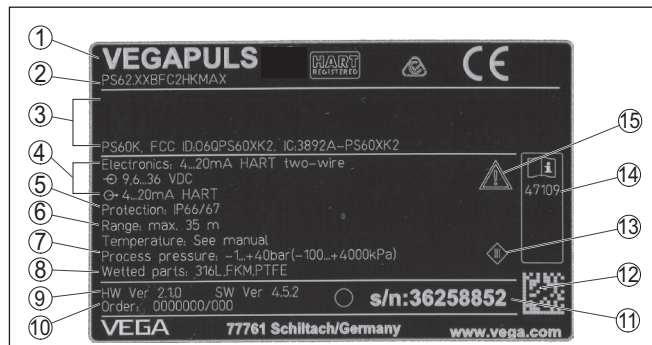


Fig. 1: Layout of the type label (example)

- 1 Instrument type
- 2 Product code
- 3 Approvals
- 4 Power supply and signal output, electronics
- 5 Protection rating
- 6 Measuring range
- 7 Process and ambient temperature, process pressure
- 8 Material wetted parts
- 9 Hardware and software version
- 10 Order number
- 11 Serial number of the instrument
- 12 Data matrix code for VEGA Tools app
- 13 Symbol of the device protection class
- 14 ID numbers, instrument documentation
- 15 Reminder to observe the instrument documentation

#### Serial number - Instrument search

The type label contains the serial number of the instrument. With it you can find the following instrument data on our homepage:

- Product code (HTML)
- Delivery date (HTML)
- Order-specific instrument features (HTML)
- Operating instructions and quick setup guide at the time of shipment (PDF)
- Order-specific sensor data for an electronics exchange (XML)
- Test certificate (PDF) - optional

Go to "[www.vega.com](http://www.vega.com)", "Search". Enter the serial number.

Alternatively, you can access the data via your smartphone:

- Download the VEGA Tools app from the "Apple App Store" or the "Google Play Store"
- Scan the Data Matrix code on the type label of the instrument or
- Enter the serial number manually in the app

## Scope of this operating instructions

This operating instructions manual applies to the following instrument versions:

- Hardware from 2.1.0
- Software version from 4.5.3

## Scope of delivery

The scope of delivery encompasses:

- Radar sensor with integrated accumulator
- Battery charger
- Mounting strap with fixing material (optional)
- Documentation
  - Quick setup guide VEGAPULS 67
  - Instructions for optional instrument features
  - Ex-specific "*Safety instructions*" (with Ex versions)
  - If necessary, further certificates



### Information:

The optional instrument features are described in the operating instructions manual. The respective scope of delivery results from the order specification.

## 3.2 Principle of operation

### Application area

The VEGAPULS 67 is a radar sensor for continuous level measurement of bulk solids under simple process conditions. It is suitable for smaller silos and vessels.

The instrument is also suitable for applications in liquids.

### Functional principle

The antenna of the radar sensor emits short radar pulses with a duration of approx. 1 ns. These pulses are reflected by the product and received by the antenna as echoes. The transit time of the radar pulses from emission to reception is proportional to the distance and hence to the level. The determined level is converted into an appropriate output signal and outputted as measured value.

### Voltage supply

The instrument is powered via an integrated accumulator. This allows operation of the instrument independently of the mains or a control system. To achieve a longer battery lifetime, the instrument is preset to HART multidrop. This puts a load of only 4 mA current on the accumulator.

## 3.3 Packaging, transport and storage

### Packaging

Your instrument was protected by packaging during transport. Its capacity to handle normal loads during transport is assured by a test based on ISO 4180.

The packaging of standard instruments consists of environment-friendly, recyclable cardboard. For special versions, PE foam or PE foil is also used. Dispose of the packaging material via specialised recycling companies.

<b>Transport</b>	Transport must be carried out in due consideration of the notes on the transport packaging. Nonobservance of these instructions can cause damage to the device.
<b>Transport inspection</b>	The delivery must be checked for completeness and possible transit damage immediately at receipt. Ascertained transit damage or concealed defects must be appropriately dealt with.
<b>Storage</b>	<p>Up to the time of installation, the packages must be left closed and stored according to the orientation and storage markings on the outside.</p> <p>Unless otherwise indicated, the packages must be stored only under the following conditions:</p> <ul style="list-style-type: none"> <li>● Not in the open</li> <li>● Dry and dust free</li> <li>● Not exposed to corrosive media</li> <li>● Protected against solar radiation</li> <li>● Avoiding mechanical shock and vibration</li> </ul>
<b>Storage and transport temperature</b>	<ul style="list-style-type: none"> <li>● Storage and transport temperature see chapter "<i>Supplement - Technical data - Ambient conditions</i>"</li> <li>● Relative humidity 20 ... 85 %</li> </ul>
<b>Lifting and carrying</b>	With instrument weights of more than 18 kg (39.68 lbs) suitable and approved equipment must be used for lifting and carrying.
<b>PLICSCOM</b>	<p><b>3.4 Accessories and replacement parts</b></p> <p>The display and adjustment module PLICSCOM is used for measured value indication, adjustment and diagnosis. It can be inserted into the sensor or the external display and adjustment unit and removed at any time.</p> <p>The integrated Bluetooth module (optional) enables wireless adjustment via standard adjustment devices:</p> <ul style="list-style-type: none"> <li>● Smartphone/tablet (iOS or Android operating system)</li> <li>● PC/notebook with Bluetooth USB adapter (Windows operating system)</li> </ul> <p>You can find further information in the operating instructions "<i>Display and adjustment module PLICSCOM</i>" (Document-ID 36433).</p>
<b>VEGACONNECT</b>	<p>The interface adapter VEGACONNECT enables the connection of communication-capable instruments to the USB interface of a PC. For parameter adjustment of these instruments, the adjustment software PACTware with VEGA-DTM is required.</p> <p>You can find further information in the operating instructions "<i>Interface adapter VEGACONNECT</i>" (Document-ID 32628).</p>
<b>Protective cover</b>	<p>The protective cover protects the sensor housing against soiling and intense heat from solar radiation.</p> <p>You will find additional information in the supplementary instructions manual "<i>Protective cover</i>" (Document-ID 34296).</p>

### Electronics module

Electronics module "VEGAPULS series 60" is a replacement part for radar sensors of VEGAPULS series 60. A different version is available for each type of signal output.

You can find further information in the operating instructions "*Electronics module VEGAPULS series 60*" (Document-ID 36801).

### Supplementary electronics for power pack

The supplementary electronics "Power pack" is a replacement part for sensors with integrated accumulator.

You can find further information in the operating instructions "*Supplementary electronics for 4 ... 20 mA/HART and power pack*" (Document-ID 41033).

## 4 Mounting

### 4.1 General instructions

#### Screwing in

On devices with a threaded fitting, the hexagon on the process fitting must be tightened with a suitable wrench.

See chapter "*Dimensions*" for wrench size.



#### Warning:

The housing or the electrical connection may not be used for screwing in! Tightening can cause damage, e. g. to the rotation mechanism of the housing.

#### Protection against moisture

Protect your instrument against moisture ingress through the following measures:

- Use a suitable connection cable (see chapter "*Connecting to power supply*")
- Tighten the cable gland or plug connector
- When mounting horizontally, turn the housing so that the cable gland or plug connector point downward
- Lead the connection cable downward in front of the cable entry or plug connector.

This applies mainly to outdoor installations, in areas where high humidity is expected (e.g. through cleaning processes) and on cooled or heated vessels.

To maintain the housing protection, make sure that the housing lid is closed during operation and locked, if necessary.

Make sure that the degree of contamination specified in chapter "*Technical data*" meets the existing ambient conditions.

#### Suitability for the process conditions

Make sure before mounting that all parts of the instrument exposed to the process are suitable for the existing process conditions.

These are mainly:

- Active measuring component
- Process fitting
- Process seal

Process conditions in particular are:

- Process pressure
- Process temperature
- Chemical properties of the medium
- Abrasion and mechanical influences

You can find detailed information on the process conditions in chapter "*Technical data*" as well as on the type label.

#### Suitability for the ambient conditions

The instrument is suitable for standard and extended ambient conditions acc. to IEC/EN 61010-1.

## 4.2 Collar or adapter flange

For mounting the instrument on a socket, a combi compression flange for DN 80 (ASME 3" or JIS 80) is also available for retro fitting. Optionally, the instrument can be also equipped with an adapter flange from DN 100 (ASME 4" or JIS 100).

With the housing versions plastic, aluminium single chamber and stainless steel, the collar flange can be placed directly over the housing. With the aluminium double chamber housing, retroactive mounting in this way is not possible - the mounting type must be specified with the order.

You can find drawings of these mounting options in chapter "Dimensions".

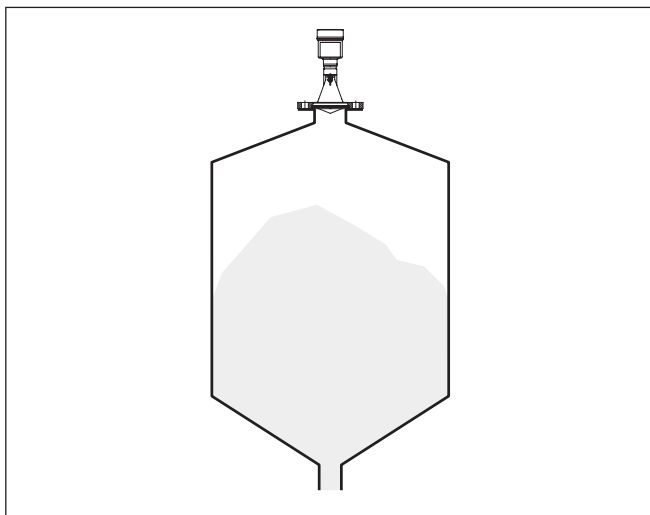


Fig. 2: Flange mounting of the radar sensor

## Mounting strap

## 4.3 Mounting strap

The mounting strap enables simple mounting on the vessel wall or silo top. It is suitable for wall, ceiling or boom mounting. Especially in open vessels this is a very easy and effective way to align the sensor to the bulk solid surface.

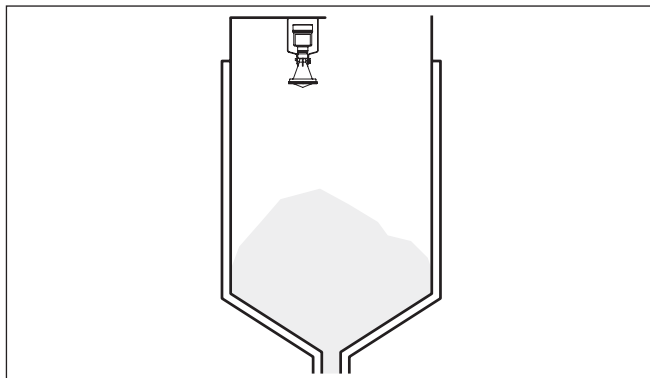


Fig. 3: Radar sensor with mounting strap

The strap is supplied unassembled and must be screwed to the sensor before setup with three hexagon socket screws M5 x 10 and spring washers. Max. torque, see chapter "Technical data". Required tools: Allen wrench size 4.

There are two ways to screw the strap onto the sensor. Depending on the selected version, the sensors can be swivelled in the strap as follows:

- Single chamber housing
  - Angle of inclination 180°, infinitely variable
  - Angle of inclination in three steps 0°, 90° and 180°
- Double chamber housing
  - Angle of inclination 90°, infinitely variable
  - Angle of inclination in two steps 0° and 90°

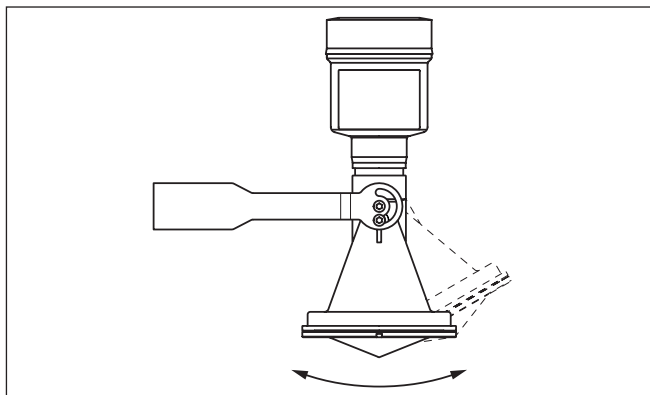


Fig. 4: Adjustment of the angle of inclination



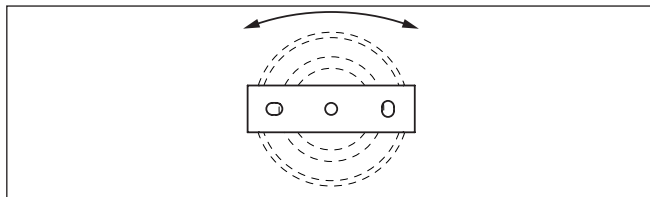


Fig. 5: Turning by fastening in the centre

## 4.4 Mounting instructions

### Tight installation of the plastic horn antenna

For tight installation of the version with plastic horn antenna with compression or adapter flange, the following conditions must be fulfilled:

1. Use suitable flat seal, e.g. of EPDM with Shore hardness 25 or 50
2. Make sure the number of flange screws corresponds to the number of flange holes
3. Tighten all screws with the torque stated in the technical data

### Polarisation

The emitted radar impulses of the radar sensor are electromagnetic waves. The polarisation is the direction of the electrical share. With radar sensors, the polarisation can be used to reduce the effect of false echoes considerably by turning the instrument in the connection flange or mounting boss.

The position of the polarisation is marked on the instrument.

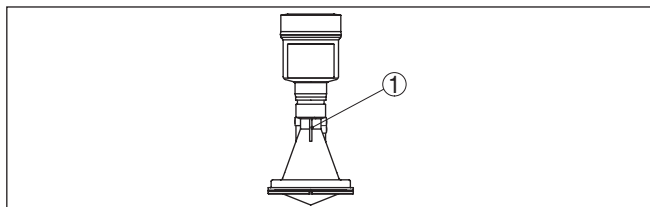


Fig. 6: Position of the polarisation

1 Marking bar

### Installation position

Mount the instrument at least 200 mm (7.874 in) away from the vessel wall.

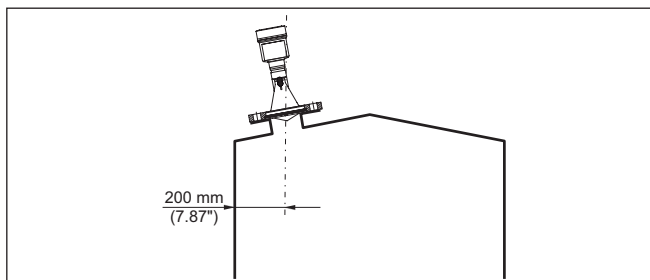


Fig. 7: Mounting the radar sensor on the vessel top

If you cannot maintain this distance, you should carry out a false signal suppression during setup. This applies particularly if buildup on the vessel wall is expected. In such cases, we recommend repeating the false signal suppression at a later date with existing buildup.

### Inflowing medium

**Filling from the top:** Mounting should not be too close to the inflowing material as the microwave signal will be interfered. The optimum mounting position is on the opposite of the filling. To avoid strong pollution, the distance to the filter or dust extraction must be as big as possible.

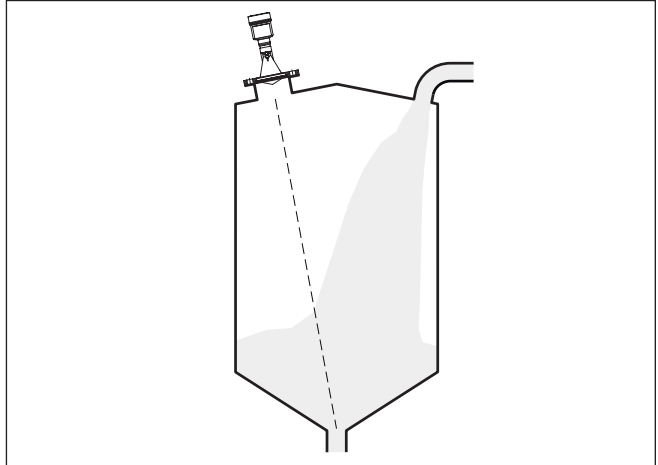


Fig. 8: Mounting of the radar sensor with inflowing medium - filling from top

**Lateral filling:** With bulk solids silos with lateral pneumatic filling, mounting should not be in the filling stream as the microwave signal will be interfered. The optimum mounting position is next to the filling. To avoid strong pollution, the distance to the filter or dust extraction must be as big as possible.

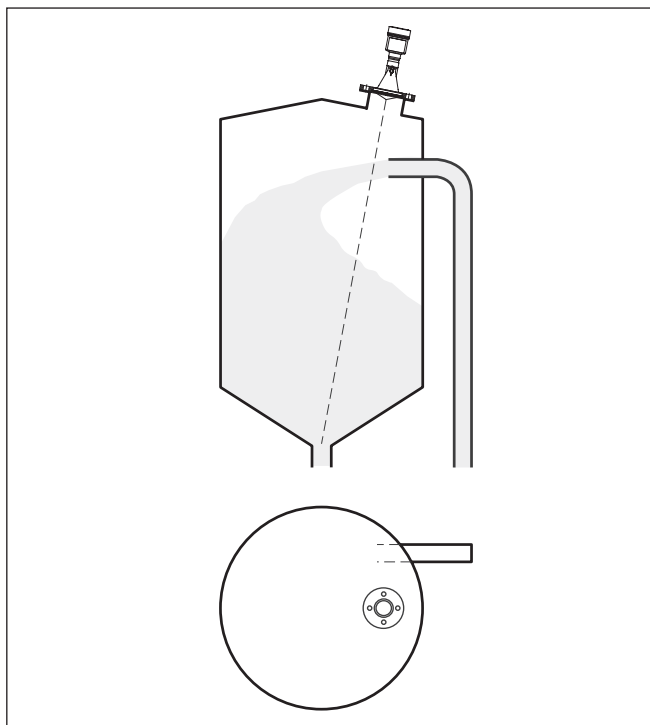


Fig. 9: Mounting of the radar sensor with inflowing medium - filling from the side

### Socket with plastic horn antenna

A corresponding collar flange for DN 80 (ASME 3" or JIS 80) as well as a suitable adapter flange are available for mounting VEGAPULS 67.

With the housing versions plastic, aluminium single chamber and stainless steel, the collar flange can be placed directly over the housing. With the aluminium double chamber housing, retroactive mounting in this way is not possible - the mounting type must be specified with the order.



#### Information:

The mounting socket should be as short as possible and its end rounded. This reduces false echoes from the vessel mounting socket.


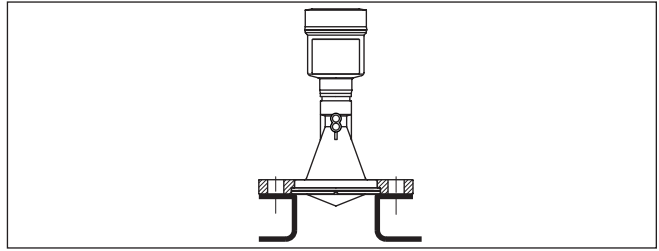


Fig. 10: Recommended socket mounting

If the medium has good reflective properties, VEGAPULS 67 can also be mounted on a longer socket piece. Recommended values for socket heights are specified in the following illustration. You must carry out a false echo storage afterwards.

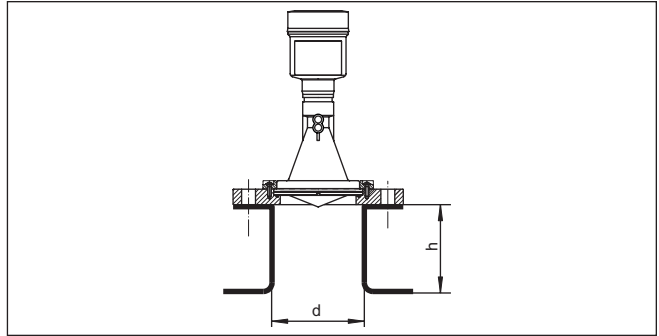

The below charts specify the max. pipe socket length  $h$  depending on the diameter  $d$ .

Socket diameter $d$	Socket length $h$
80 mm	$\leq 300$ mm
100 mm	$\leq 400$ mm
150 mm	$\leq 500$ mm

Socket diameter $d$	Socket length $h$
3"	$\leq 11.8$ in
4"	$\leq 15.8$ in
6"	$\leq 19.7$ in



**Tip:**

In new facilities it is useful to incline the vessel socket in the direction of the outlet. False reflections from the vessel wall are thus reduced and measurement all the way down to the bottom of the conical outlet is possible.

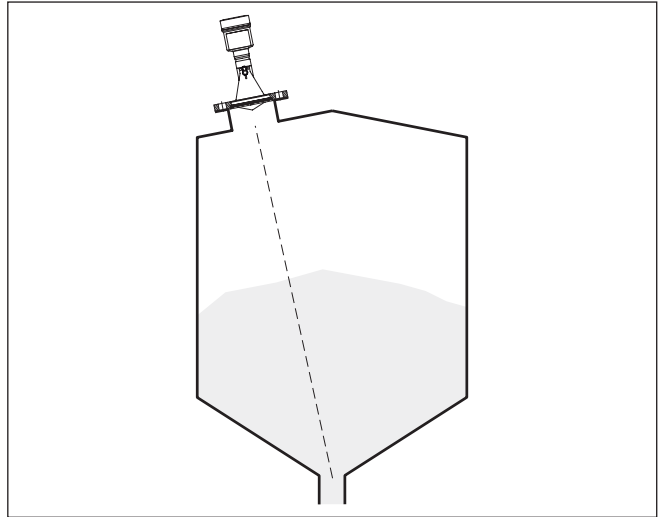


Fig. 12: Alignment in silos

## Orientation

To detect nearly the complete vessel volume the sensor should be directed in such a way that the measuring beam reaches the lowest level in the vessel, i.e. the outlet.

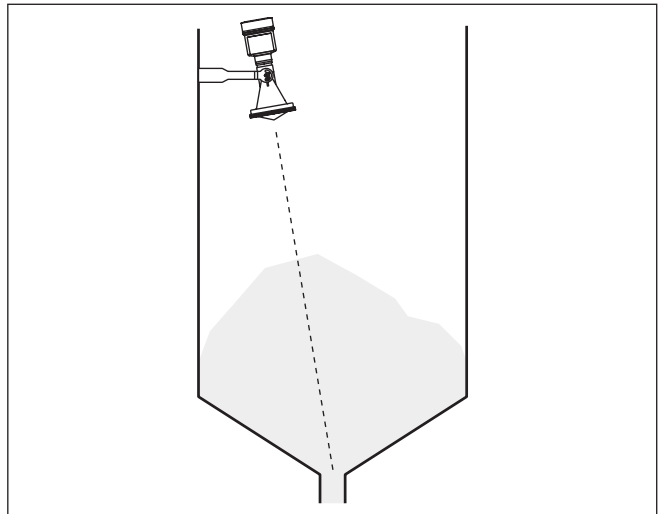


Fig. 13: Mounting in open vessel

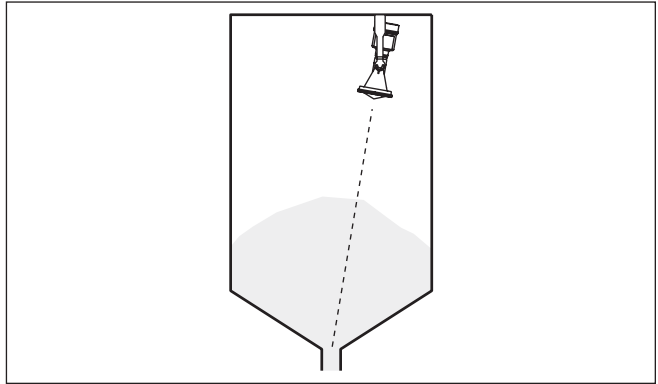


Fig. 14: Mounting on the vessel ceiling



**Caution:**

When mounting on the vessel ceiling make sure that the sensor does not overfill. Depending on the measured product, this can cause a mechanical damage.

In a cylindrical silo with conical outlet, the mounting is carried out on a socket. It should be positioned on one third up to the half of the vessel radius.

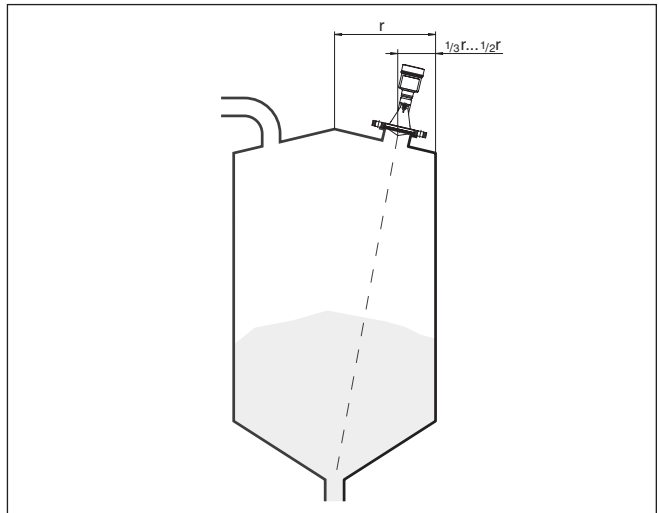


Fig. 15: Mounting position and orientation

**Material heaps**

Large material heaps are best measured with several instruments, which can be mounted on e.g. traverse cranes. For this type of application it is advantageous to orient the sensor perpendicular to the bulk solid surface.

The sensors do not influence each other.



**Information:**

Keep in mind that for these applications, the sensors are designed for relatively slow level changes. If the sensor is used on a movable boom, the max. measuring rate must be observed (see chapter "Technical data").

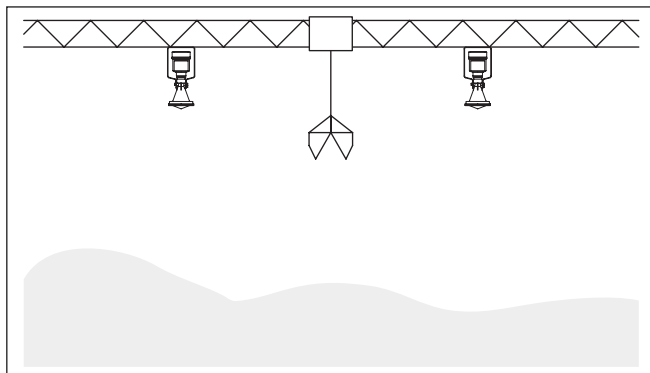


Fig. 16: Radar sensors on traverse crane

**Vessel installations**

The mounting location of the radar sensor should be a place where no other equipment or fixtures cross the path of the radar signals.

Vessel installations, such as e.g. ladders, limit switches, heating spirals, struts, etc., can cause false echoes and impair the useful echo. Make sure when planning your measuring point that the radar sensor has a "clear view" to the measured product.

In case of existing vessel installations, a false signal suppression should be carried out during setup.

If large vessel installations such as struts or supports cause false echoes, these can be attenuated through supplementary measures. Small, inclined sheet metal baffles above the installations scatter the radar signals and prevent direct interfering reflections.

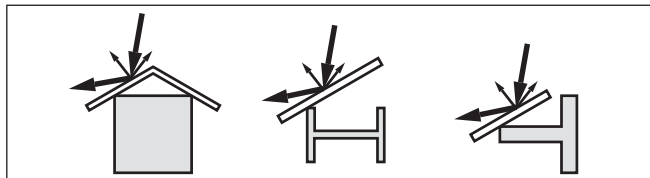


Fig. 17: Cover flat, large-area profiles with deflectors

**Agitators**

If there are agitators in the vessel, a false signal suppression should be carried out with the agitators in motion. This ensures that the interfering reflections from the agitators are saved with the blades in different positions.

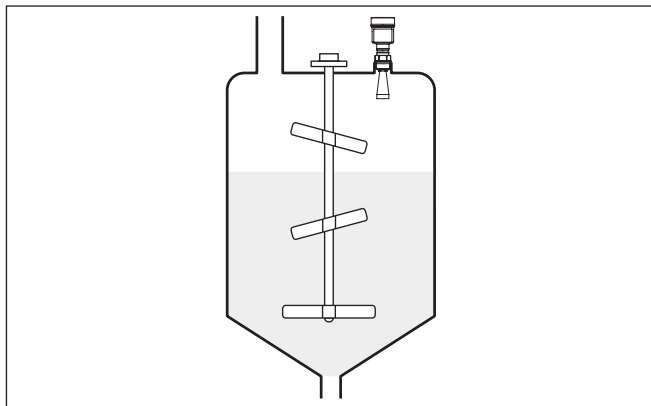


Fig. 18: Agitators

### Installation in subsurface enclosures

For level measurements in concrete silos, the sensors are often mounted in protective boxes. These boxes can be for example metallic, closed subsurface enclosures.

Minimal amounts of stray radiation from the sensor can be reflected and strengthened by the walls of the subsurface enclosures. In the case of sensors with plastic housings, this can lead to coupling disturbances. This is avoided by using sensor housings of aluminium or stainless steel as well as electromagnetic absorber material in subsurface enclosures.

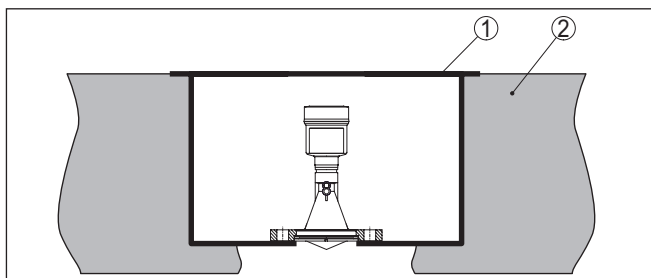


Fig. 19: Mounting of the instrument in an subsurface enclosure

- 1 Subsurface enclosure
- 2 Concrete bottom

### Mounting in multiple chamber silo

The walls of multiple-chamber silos are often made of profile material, e.g. profile sheeting, to ensure the required stability. If the radar sensor is mounted very close to a heavily structured vessel wall, substantial interfering reflections can be generated. Thus the sensor should be mounted at the largest possible distance from the separating wall.

The optimum mounting position is on the outer wall of the silo with the sensor oriented towards the outlet in the silo center.



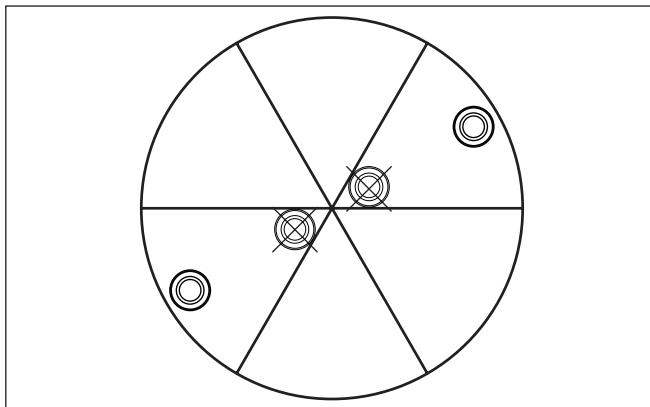


Fig. 20: Installation and orientation in multiple chamber silos

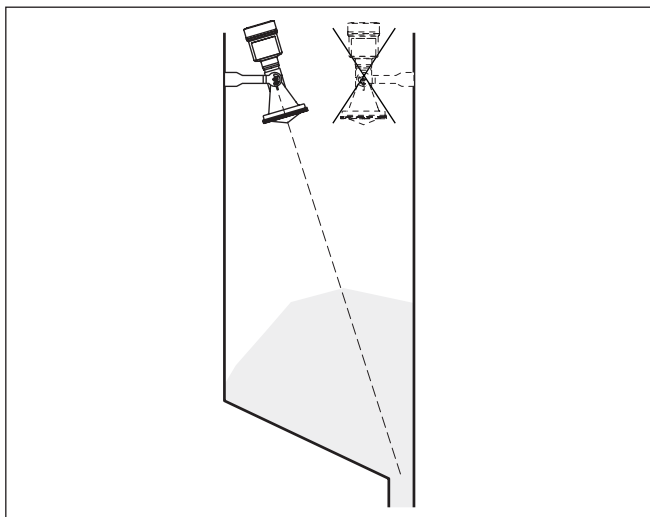


Fig. 21: Installation and orientation in multiple chamber silos

### Air rinsing

Air rinsing is useful for avoiding buildup, particularly when there is strong condensation. Since VEGAPULS 67 has no direct rinsing air connection, a separate rinsing air connection must be provided in the mounting socket. By inclining this connection towards the top, a particularly effective cleaning of the antenna cover is achieved.

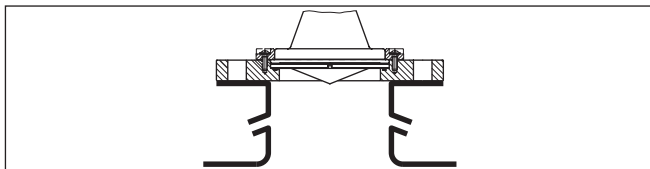


Fig. 22: Purging air connection

## 5 Connecting to power supply

### 5.1 Connection of the battery charger

We recommended charging the integrated accumulator completely before setting up the instrument. You can find the charging time in chapter "*Technical data*".

The battery charger is plugged into a socket in the supply room, see chapter "*Wiring plan*".

The LEDs in the supply room show the charging process and condition of the accumulator, see chapter "*Wiring plan*".

#### Cable glands

##### Metric threads

In the case of instrument housings with metric thread, the cable glands are screwed in at the factory. They are sealed with plastic plugs as transport protection.

You have to remove these plugs before electrical connection.

##### NPT thread

In the case of instrument housings with self-sealing NPT threads, it is not possible to have the cable entries screwed in at the factory. The free openings for the cable glands are therefore covered with red dust protection caps as transport protection.

Prior to setup you have to replace these protective caps with approved cable glands or close the openings with suitable blind plugs.

On plastic housings, the NPT cable gland or the Conduit steel tube must be screwed into the threaded insert without grease.

Max. torque for all housings, see chapter "*Technical data*".

#### Cable screening and grounding

If screened cable is required, we recommend connecting the cable screen on both ends to ground potential. In the sensor, the screen must be connected directly to the internal ground terminal. The ground terminal on the outside of the housing must be connected to the ground potential (low impedance).

In Ex systems, the grounding is carried out according to the installation regulations.

#### Overview

### 5.2 Wiring plan

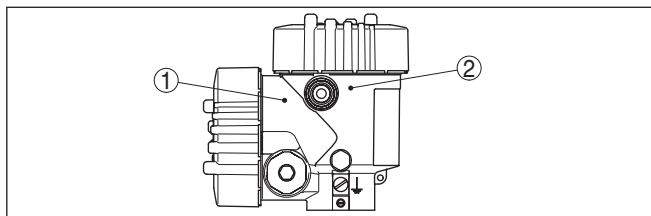


Fig. 23: Position of the power supply and electronics compartment

- 1 Supply room (accumulator)
- 2 Electronics compartment

## Electronics compartment

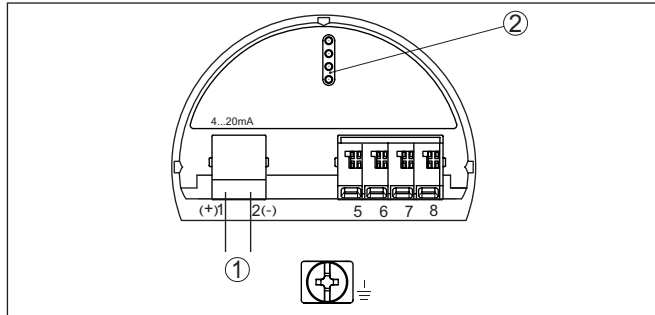


Fig. 24: Electronics compartment - double chamber housing

- 1 Internal connection to the connection compartment
- 2 Contact pins for the display and adjustment module

## Supply room

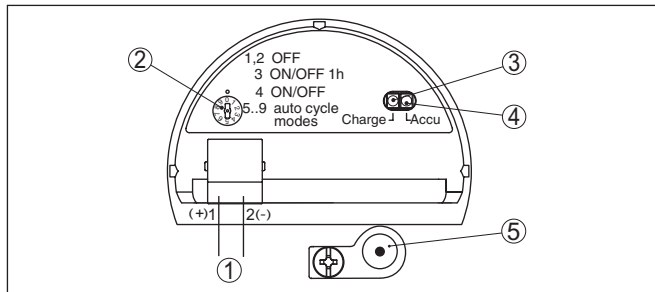


Fig. 25: Supply room

- 1 Internal connection of the socket for the battery charger
- 2 Mode switch
- 3 LED green, charging process
- 4 LED yellow, charging status
- 5 Socket for the battery charger

The mode switch enables the selection of the following modes:

- 0 = sensor off, LEDs show the accumulator status
- 1, 2 = sensor off, LEDs off
- 3 = sensor on for 1 hour after pressing a key (delivery status)
- 4 = sensor permanently on, switching on/off via button
- 5 = sensor is switched on every 30 minutes for 3 minutes
- 6 = sensor is switched on every hour for 3 min.
- 7 = sensor is switched on every 6 hours for 3 minutes
- 8 = sensor is switched on every 12 hours for 3 minutes
- 9 = sensor is switched on every 24 hours for 3 minutes

The green LED characterizes the charging process:

- LED flashes = Accumulator is charging
- LED lights = accumulator is full, battery charger should be unplugged (accumulator life time)

After pressing the key or changing the mode the yellow LED shows the accumulator status for approximately 10 s as follows:

- LED lights = accumulator is full
- LED flashes = accumulator should be charged
- LED off = accumulator is empty

### 5.3 Switch-on phase

The instrument is switched on and off by means of a button outside on the housing.

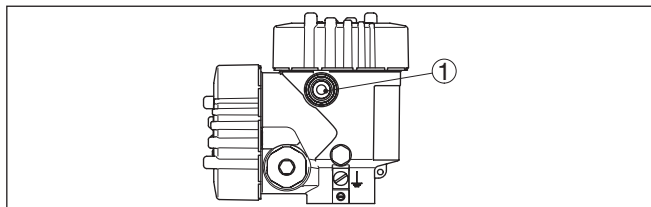


Fig. 26: Switch on/off button outside on the housing

1 On/Off button

After switching on, the instrument carries out a self-check for approximately 30 s:

- Internal check of the electronics
- Indication of a status message, e.g. "*F 105 Determine measured value*" on the display

Then the actual measured value is output to the signal cable. The value takes into account settings that have already been carried out, e.g. default setting.

## 6 Set up with the display and adjustment module

### 6.1 Insert display and adjustment module

The display and adjustment module can be inserted into the sensor and removed again at any time. You can choose any one of four different positions - each displaced by 90°. It is not necessary to interrupt the power supply.

Proceed as follows:

1. Unscrew the housing lid
2. Place the display and adjustment module on the electronics in the desired position and turn it to the right until it snaps in.
3. Screw housing lid with inspection window tightly back on

Disassembly is carried out in reverse order.

The display and adjustment module is powered by the sensor, an additional connection is not necessary.



Fig. 27: Installing the display and adjustment module in the electronics compartment of the single chamber housing

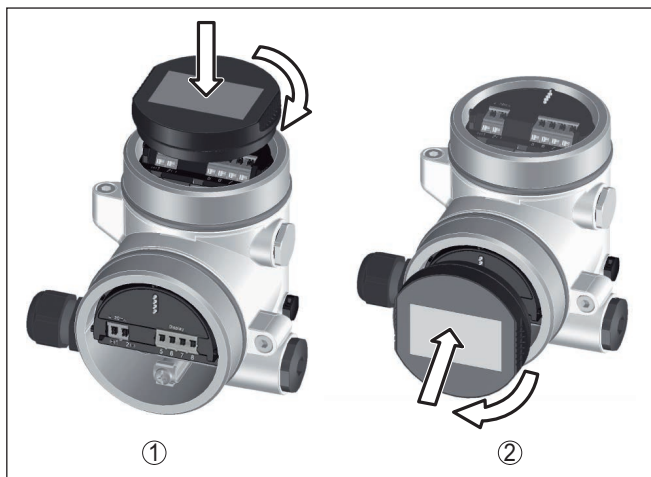


Fig. 28: Installing the display and adjustment module in the double chamber housing

- 1 In the electronics compartment
- 2 In the connection compartment



**Note:**

If you intend to retrofit the instrument with a display and adjustment module for continuous measured value indication, a higher lid with an inspection glass is required.

## 6.2 Adjustment system

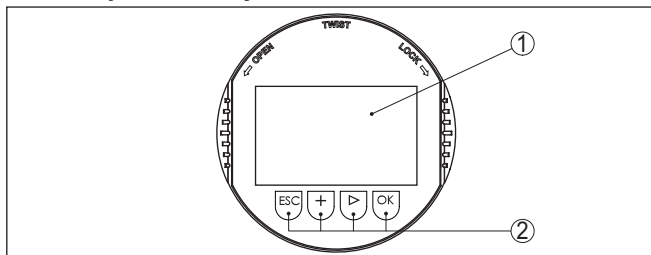


Fig. 29: Display and adjustment elements

- 1 LC display
- 2 Adjustment keys

### Key functions

- **[OK]** key:
  - Move to the menu overview
  - Confirm selected menu
  - Edit parameter
  - Save value
- **[->]** key:
  - Change measured value presentation
  - Select list entry

- Select menu items in the quick-setup menu
- Select editing position
- **[+]** key:
  - Change value of the parameter
- **[ESC]** key:
  - Interrupt input
  - Jump to next higher menu

### Operating system - Keys direct

The instrument is operated via the four keys of the display and adjustment module. The individual menu items are shown on the LC display. You can find the function of the individual keys in the previous illustration.

### Adjustment system - keys via magnetic pen

With the Bluetooth version of the display and adjustment module you can also adjust the instrument with the magnetic pen. The pen operates the four keys of the display and adjustment module right through the closed lid (with inspection window) of the sensor housing.

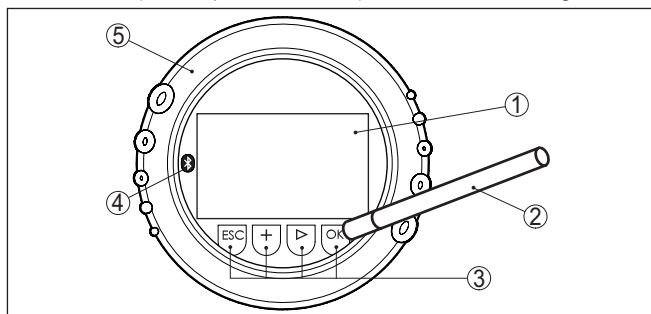


Fig. 30: Display and adjustment elements - with adjustment via magnetic pen

- 1 LC display
- 2 Magnetic pen
- 3 Adjustment keys
- 4 Bluetooth symbol
- 5 Lid with inspection window

### Time functions

When the **[+]** and **[>]** keys are pressed quickly, the edited value, or the cursor, changes one value or position at a time. If the key is pressed longer than 1 s, the value or position changes continuously.

When the **[OK]** and **[ESC]** keys are pressed simultaneously for more than 5 s, the display returns to the main menu. The menu language is then switched over to "English".

Approx. 60 minutes after the last pressing of a key, an automatic reset to measured value indication is triggered. Any values not confirmed with **[OK]** will not be saved.

## 6.3 Measured value indication - Selection of national language

### Measured value indication

 
With the **[>]** key you move between three different indication modes.



In the first view, the selected measured value is displayed in large digits.

In the second view, the selected measured value and a corresponding bar graph presentation are displayed.

In the third view, the selected measured value as well as a second selectable value, e.g. the temperature of the electronics, are displayed.



During the initial setup of an instrument shipped with factory settings, use the "OK" key to get to the menu "National language".

### Selection of national language

This menu item is used to select the national language for further parameter adjustment. You can change the selection via the menu item "Setup - Display, Menu language".



 
With the "OK" key you move to the main menu.

## 6.4 Parameter adjustment

The instrument is adapted to the application conditions via the parameter adjustment. The parameter adjustment is carried out with an adjustment menu.

### Main menu

The main menu is divided into five sections with the following functions:



**Setup:** Settings, e.g., for measurement loop name, medium, application, vessel, adjustment, signal output

**Display:** Settings, e.g., for language, measured value display, lighting

**Diagnostics:** Information, e.g. on instrument status, pointer, measurement reliability, simulation, echo curve

**Further settings:** Instrument unit, false signal suppression, linearisation curve, reset, date/time, reset, copy function

**Info:** Instrument name, hardware and software version, date of manufacture, instrument features



### Information:

In this operating instructions manual, the instrument-specific parameters in the menu sections "Setup", "Diagnostics" and "Additional settings" are described. The general parameters in these menu sections are described in the operating instructions manual "Display and adjustment module".

In the operating instructions manual "*Display and adjustment module*" you can also find the description of menu sections "*Display*" and "*Info*".

In the main menu item "*Setup*", the individual submenu items should be selected one after the other and provided with the correct parameters to ensure optimum adjustment of the measurement. The procedure is described in the following.

 
### Setup - Measurement loop name

In the menu item "*Sensor TAG*" you edit a twelve-digit measurement loop designation.

You can enter an unambiguous designation for the sensor, e.g. the measurement loop name or the tank or product designation. In digital systems and in the documentation of larger plants, a singular designation must be entered for exact identification of individual measuring points.

The available digits include:


- Letters from A ... Z
- Numbers from 0 ... 9
- Special characters +, -, /, -



### Setup - Medium

Every medium has different reflective properties. With liquids, there are additional interfering factors such as turbulent product surface and foam generation. With bulk solids, the additional interfering factors are dust generation, angle of repose and secondary echoes from the vessel wall.

To adapt the sensor to these different measuring conditions, the selection "*Liquid*" or "*Bulk solid*" should be made in this menu item.

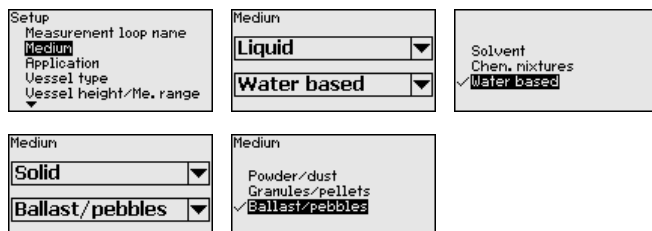


Through this selection, the sensor is optimally adapted to the product, and measurement reliability, particularly in products with poor reflective properties, is considerably increased.

Enter the requested parameters via the appropriate keys, save your settings with **[OK]** and jump to the next menu item with the **[ESC]** and the **[>]** key.




### Setup - Application

 In addition to the medium, also the application, i.e. the measuring site, can influence the measurement.

With this menu item, the sensor can be adapted to the applications. The adjustment possibilities depend on the selection "*Liquid*" or "*Bulk solid*" under "*Medium*".



   The following options are available when "*Liquid*" is selected:





**Note:**

Probably the operation of the instrument in the following applications is subject to national restrictions in respect to the radio license (see chapter "*For your safety*"):

- Plastic tank
- Transportable plastic tank
- Open water
- Open flume
- Rain water spillover

  The following options are available when "*Bulk solid*" is selected:



Following the characteristics of the applications and the metrological features of the sensor with application "*Bulk solids*" are described.

**Silo (slender and high):**

- Vessel of metal: weld joints
- Process/measurement conditions:
  - Filling aperture too close to the sensor
  - System noise in completely empty silo increased
- Properties, sensor:
  - Stable measured values through higher averaging
  - False signal suppression during setup recommended, required for automatic false signal suppression
  - Automatic false signal suppression with partly filled vessel<sup>1)</sup>

**Bunker (large-volume):**

- Vessel of concrete or metal:
  - Structured vessel walls
  - Installations present
- Process/measurement conditions:

<sup>1)</sup> The instrument recognizes if a manual false signal suppression was carried out with empty vessel and high system noise. An automatic false signal suppression is then carried out if a product echo was detected at the beginning of the filling process.

- Large distance to the medium
- Large angles of repose
- Properties, sensor:
  - Mean averaging
  - High measured value jumps are accepted

**Bunker with fast filling:**

- Vessel of concrete or metal, also multiple chamber silo:
  - Structured vessel walls
  - Installations present
- Process/measurement conditions:
  - Measured value jumps, e.g. through truck loading
  - Large distance to the medium
  - Large angles of repose
- Properties, sensor:
  - Lower averaging
  - Very high measured value jumps are accepted

**Heap:**

- Sensor mounting on movable conveyor belts
- Detection of the heap profile
- Height detection during filling
- Process/measurement conditions:
  - Measured value jumps, e.g. by the profile of the heap or traverses
  - Large angles of repose
  - Measurement near the filling stream
- Properties, sensor:
  - Mean averaging
  - High measured value jumps are accepted

**Crusher:**

- Vessel: installations, wear and protective facilities available
- Process/measurement conditions:
  - Measured value jumps, e.g. through truck loading
  - Fast reaction time
  - Large distance to the medium
- Properties, sensor:
  - Little averaging
  - Max. reaction speed, very high measured value jumps are accepted

 
**Demonstration:**

- Adjustment for all applications which are not typically level measurement
  - Instrument demonstration
  - Object recognition/monitoring (additional settings required)
- Properties, sensor:
  - Sensor accepts all measured value changes within the measuring range immediately
  - High sensitivity to interference, because virtually no averaging

Enter the requested parameters via the appropriate keys, save your settings with **[OK]** and jump to the next menu item with the **[ESC]** and the **[→]** key.

### Setup - Vessel form

Apart from the medium and the application, the vessel form itself can influence the measurement. To adapt the sensor to these measuring conditions, this menu item offers different options for vessel bottom for certain applications.




Enter the requested parameters via the appropriate keys, save your settings with **[OK]** and jump to the next menu item with the **[ESC]** and the **[→]** key.

### Setup - Vessel height, measuring range

 Through this selection the operating range of the sensor is adapted to the vessel height, which considerably increases measurement reliability under different basic conditions.

The min. adjustment must be carried out independently of this.



Enter the requested parameters via the appropriate keys, save your settings with **[OK]** and jump to the next menu item with the **[ESC]** and the **[→]** key.

### Setup - Adjustment

Since the radar sensor is a distance measuring instrument, it is the distance from the sensor to the product surface that is measured. To indicate the actual level, the measured distance must be assigned to a certain height percentage.

To perform the adjustment, enter the distance with full and empty vessel, see the following example:

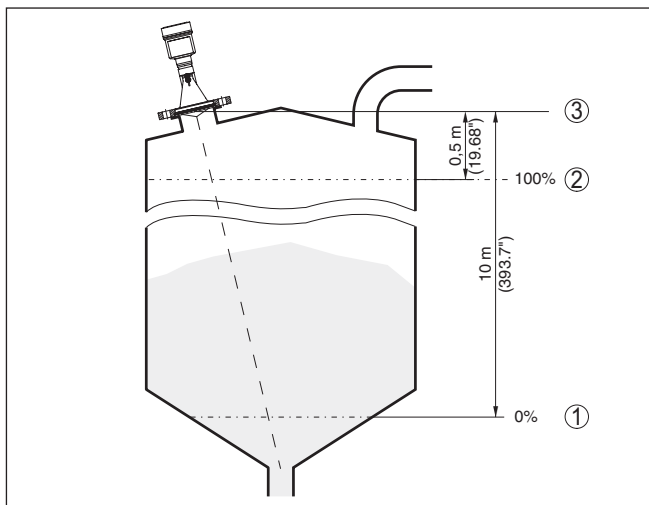


Fig. 31: Parameterisation example, Min./max. adjustment

- 1 Min. level = max. measuring distance
- 2 Max. level = min. measuring distance


If these values are not known, an adjustment with the distances of e.g. 10 % and 90 % is possible. Starting point for these distance specifications is always the sealing surface of the flange. You can find further specifications on the reference plane in the chapters "Mounting instructions" and "Technical data". The actual level is calculated on the basis of these settings.

The actual product level during this adjustment is not important, because the min./max. adjustment is always carried out without changing the product level. These settings can be made ahead of time without the instrument having to be installed.


## Setup - Min. adjustment

 Proceed as follows:


1. Select the menu item "Setup" with [ $\rightarrow$ ] and confirm with [OK].  
Now select with [ $\rightarrow$ ] the menu item "Min. adjustment" and confirm with [OK].



 2. Edit the percentage value with [OK] and set the cursor to the requested position with [ $\rightarrow$ ].



 3. Set the requested percentage value with [+] and save with [OK].  
The cursor jumps now to the distance value.





4. Enter the suitable distance value in m for empty vessel (e.g. distance from the sensor to the vessel bottom) corresponding to the percentage value.
5. Save settings with **[OK]** and move with **[ESC]** and **[>]** to the max. adjustment.


### Setup - Max. adjustment

  Proceed as follows:


1. Select with **[>]** the menu item Max. adjustment and confirm with **[OK]**.



 2. Prepare the percentage value for editing with **[OK]** and set the cursor to the requested position with **[>]**.





 
3. Set the requested percentage value with **[+]** and save with **[OK]**. The cursor jumps now to the distance value.



4. Enter the appropriate distance value in m (corresponding to the percentage value) for the full vessel. Keep in mind that the max. level must lie below the min. distance to the antenna edge.
5. Save settings with **[OK]**

### Setup - Damping

 
 
 
To damp process-dependent measured value fluctuations, set an integration time of 0 ... 999 s in this menu item.




Depending on the sensor type, the factory setting is 0 s or 1 s.

### Setup - Current output, mode

    In the menu item "Current output mode" you determine the output characteristics and reaction of the current output in case of fault.






The default setting is output characteristics 4 ... 20 mA, fault mode < 3.6 mA.

### Setup - Current output Min./Max.


In the menu item "Current output Min./Max.", you determine the reaction of the current output during operation.

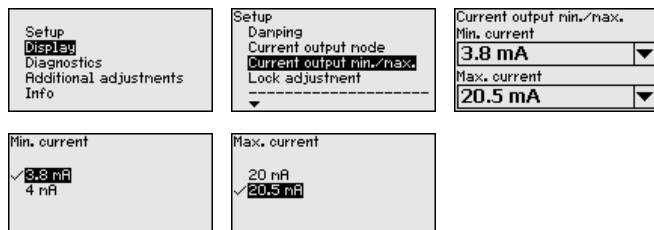

The default setting is min. current 3.8 mA and max. current 20.5 mA.

### Setup - Lock adjustment

 In this menu item, the PIN is activated/deactivated permanently. Entering a 4-digit PIN protects the sensor data against unauthorized access and unintentional modifications. If the PIN is activated permanently, it can be deactivated temporarily (i.e. for approx. 60 min.) in any menu item.



Only the following functions are permitted with activated PIN:

- Select menu items and show data
- Read data from the sensor into the display and adjustment module




#### Caution:

When the PIN is active, adjustment via PACTware/DTM as well as other systems is also blocked.

In delivery status, the PIN is "0000".

### Display - Language

This menu item enables the setting of the requested national language.

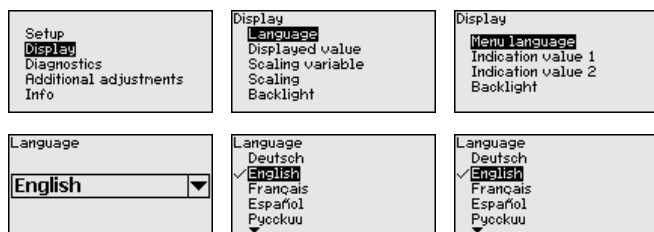



In delivery status, the sensor is set to the ordered national language.

### Display - Indicated value

In this menu item you can define the indication of the measured value on the display.

Setup <b>Display</b> Diagnostics Additional adjustments Info	Display Language <b>Displayed value</b> Scaling variable Scaling Backlight	Displayed value Distance
✓ Distance Height Percent Linear percent Scaled	Percent Linear percent ✓ Scaled Current	

The default setting for the indicated value is e.g. "Distance" on radar sensors.

### Display - Backlight

The optionally integrated background lighting can be switched on via the adjustment menu. This function depends on the level of the supply voltage, see operating instructions of the respective sensor.

Setup <b>Display</b> Diagnostics Additional adjustments Info	Display Language Displayed value Scaling variable Scaling <b>Backlight</b>	Display Menu language Indication value 1 Indication value 2 <b>Backlight</b>
--	---	--

In delivery status, the lighting is switched on.

### Diagnostics - Device status

In this menu item, the device status is displayed.

Setup Display <b>Diagnostics</b> Additional adjustments Info	Diagnostics <b>Sensor status</b> Peak values Electronics temperature Meas. reliability Simulation	Device status OK
--	--	---------------------

### Diagnostics - Peak values (distance)

The respective min. and max. measured distance values are saved in the sensor. The values are displayed in the menu item "Peak values".

Setup Display <b>Diagnostics</b> Additional adjustments Info	Diagnostics Device status <b>Peak values (Distance)</b> Electronics temperature Meas. reliability Simulation	Peak values (Distance) Min. 0.108 m Max. 12.911 m
--	---	---

 
### Diagnosis - Electronics temperature

The respective min. and max. measured values of the electronics temperature are saved in the sensor. These values as well as the current temperature value are displayed in the menu item "Peak values".

Setup Display <b>Diagnostics</b> Additional adjustments Info	Diagnostics Sensor status Peak values <b>Electronics temperature</b> Meas. reliability Simulation	Diagnostics Peak values Distance Peak indicator, reliab. <b>Peak values further</b> Echo curve Simulation
Electronics temperature Actual 28.30 °C Min. 20.40 °C Max. 32.20 °C		


### Diagnosis - Measurement reliability

When non-contact level sensors are used, the measurement can be influenced by the respective process conditions. In this menu item, the measurement reliability of the level echo is displayed as a dB value. Measurement reliability equals signal strength minus noise. The higher the value, the more reliable the measurement. A well functioning measurement normally has a value > 10 dB.



### Diagnosis - Simulation

In this menu item you can simulate measured values via the current output. This allows the signal path to be tested, e.g. through downstream indicating instruments or the input card of the control system.

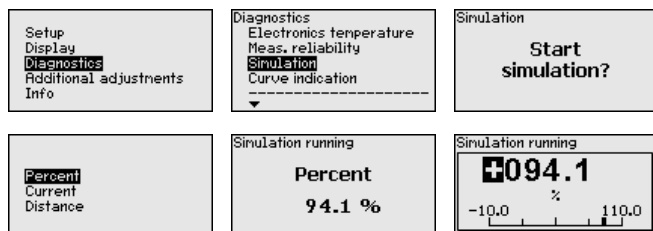

How to start the simulation:

1. Push **[OK]**
2. Select the requested simulation variable with **[->]** and confirm with **[OK]**.
3. With **[OK]** you start the simulation, first of all the actual measured value is displayed in %
4. Start the editing mode with **[OK]**
5. Set the requested numerical value with **[+]** and **[->]**.
6. Push **[OK]**



#### Note:

During simulation, the simulated value is output as 4 ... 20 mA current value and digital HART signal.

How to interrupt the simulation:

→ Push **[ESC]**

 


#### Information:

The simulation is automatically terminated 10 minutes after the last pressing of a key.


### Diagnosis - Curve indication

The "Echo curve" shows the signal strength of the echoes over the measuring range in dB. The signal strength enables an evaluation of the quality of the measurement.



The "False signal suppression" displays the saved false echoes (see menu "Additional settings") of the empty vessel with signal strength in "dB" over the entire measuring range.

 A comparison of echo curve and false signal suppression allows a more detailed statement about measurement reliability.




The selected curve is continuously updated. A submenu with zoom functions is opened with the **[OK]** key:

- "X-Zoom": Zoom function for the meas. distance
- "Y-Zoom": 1, 2, 5 and 10x signal magnification in "dB"
- "Unzoom": Reset the presentation to the nominal measuring range without magnification

### Diagnostics - Echo curve memory

 
The function "Echo curve memory" makes it possible to save the echo curve at the time of setup. This is generally recommended, and it is absolutely necessary if you want to use the Asset Management functions. If possible, the curve should be saved with a low level in the vessel.

With the adjustment software PACTware and a PC, a high resolution echo curve can be displayed and used to recognize signal changes during operation. In addition, the echo curve of setup can be displayed in the echo curve window and compared with the current echo curve.



### Additional adjustments - Instrument units

 In this menu item you select the measured variable of the system and the temperature unit.



### Additional settings - False signal suppression

The following circumstances cause interfering reflections and can influence the measurement:

- High mounting sockets
- Vessel internals such as struts
- Agitators
- Buildup or welded joints on vessel walls

 
 
 
**Note:**

A false signal suppression detects, marks and saves these false signals to ensure that they are ignored in the level measurement.

This should be done with the lowest possible level so that all potential interfering reflections can be detected.

Proceed as follows:

1. Select with **[→]** the menu item *"False signal suppression"* and confirm with **[OK]**.




2. Confirm 3-times with **[OK]** and enter the actual distance from the sensor to the product surface.
3. All interfering signals in this range are detected by the sensor and stored after being confirmed with **[OK]**.

**Note:**

 Check the distance to the product surface, because if an incorrect (too large) value is entered, the existing level will be saved as a false signal. The level would then no longer be detectable in this area.

If a false signal suppression has already been saved in the sensor, the following menu window appears when selecting *"False signal suppression"*:



**Delete:** An already created false signal suppression will be completely deleted. This is useful if the saved false signal suppression no longer matches the metrological conditions in the vessel.


**Extend:** is used to extend an already created false signal suppression. This is useful if a false signal suppression was carried out with too high a level and not all false signals could be detected. When selecting *"Extend"*, the distance to the product surface of the created false signal suppression is displayed. This value can now be changed and the false signal suppression can be extended to this range.

### Additional settings - Linearization

 A linearization is necessary for all vessels in which the vessel volume does not increase linearly with the level - e.g. a horizontal cylinder-

cal or spherical tank - and the indication or output of the volume is required. Corresponding linearization curves are preprogrammed for these vessels. They represent the correlation between the level percentage and vessel volume.

By activating the appropriate curve, the volume percentage of the vessel is displayed correctly. If the volume should not be displayed in percent but e.g. in l or kg, a scaling can be also set in the menu item "Display".



Enter the requested parameters via the appropriate keys, save your settings and jump to the next menu item with the **[ESC]** and **[→]** key.




### Caution:

Note the following if instruments with appropriate approval are used as part of an overflow protection system according to WHG:

If a linearisation curve is selected, the measuring signal is no longer necessarily linear to the filling height. This must be considered by the user especially when setting the switching point on the limit signal transmitter.

### Additional settings - PIN


Entering a 4-digit PIN protects the sensor data against unauthorized access and unintentional modification. In this menu item, the PIN is displayed or edited and changed. However, this menu item is only available if adjustment is enabled in the menu "Setup".

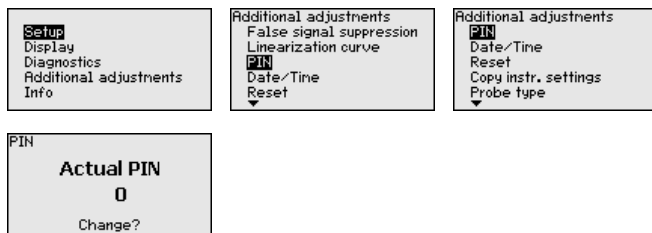

In delivery status, the PIN is "0000".


### Additional settings - Date/Time

 In this menu item, the internal clock of the sensor is set.



### Additional settings - Reset

 After a reset, certain parameter adjustments made by the user are reset.



The following reset functions are available:

**Delivery status:** Restores the parameter settings at the time of shipment from the factory, incl. order-specific settings. Any stored false signal suppression or user-programmed linearisation curve, as well as the measured value memory, are deleted.

**Basic settings:** Restores the parameter settings, incl. special parameters, to the default values of the respective instrument. Any stored false signal suppression or user-programmed linearisation curve, as well as the measured value memory, are deleted.

**Setup:** Restores the parameter settings made in the menu item Setup to the default values of the respective instrument. False signal suppression, user-programmed linearisation curve, measured value memory and event memory remain untouched. The linearisation is set to linear.

**False signal suppression:** Deletes a previously created false signal suppression. The false signal suppression created at the factory remains active.

**Peak values, measured value:** Resets the measured min. and max. distances to the current measured value.


The following table shows the default values of the instrument. Depending on the instrument version, not all menu items are available or some may be differently assigned:

Menu	Menu item	Default value
Setup	Measurement loop name	Sensor
	Medium	Liquid/Water Bulk solids/Crushed stones, gravel
	Application	Storage tank Silo
	Vessel form	Vessel bottom, dished form Vessel top, dished form
	Vessel height/Measuring range	Recommended measuring range, see "Technical data" in the supplement.
	Min. adjustment	Recommended measuring range, see "Technical data" in the supplement.
	Max. adjustment	0,000 m(d)
	Damping	0.0 s
	Current output mode	4 ... 20 mA, < 3.6 mA
	Current output, min./max.	Min. current 3.8 mA, max. current 20.5 mA
	Lock adjustment	Released

Menu	Menu item	Default value
Display	Language	Like order
	Displayed value	Distance
	Display unit	m
	Scaling size	Volume l
	Scaling	0.00 lin %, 0 l 100.00 lin %, 100 l
	Backlight	Switched on
Additional adjustments	Distance unit	m
	Temperature unit	°C
	Probe length	Length of standpipe ex factory
	Linearisation curve	Linear
	HART mode	Standard Address 0

### Additional settings - HART mode

 The sensor offers the HART modes standard and Multidrop. In this menu item you specify the HART mode and enter the address for Multidrop.



The mode "standard" with the fixed address 0 means outputting the measured value as a 4 ... 20 mA signal.

In Multidrop mode, up to 63 sensors can be operated on one two-wire cable. An address between 1 and 63 must be assigned to each sensor.<sup>2)</sup>

The default setting is standard with address 0.

### Additional settings - Copy instrument settings

 
The instrument settings are copied with this function. The following functions are available:

- Store data from sensor in the display and adjustment module.
- Store data from display and adjustment module in the sensor

The following data or settings for adjustment of the display and adjustment module are saved:

- All data of the menu "Setup" and "Display"
- In the menu "Additional settings" the items "Distance unit, temperature unit and linearization"
- The values of the user-programmable linearisation curve

<sup>2)</sup> The 4 ... 20 mA signal of the sensor is switched off. The sensor uses a constant current of 4 mA. The measuring signal is transmitted exclusively as a digital HART signal.



The copied data are permanently saved in an EEPROM memory in the display and adjustment module and remain there even in case of power failure. From there, they can be written into one or more sensors or kept as backup for a possible sensor exchange.

The type and the volume of the copied data depend on the respective sensor.




### Note:

 Before the data are stored in the sensor, a check is carried out to determine if the data fit the sensor. If the data do not fit, a fault signal is triggered or the function is blocked. When data are being written into the sensor, the display shows which instrument type the data originate from and which TAG-no. this sensor had.


### Info - Instrument name

In this menu, you read out the instrument name and the instrument serial number:




### Info - Instrument version

 In this menu item, the hardware and software version of the sensor is displayed.




### Info - Date of manufacture

 In this menu item, the date of factory calibration of the sensor as well as the date of the last change of sensor parameters are displayed via the display and adjustment module or via the PC.



### Instrument features

 In this menu item, the features of the sensor such as approval, process fitting, seal, measuring range, electronics, housing and others are displayed.





## 6.5 Saving the parameterisation data

### On paper

We recommended writing down the adjustment data, e.g. in this operating instructions manual, and archiving them afterwards. They are thus available for multiple use or service purposes.

### In the display and adjustment module

If the instrument is equipped with a display and adjustment module, the parameter adjustment data can be saved therein. The procedure is described in menu item "*Copy device settings*".

## 7 Setup with PACTware

### 7.1 Connect the PC

Via the interface adapter  
directly on the sensor

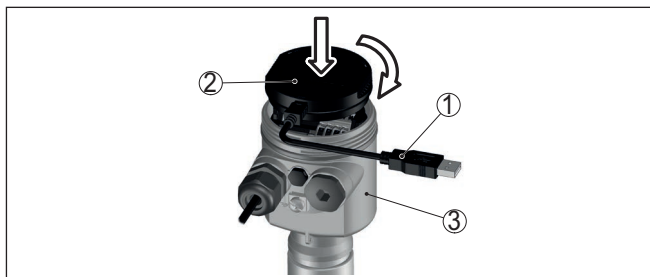


Fig. 32: Connection of the PC directly to the sensor via the interface adapter

- 1 USB cable to the PC
- 2 Interface adapter VEGACONNECT
- 3 Sensor

Via the interface adapter  
and HART

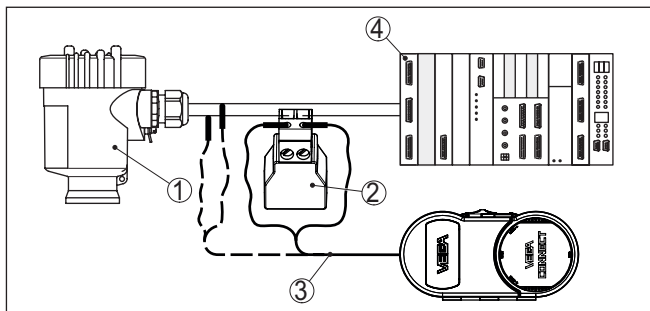


Fig. 33: Connecting the PC via HART to the signal cable

- 1 Sensor
- 2 HART resistance 250  $\Omega$  (optional depending on evaluation)
- 3 Connection cable with 2 mm pins and terminals
- 4 Processing system/PLC/Voltage supply
- 5 Interface adapter, for example VEGACONNECT 4



#### Note:

With power supply units with integrated HART resistance (internal resistance approx. 250  $\Omega$ ), an additional external resistance is not necessary. This applies, e.g. to the VEGA instruments VEGATRENN 149A, VEGAMET 381, VEGAMET 391. Common Ex separators are also usually equipped with a sufficient current limiting resistance. In such cases, the interface converter can be connected parallel to the 4 ... 20 mA cable (dashed line in the previous illustration).

### 7.2 Parameter adjustment

#### Prerequisites

For parameter adjustment of the instrument via a Windows PC, the configuration software PACTware and a suitable instrument driver

(DTM) according to FDT standard are required. The latest PACTware version as well as all available DTMs are compiled in a DTM Collection. The DTMs can also be integrated into other frame applications according to FDT standard.



### Note:

To ensure that all instrument functions are supported, you should always use the latest DTM Collection. Furthermore, not all described functions are included in older firmware versions. You can download the latest instrument software from our homepage. A description of the update procedure is also available in the Internet.

Further setup steps are described in the operating instructions manual "DTM Collection/PACTware" attached to each DTM Collection and which can also be downloaded from the Internet. Detailed descriptions are available in the online help of PACTware and the DTMs.

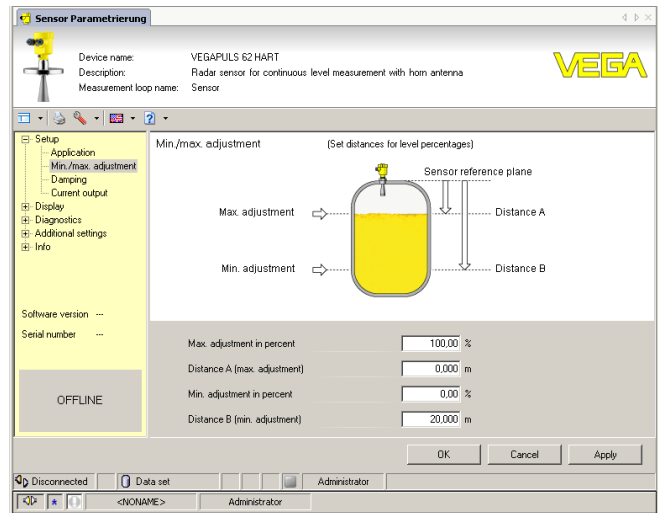


Fig. 34: Example of a DTM view

## Standard/Full version

All device DTMs are available as a free-of-charge standard version and as a full version that must be purchased. In the standard version, all functions for complete setup are already included. An assistant for simple project configuration simplifies the adjustment considerably. Saving/printing the project as well as import/export functions are also part of the standard version.

In the full version there is also an extended print function for complete project documentation as well as a save function for measured value and echo curves. In addition, there is a tank calculation program as well as a multiviewer for display and analysis of the saved measured value and echo curves.

The standard version is available as a download under [www.vega.com/downloads](http://www.vega.com/downloads) and "Software". The full version is available on CD from the agency serving you.

### **7.3 Saving the parameterisation data**

We recommend documenting or saving the parameterisation data via PACTware. That way the data are available for multiple use or service purposes.

## 8 Set up with other systems

### 8.1 DD adjustment programs

Device descriptions as Enhanced Device Description (EDD) are available for DD adjustment programs such as, for example, AMS™ and PDM.

The files can be downloaded at [www.vega.com/downloads](http://www.vega.com/downloads) under "Software".

### 8.2 Field Communicator 375, 475

Device descriptions for the instrument are available as EDD for parameterisation with Field Communicator 375 or 475.

Integrating the EDD into the Field Communicator 375 or 475 requires the "Easy Upgrade Utility" software, which is available from the manufacturer. This software is updated via the Internet and new EDDs are automatically accepted into the device catalogue of this software after they are released by the manufacturer. They can then be transferred to a Field Communicator.

## 9 Diagnosis, asset management and service

### 9.1 Maintenance

#### Maintenance

If the device is used properly, no special maintenance is required in normal operation.

#### Precaution measures against buildup

In some applications, buildup on the antenna system can influence the measuring result. Depending on the sensor and application, take measures to avoid heavy soiling of the antenna system. If necessary, clean the antenna system in certain intervals.

#### Cleaning

The cleaning helps that the type label and markings on the instrument are visible.

Take note of the following:

- Use only cleaning agents which do not corrode the housings, type label and seals
- Use only cleaning methods corresponding to the housing protection rating

### 9.2 Measured value and event memory

The instrument has several memories available for diagnostic purposes. The data remain there even in case of voltage interruption.

#### Measured value memory

Up to 100,000 measured values can be stored in the sensor in a ring memory. Each entry contains date/time as well as the respective measured value. Storable values are for example:

- Distance
- Filling height
- Percentage value
- Lin. percent
- Scaled
- Current value
- Measurement reliability
- Electronics temperature

When the instrument is shipped, the measured value memory is active and stores distance, measurement reliability and electronics temperature every 3 minutes.

The requested values and recording conditions are set via a PC with PACTware/DTM or the control system with EDD. Data are thus read out and also reset.

#### Event memory

Up to 500 events are automatically stored with a time stamp in the sensor (non-deletable). Each entry contains date/time, event type, event description and value. Event types are for example:

- Modification of a parameter
- Switch-on and switch-off times
- Status messages (according to NE 107)
- Error messages (according to NE 107)

The data are read out via a PC with PACTware/DTM or the control system with EDD.

## Echo curve memory

The echo curves are stored with date and time and the corresponding echo data. The memory is divided into two sections:

**Echo curve of the setup:** This is used as reference echo curve for the measurement conditions during setup. Changes in the measurement conditions during operation or buildup on the sensor can thus be recognized. The echo curve of the setup is stored via:

- PC with PACTware/DTM
- Control system with EDD
- Display and adjustment module

**Further echo curves:** Up to 10 echo curves can be stored in a ring buffer in this memory section. Additional echo curves are stored via:

- PC with PACTware/DTM
- Control system with EDD

## 9.3 Asset Management function

The instrument features self-monitoring and diagnostics according to NE 107 and VDI/VDE 2650. In addition to the status messages in the following tables, detailed error messages are available under menu item "Diagnostics" via the display and adjustment module, PACTware/DTM and EDD.

## Status messages

The status messages are divided into the following categories:

- Failure
- Function check
- Out of specification
- Maintenance requirement

and explained by pictographs:

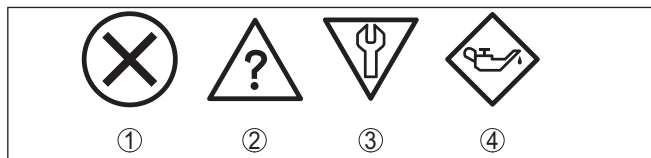


Fig. 35: Pictographs of the status messages

- 1 Failure - red
- 2 Out of specification - yellow
- 3 Function check - orange
- 4 Maintenance - blue

**Failure:** Due to a malfunction in the instrument, a fault message is output.

This status message is always active. It cannot be deactivated by the user.

**Function check:** The instrument is being worked on, the measured value is temporarily invalid (for example during simulation).

This status message is inactive by default. It can be activated by the user via PACTware/DTM or EDD.

**Out of specification:** The measured value is unreliable because an instrument specification was exceeded (e.g. electronics temperature).

This status message is inactive by default. It can be activated by the user via PACTware/DTM or EDD.

**Maintenance:** Due to external influences, the instrument function is limited. The measurement is affected, but the measured value is still valid. Plan in maintenance for the instrument because a failure is expected in the near future (e.g. due to buildup).

This status message is inactive by default. It can be activated by the user via PACTware/DTM or EDD.

## Failure

Code Text message	Cause	Rectification	DevSpec State in CMD 48
F013 no measured value available	<ul style="list-style-type: none"> <li>● Sensor does not detect an echo during operation</li> <li>● Antenna system dirty or defective</li> </ul>	<ul style="list-style-type: none"> <li>● Check or correct installation and/or parameter settings</li> <li>● Clean or exchange process component or antenna</li> </ul>	Bit 0 of Byte 0 ... 5
F017 Adjustment span too small	<ul style="list-style-type: none"> <li>● Adjustment not within specification</li> </ul>	<ul style="list-style-type: none"> <li>● Change adjustment according to the limit values (difference between min. and max. <math>\geq 10</math> mm)</li> </ul>	Bit 1 of Byte 0 ... 5
F025 Error in the linearisation table	<ul style="list-style-type: none"> <li>● Index markers are not continuously rising, for example illogical value pairs</li> </ul>	<ul style="list-style-type: none"> <li>● Check linearisation table</li> <li>● Delete table/Create new</li> </ul>	Bit 2 of Byte 0 ... 5
F036 No operable software	<ul style="list-style-type: none"> <li>● Failed or interrupted software update</li> </ul>	<ul style="list-style-type: none"> <li>● Repeat software update</li> <li>● Check electronics version</li> <li>● Exchanging the electronics</li> <li>● Send instrument for repair</li> </ul>	Bit 3 of Byte 0 ... 5
F040 Error in the electronics	<ul style="list-style-type: none"> <li>● Hardware defect</li> </ul>	<ul style="list-style-type: none"> <li>● Exchanging the electronics</li> <li>● Send instrument for repair</li> </ul>	Bit 4 of Byte 0 ... 5
F080 General software error	<ul style="list-style-type: none"> <li>● General software error</li> </ul>	<ul style="list-style-type: none"> <li>● Disconnect operating voltage briefly</li> </ul>	Bit 5 of Byte 0 ... 5
F105 Determine measured value	<ul style="list-style-type: none"> <li>● The instrument is still in the start phase, the measured value could not yet be determined</li> </ul>	<ul style="list-style-type: none"> <li>● Wait for the end of the switch-on phase</li> <li>● Duration up to approx. 3 minutes depending on the version and parameter settings</li> </ul>	Bit 6 of Byte 0 ... 5
F113 Communication error	<ul style="list-style-type: none"> <li>● EMC interference</li> <li>● Transmission error during external communication with 4-wire power supply unit</li> </ul>	<ul style="list-style-type: none"> <li>● Remove EMC influences</li> </ul>	Bit 12 of Byte 0 ... 5
F125 Impermissible electronics temperature	<ul style="list-style-type: none"> <li>● Temperature of the electronics in the non-specified range</li> </ul>	<ul style="list-style-type: none"> <li>● Check ambient temperature</li> <li>● Insulate electronics</li> <li>● Use instrument with higher temperature range</li> </ul>	Bit 7 of Byte 0 ... 5



Code Text message	Cause	Rectification	DevSpec State in CMD 48
F260 Error in the calibration	<ul style="list-style-type: none"> <li>● Error in the calibration carried out in the factory</li> <li>● Error in the EEPROM</li> </ul>	<ul style="list-style-type: none"> <li>● Exchanging the electronics</li> <li>● Send instrument for repair</li> </ul>	Bit 8 of Byte 0 ... 5
F261 Error in the instrument settings	<ul style="list-style-type: none"> <li>● Error during setup</li> <li>● False signal suppression faulty</li> <li>● Error when carrying out a reset</li> </ul>	<ul style="list-style-type: none"> <li>● Repeat setup</li> <li>● Carry out a reset</li> </ul>	Bit 9 of Byte 0 ... 5
F264 Installation/Setup error	<ul style="list-style-type: none"> <li>● Adjustment not within the vessel height/measuring range</li> <li>● Max. measuring range of the instrument not sufficient</li> </ul>	<ul style="list-style-type: none"> <li>● Check or correct installation and/or parameter settings</li> <li>● Use an instrument with bigger measuring range</li> </ul>	Bit 10 of Byte 0 ... 5
F265 Measurement function disturbed	<ul style="list-style-type: none"> <li>● Sensor no longer carries out a measurement</li> <li>● Operating voltage too low</li> </ul>	<ul style="list-style-type: none"> <li>● Check operating voltage</li> <li>● Carry out a reset</li> <li>● Disconnect operating voltage briefly</li> </ul>	Bit 11 of Byte 0 ... 5

## Function check

Code Text message	Cause	Rectification	DevSpec State in CMD 48
C700 Simulation active	<ul style="list-style-type: none"> <li>● A simulation is active</li> </ul>	<ul style="list-style-type: none"> <li>● Finish simulation</li> <li>● Wait for the automatic end after 60 mins.</li> </ul>	"Simulation Active" in "Standardized Status 0"

## Out of specification

Code Text message	Cause	Rectification	DevSpec State in CMD 48
S600 Impermissible electronics temperature	<ul style="list-style-type: none"> <li>● Temperature of the electronics in the non-specified range</li> </ul>	<ul style="list-style-type: none"> <li>● Check ambient temperature</li> <li>● Insulate electronics</li> <li>● Use instrument with higher temperature range</li> </ul>	Bit 5 of Byte 14 ... 24
S601 Overfilling	<ul style="list-style-type: none"> <li>● Danger of vessel overfilling</li> </ul>	<ul style="list-style-type: none"> <li>● Make sure that there is no further filling</li> <li>● Check level in the vessel</li> </ul>	Bit 6 of Byte 14 ... 24

Tab. 6: Error codes and text messages, information on causes as well as corrective measures

## Maintenance

Code Text message	Cause	Rectification	DevSpec State in CMD 48
M500 Error during the reset "delivery status"	<ul style="list-style-type: none"> <li>● The data could not be restored during the reset to delivery status</li> </ul>	<ul style="list-style-type: none"> <li>● Repeat reset</li> <li>● Load XML file with sensor data into the sensor</li> </ul>	Bit 0 of Byte 14 ... 24
M501 Error in the non-active linearisation table	<ul style="list-style-type: none"> <li>● Hardware error EEPROM</li> </ul>	<ul style="list-style-type: none"> <li>● Exchanging the electronics</li> <li>● Send instrument for repair</li> </ul>	Bit 1 of Byte 14 ... 24

Code Text message	Cause	Rectification	DevSpec State in CMD 48
M502 Error in the diagnostics memory	<ul style="list-style-type: none"> <li>● Hardware error EEPROM</li> </ul>	<ul style="list-style-type: none"> <li>● Exchanging the electronics</li> <li>● Send instrument for repair</li> </ul>	Bit 2 of Byte 14 ... 24
M503 Measurement reliability too low	<ul style="list-style-type: none"> <li>● The echo/noise ratio is too small for reliable measurement</li> </ul>	<ul style="list-style-type: none"> <li>● Check installation and process conditions</li> <li>● Clean the antenna</li> <li>● Change polarisation direction</li> <li>● Use instrument with higher sensitivity</li> </ul>	Bit 3 of Byte 14 ... 24
M504 Error at a device interface	<ul style="list-style-type: none"> <li>● Hardware defect</li> </ul>	<ul style="list-style-type: none"> <li>● Check connections</li> <li>● Exchanging the electronics</li> <li>● Send instrument for repair</li> </ul>	Bit 4 of Byte 14 ... 24
M505 No echo available	<ul style="list-style-type: none"> <li>● Level echo can no longer be detected</li> </ul>	<ul style="list-style-type: none"> <li>● Clean the antenna</li> <li>● Use a more suitable antenna/sensor</li> <li>● Remove possible false echoes</li> <li>● Optimize sensor position and orientation</li> </ul>	Bit 7 of Byte 14 ... 24

Tab. 7: Error codes and text messages, information on causes as well as corrective measures

## 9.4 Rectify faults

### Reaction when malfunction occurs

The operator of the system is responsible for taking suitable measures to rectify faults.

### Procedure for fault rectification

The first measures are:

- Evaluation of fault messages via the adjustment device
- Checking the output signal
- Treatment of measurement errors


Further comprehensive diagnostics options are available with a PC with PACTware and the suitable DTM. In many cases, the reasons can be determined in this way and faults rectified.

### Treatment of measurement errors with bulk solids

The below tables show typical examples of application-related measurement errors with bulk solids. A distinction is made between measurement errors during:

- Constant level
- Filling
- Emptying

The images in column "Error pattern" show the real level as a broken line and the level displayed by the sensor as a continuous line.

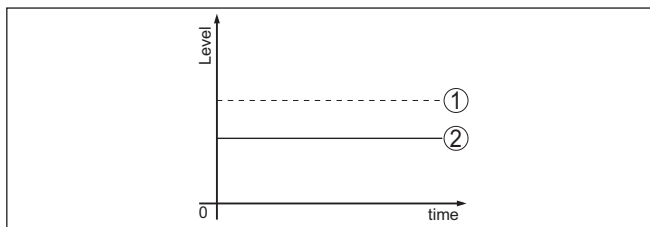
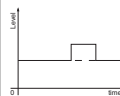


- 1 Real level  
2 Level displayed by the sensor


Notes:



- Whenever the sensor displays a constant value, the reason could also be that the fault setting of the current output is set to "Hold value"
- If the level indication is too low, the reason could be a line resistance that is too high

Measurement error with constant level


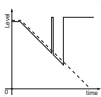
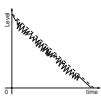
Fault description	Cause	Rectification
1. Measured value shows a too low or too high level 	• Min./max. adjustment not correct	• Adapt min./max. adjustment
	• Incorrect linearisation curve	• Adapt linearisation curve
2. Measured value jumps towards 100 % 	• Due to the process, the amplitude of the product echo decreases • A false signal suppression was not carried out	• Carry out a false signal suppression
	• Amplitude or position of a false signal has changed (e.g. condensation, buildup); false signal suppression no longer matches actual conditions	• Determine the reason for the changed false signals, carry out false signal suppression, e.g. with condensation

Measurement error during filling

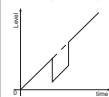Fault description	Cause	Rectification
3. Measured value jumps towards 0 % during filling 	• Amplitude of a multiple echo (vessel top - product surface) is larger than the level echo	• Check parameter "Application", especially vessel top, type of medium, dished bottom, high dielectric constant, and adapt if necessary
	• The level echo cannot be distinguished from the false signal at a false signal position (jumps to multiple echo)	• Remove/reduce false signal: minimize interfering installations by changing the polarization direction • Chose a more suitable installation position
	• Transverse reflection from an extraction funnel, amplitude of the transverse reflection larger than the level echo	• Direct sensor to the opposite funnel wall, avoid crossing with the filling stream

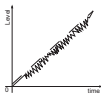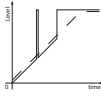Fault description	Cause	Rectification
4. Measured value fluctuates around 10 ... 20 % 	<ul style="list-style-type: none"> <li>Various echoes from an uneven product surface, e.g. a material cone</li> </ul>	<ul style="list-style-type: none"> <li>Check parameter "Type of medium" and adapt, if necessary</li> <li>Optimize installation position and sensor orientation</li> </ul>
5. Measured value jumps sporadically to 100 % during filling 	<ul style="list-style-type: none"> <li>Reflections from the product surface via the vessel wall (deflection)</li> </ul>	<ul style="list-style-type: none"> <li>Select a more suitable installation position, optimize sensor orientation, e.g. with a swivelling holder</li> </ul>
	<ul style="list-style-type: none"> <li>Changing condensation or contamination on the antenna</li> </ul>	<ul style="list-style-type: none"> <li>Carry out a false signal suppression or increase false signal suppression with condensation/contamination in the close range by editing</li> <li>With bulk solids use radar sensor with purging air connection or flexible antenna cover</li> </ul>

### Measurement error during emptying

Fault description	Cause	Rectification
6. Measured value remains unchanged in the close range during emptying 	<ul style="list-style-type: none"> <li>False signal larger than the level echo</li> <li>Level echo too small</li> </ul>	<ul style="list-style-type: none"> <li>Eliminate false signals in the close range. Check: Antenna must protrude out of the socket</li> <li>Remove contamination on the antenna</li> <li>Minimize interfering installations in the close range by changing the polarization direction</li> <li>After eliminating the false signals, the false signal suppression must be deleted. Carry out a new false signal suppression</li> </ul>
7. Measured value jumps sporadically towards 100 % during emptying 	<ul style="list-style-type: none"> <li>Changing condensation or contamination on the antenna</li> </ul>	<ul style="list-style-type: none"> <li>Carry out false signal suppression or increase false signal suppression in the close range by editing</li> <li>With bulk solids use radar sensor with purging air connection or flexible antenna cover</li> </ul>
8. Measured value fluctuates around 10 ... 20 % 	<ul style="list-style-type: none"> <li>Various echoes from an uneven product surface, e.g. an extraction funnel</li> <li>Reflections from the product surface via the vessel wall (deflection)</li> </ul>	<ul style="list-style-type: none"> <li>Check parameter "Type of medium" and adapt, if necessary</li> <li>Optimize installation position and sensor orientation</li> </ul>

### Reaction after fault rectification

Depending on the reason for the fault and the measures taken, the steps described in chapter "Setup" must be carried out again or must be checked for plausibility and completeness.

### 24 hour service hotline

Should these measures not be successful, please call in urgent cases the VEGA service hotline under the phone no. **+49 1805 858550**.

The hotline is also available outside normal working hours, seven days a week around the clock.

Since we offer this service worldwide, the support is provided in English. The service itself is free of charge, the only costs involved are the normal call charges.

## 9.5 Exchanging the electronics module

If the electronics module is defective, it can be replaced by the user.



In Ex applications, only instruments and electronics modules with appropriate Ex approval may be used.

If there is no electronics module available on site, the electronics module can be ordered through the agency serving you. The electronics modules are adapted to the respective sensor and differ in signal output or voltage supply.

The new electronics module must be loaded with the default settings of the sensor. These are the options:

- In the factory
- Or on site by the user

In both cases, the serial number of the sensor is needed. The serial numbers are stated on the type label of the instrument, on the inside of the housing as well as on the delivery note.

When loading on site, the order data must first be downloaded from the Internet (see operating instructions "*Electronics module*").



### Caution:

All application-specific settings must be entered again. That's why you have to carry out a fresh setup after exchanging the electronics.

If you saved the parameter settings during the first setup of the sensor, you can transfer them to the replacement electronics module. A fresh setup is then not necessary.

## 9.6 Software update

The device software can be updated in the following ways:

- Interface adapter VEGACONNECT
- HART signal
- Bluetooth

Depending on the method, the following components are required:

- Instrument
- Voltage supply
- Interface adapter VEGACONNECT
- Display and adjustment module PLICSCOM with Bluetooth function
- PC with PACTware/DTM and Bluetooth USB adapter
- Current instrument software as file

You can find the current instrument software as well as detailed information on the procedure in the download area of our homepage: [www.vega.com](http://www.vega.com).

**Caution:**

Instruments with approvals can be bound to certain software versions. Therefore make sure that the approval is still effective after a software update is carried out.

You can find detailed information in the download area at [www.vega.com](http://www.vega.com).

## 9.7 How to proceed if a repair is necessary

You can find an instrument return form as well as detailed information about the procedure in the download area of our homepage: [www.vega.com](http://www.vega.com). By doing this you help us carry out the repair quickly and without having to call back for needed information.

In case of repair, proceed as follows:

- Print and fill out one form per instrument
- Clean the instrument and pack it damage-proof
- Attach the completed form and, if need be, also a safety data sheet outside on the packaging
- Ask the agency serving you to get the address for the return shipment. You can find the agency on our home page [www.vega.com](http://www.vega.com).

## 10 Dismount

### 10.1 Dismounting steps

**Warning:**

Before dismantling, be aware of dangerous process conditions such as e.g. pressure in the vessel or pipeline, high temperatures, corrosive or toxic products etc.

Take note of chapters "*Mounting*" and "*Connecting to voltage supply*" and carry out the listed steps in reverse order.

### 10.2 Disposal

The instrument consists of materials which can be recycled by specialised recycling companies. We use recyclable materials and have designed the electronics to be easily separable.

**WEEE directive**

The instrument does not fall in the scope of the EU WEEE directive. Article 2 of this Directive exempts electrical and electronic equipment from this requirement if it is part of another instrument that does not fall in the scope of the Directive. These include stationary industrial plants.

Pass the instrument directly on to a specialised recycling company and do not use the municipal collecting points.

**Battery/accumulator recycling****Note:**

The disposal is subject to the EU directive on batteries and accumulators.

Batteries and accumulators contain some environmentally harmful but also some valuable raw materials that can be recycled. For that reason batteries and accumulators must not be disposed of in household waste.

All users are legally obligated to bring spent batteries to a suitable collection point, e.g. public collection points. You can also return the batteries and accumulators to us for correct disposal. Due to the very strict transport regulations for lithium-based batteries/accumulators, this is normally not a good idea because shipment is very expensive.

Proceed as follows to dismantle the accumulator:

- Unscrew the cover of the supply room
- Loosen the plug connector
- Loosen the fixing screws
- Pull out the complete insert by means of the plastic strap

If you have no way to dispose of the old instrument properly, please contact us concerning return and disposal.

## 11 Supplement

### 11.1 Technical data

#### Note for approved instruments

The technical data in the respective safety instructions are valid for approved instruments (e.g. with Ex approval). These data can differ from the data listed herein - for example regarding the process conditions or the voltage supply.

#### General data

316L corresponds to 1.4404 or 1.4435

#### Materials, wetted parts

##### Sensor

- |                        |                                   |
|------------------------|-----------------------------------|
| – Adapter flange       | PP-GF30 black                     |
| – Seal, adapter flange | FKM (COG VI500), EPDM (COG AP310) |
| – Focussing lense      | PP                                |

##### Material, wetted parts rinsing connection

- |                                   |  |
|-----------------------------------|--|
| – Flushing ring                   | PP-GFK                                   |
| – O-ring seal, rinsing connection | FKM (SHS FPM 70C3 GLT), EPDM (COG AP310) |
| – Reflux valve                    | 316 Ti                                   |
| – Sealing, reflux valve           | FKM (SHS FPM 70C3 GLT), EPDM (COG AP310) |

#### Materials, non-wetted parts

##### Mounting parts

- |                                 |               |
|---------------------------------|---------------|
| – Antenna cone                  | PBT-GF 30     |
| – Compression flange            | PP-GF30 black |
| – Mounting strap                | 316L          |
| – Fixing screws, mounting strap | 316L          |
| – Fixing screws, adapter flange | 304           |

##### Housing

- |  |  |
|--|--|
| – Plastic housing                      | Plastic PBT (Polyester)  |
| – Aluminium die-cast housing           | Aluminium die-casting AlSi10Mg, powder-coated (Basis: Polyester) |
| – Stainless steel housing              | 316L   |
| – Cable gland                          | PA, stainless steel, brass                                       |
| – Sealing: cable gland                 | NBR  |
| – Blind plug: cable gland              | PA   |
| – Seal between housing and housing lid | Silicone SI 850 R, NBR silicone-free                             |
| – Inspection window housing cover      | Polycarbonate (UL-746-C listed), glass <sup>3)</sup>             |
| – Ground terminal                      | 316L   |

Weight depending on process fitting and housing material 0.7 ... 3.4 kg (1.543 ... 7.496 lbs)

<sup>3)</sup> Glass with Aluminium and stainless steel precision casting housing



## Torques

### Max. torques

- Mounting screws, mounting strap on sensor housing 4 Nm (2.950 lbf ft)
- Flange screws, compression flange DN 80 5 Nm (3.689 lbf ft)
- Terminal screws, adapter flange - antenna 2.5 Nm (1.844 lbf ft)
- Flange screws, adapter flange DN 100 7 Nm (5.163 lbf ft)

### Max. torques for NPT cable glands and Conduit tubes

- Plastic housing 10 Nm (7.376 lbf ft)
- Aluminium/Stainless steel housing 50 Nm (36.88 lbf ft)

## Input variable

### Measured variable

The measured quantity is the distance between the end of the sensor antenna and the product surface. The reference plane for the measurement is the lower side of the flange.

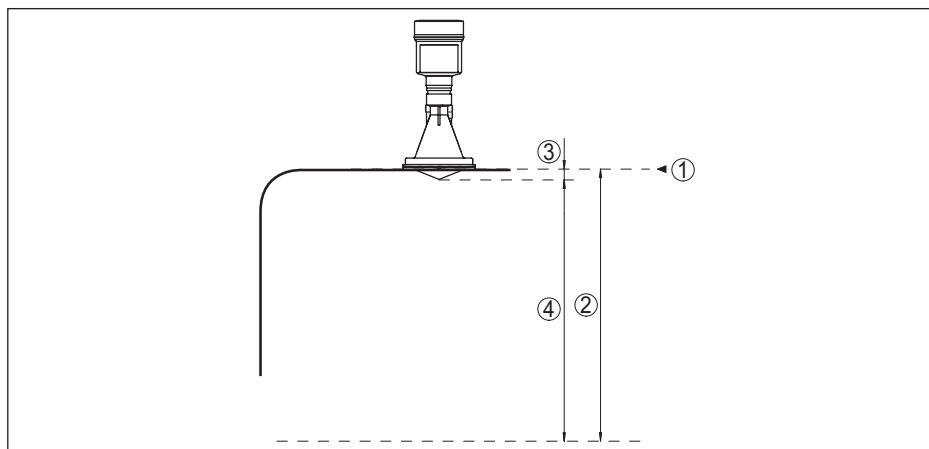


Fig. 45: Data of the input variable

- 1 Reference plane
- 2 Measured variable, max. measuring range
- 3 Antenna length
- 4 Utilisable measuring range

Max. measuring range	15 m (49.21 ft)
Recommended measuring range	up to 15 m (49.21 ft)

## Deviation (according to DIN EN 60770-1)

### Process reference conditions according to DIN EN 61298-1

- Temperature +18 ... +30 °C (+64 ... +86 °F)
- Relative humidity 45 ... 75 %

– Air pressure	860 ... 1060 mbar/86 ... 106 kPa (12.5 ... 15.4 psig)
Installation reference conditions	
– Min. distance to internal installations	> 200 mm (7.874 in)
– Reflector	Flat plate reflector
– False reflections	Biggest false signal, 20 dB smaller than the useful signal
Deviation with liquids	≤ 2 mm (meas. distance > 1.0 m/3.280 ft)
Non-repeatability <sup>4)</sup>	≤ 1 mm
Deviation with bulk solids	The values depend to a great extent on the application. Binding specifications are thus not possible.

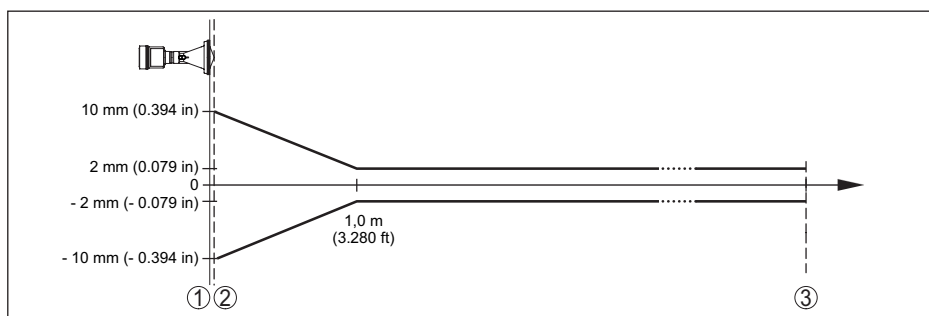


Fig. 46: Deviation under reference conditions

- 1 Reference plane  
2 Antenna edge  
3 Recommended measuring range

## Characteristics and performance data

Measuring frequency	K-band (26 GHz technology)
Measuring cycle time approx.	700 ms
Step response time <sup>5)</sup>	≤ 3 s
Beam angle <sup>6)</sup>	10°
Emitted HF power (depending on the parameter setting) <sup>7)</sup>	
– Average spectral transmission power density	-14 dBm/MHz EIRP
– Max. spectral transmission power density	+43 dBm/50 MHz EIRP
– Max. power density at a distance of 1 m	< 1 μW/cm <sup>2</sup>

## Ambient conditions

Ambient, storage and transport temperature	-40 ... +80 °C (-40 ... +176 °F)
--	----------------------------------

<sup>4)</sup> Already included in the meas. deviation

<sup>5)</sup> Time span after a sudden measuring distance change by max. 0.5 m in liquid applications, max 2 m with bulk solids applications, until the output signal has taken for the first time 90 % of the final value (IEC 61298-2).

<sup>6)</sup> Outside the specified beam angle, the energy level of the radar signal is 50% (-3 dB) less.

<sup>7)</sup> EIRP: Equivalent Isotropic Radiated Power.

## Process conditions

Process temperature (measured on the process fitting)	-40 ... +80 °C (-40 ... +176 °F)
Vessel pressure	-1 ... 2 bar (-100 ... 200 kPa/-14.5 ... 29.0 psig)
Vessel pressure - Version with adapter flange from DN 100 PP or PP-GF 30	-1 ... 1 bar (-100 ... 100 kPa/-14.5 ... 14.5 psig)
Vibration resistance	
– With adapter flange	2 g at 5 ... 200 Hz according to EN 60068-2-6 (vibration with resonance)
– with mounting strap	1 g at 5 ... 200 Hz according to EN 60068-2-6 (vibration with resonance)
Shock resistance	100 g, 6 ms according to EN 60068-2-27 (mechanical shock)

## Display and adjustment module

Display element	Display with backlight
Measured value indication	
– Number of digits	5
Adjustment elements	
– 4 keys	<b>[OK], [-&gt;], [+], [ESC]</b>
– Switch	Bluetooth On/Off
Bluetooth interface	
– Standard	Bluetooth smart
– Effective range	25 m (82.02 ft)
Protection rating	
– unassembled	IP 20
– Mounted in the housing without lid	IP 40
Materials	
– Housing	ABS
– Inspection window	Polyester foil
Functional safety	SIL non-reactive

## Display and adjustment elements, power pack

Display elements	
– Green LED in the supply room	Indication of the charging process
– Yellow LED in the supply room	Indication of the charging condition
Adjustment elements	
– Rotary switch in the supply room	Selection of the mode
– Button outside on the housing	Switching on and off

## Integrated clock

Date format	Day.Month.Year
Time format	12 h/24 h

Time zone, factory setting	CET
Max. rate deviation	10.5 min/year

---

**Additional output parameter - Electronics temperature**


---

Range	-40 ... +85 °C (-40 ... +185 °F)
Resolution	< 0.1 K
Deviation	±3 K
Output of the temperature values	
– Indication	Via the display and adjustment module
– Analogue	Via the current output, the additional current output
– Digital	Via the digital output signal (depending on the electronics version)

---

**Potential connections and electrical separating measures in the instrument**


---

Electronics	Not non-floating
Reference voltage <sup>8)</sup>	500 V AC
Conductive connection	Between ground terminal and metallic process fitting

---

**External battery charger**


---

Mains voltage	100 ... 240 V AC
Output voltage	24 V DC
Max. output current (short-circuit proof)	500 mA
Load current limitation	70 mA
DC plug (inside plus, outside minus)	2.1 mm

---

**Integrated accumulator**


---

Type	Lithium ions
Voltage	14.8 V
Accumulator capacity	4.7 Wh
Charging period from 0 % to 100 %	approx. 4 h
Operating time after 10 minutes charging of 0 %	> 3 h
Operating time in mode 4 (sensor permanently on) with completely charged accumulator	> 60 h
Temperature range	
– Charge accumulator	0 ... +45° C (+32 ... +167 °F)
– Accumulator operation	-20 ... +60° C (-4 ... +140 °F)
Temperature derating accumulator capacity	
– +25° C (+77 °F)	100 %
– -10° C (+14 °F)	50 %

<sup>8)</sup> Galvanic separation between electronics and metal housing parts

## Electrical protective measures

Protection, depending on housing version

- Plastic housing IEC 60529 IP 66/IP 67 (NEMA Type 4X)
- Aluminium housing; stainless steel housing - precision casting IEC 60529 IP 66/IP 68 (0.2 bar), NEMA Type 6P

Connection of the feeding power supply unit to networks of overvoltage category III

Pollution degree<sup>9)</sup> 4

Protection rating (IEC 61010-1) III

## 11.2 Dimensions

The following dimensional drawings represent only an extract of all possible versions. Detailed dimensional drawings can be downloaded at [www.vega.com/downloads](http://www.vega.com/downloads) under "Drawings".

### Housing

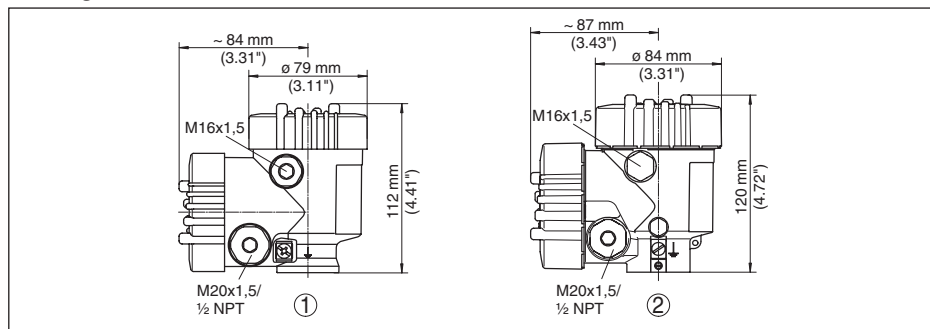


Fig. 47: Dimensions housing (with integrated display and adjustment module the housing is 9 mm/0.35 in higher, with metal housings 18 mm/0.71 in)

1 Plastic double chamber

2 Aluminium/Stainless steel double chamber

<sup>9)</sup> When used with fulfilled housing protection

VEGAPULS 67, version with mounting strap

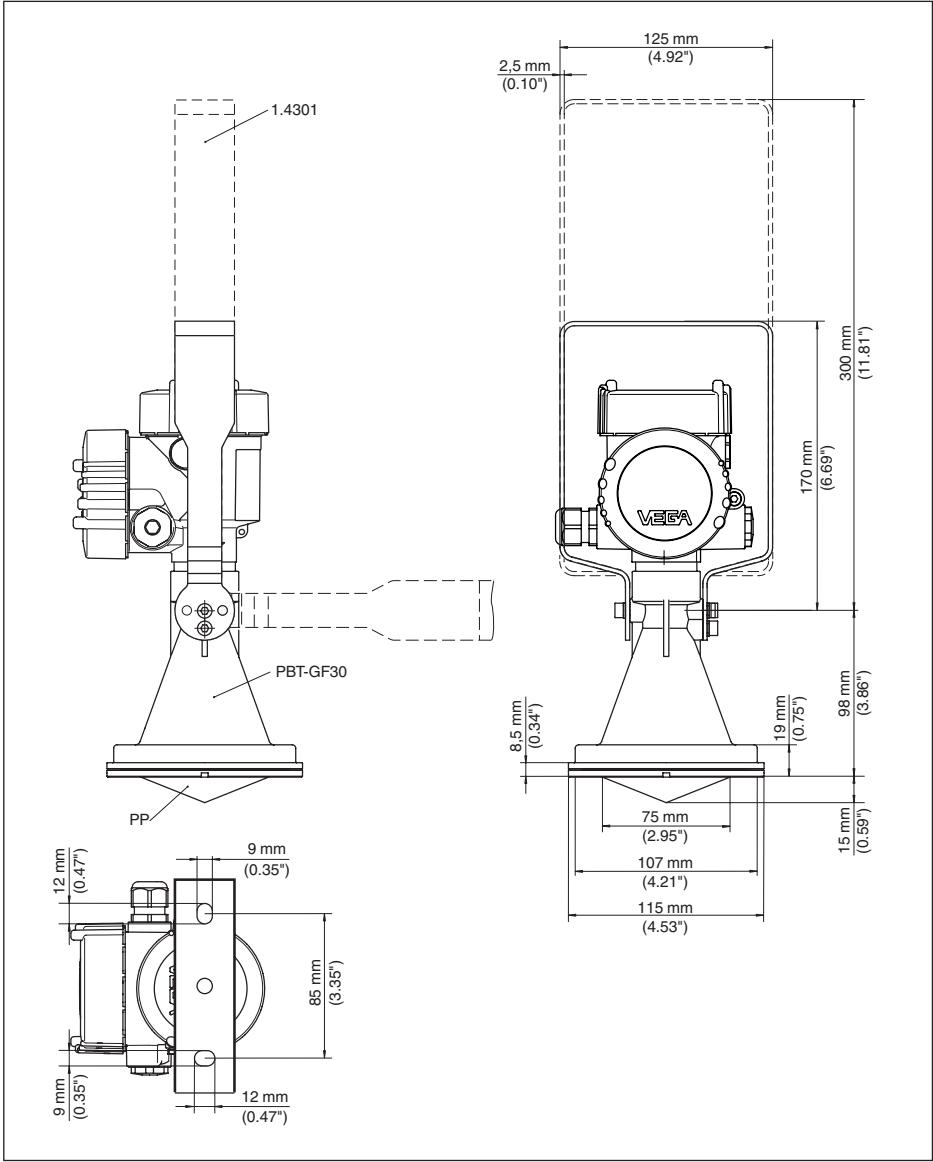
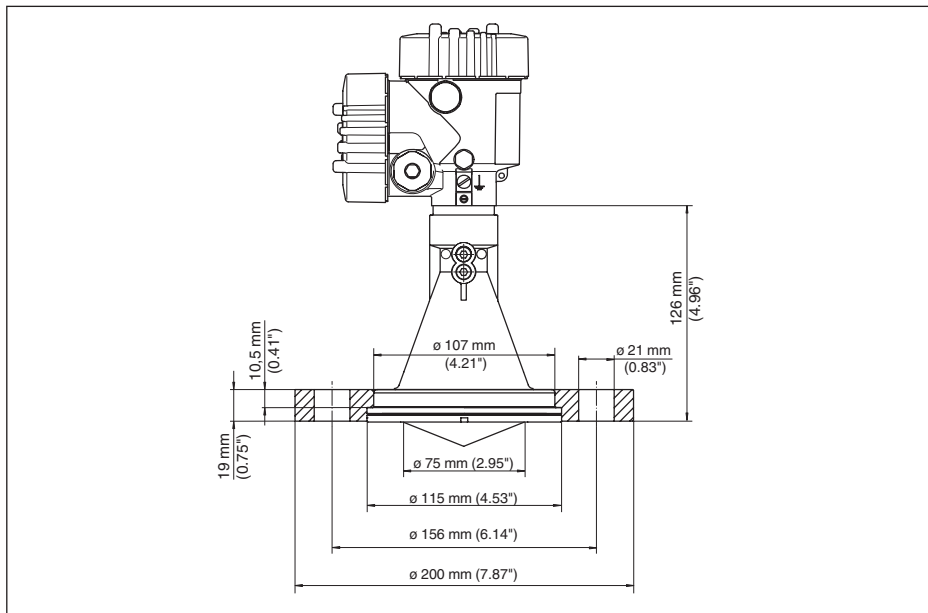


Fig. 48: VEGAPULS 67, with mounting strap

**VEGAPULS 67, version with compression flange**



*Fig. 49: VEGAPULS 67, compression flange suitable for DN 80 PN 16, ASME 3" 150lbs, JIS80 10K*

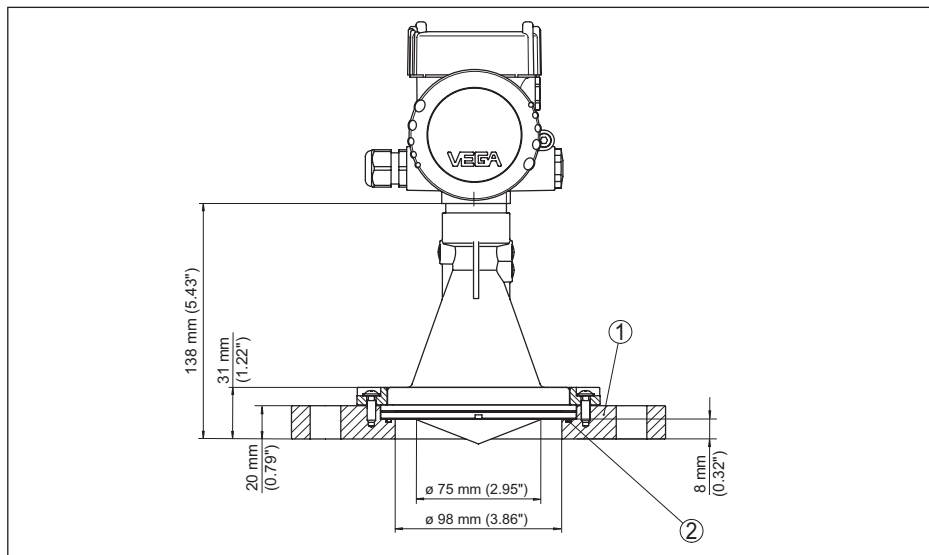
**VEGAPULS 67, version with adapter flange**

Fig. 50: VEGAPULS 67, adapter flange

- 1 Adapter flange
- 2 Seal



### 11.3 Industrial property rights

VEGA product lines are global protected by industrial property rights. Further information see [www.vega.com](http://www.vega.com).

VEGA Produktfamilien sind weltweit geschützt durch gewerbliche Schutzrechte.

Nähere Informationen unter [www.vega.com](http://www.vega.com).

Les lignes de produits VEGA sont globalement protégées par des droits de propriété intellectuelle. Pour plus d'informations, on pourra se référer au site [www.vega.com](http://www.vega.com).

VEGA lineas de productos están protegidas por los derechos en el campo de la propiedad industrial. Para mayor información revise la pagina web [www.vega.com](http://www.vega.com).

Линии продукции фирмы ВЕГА защищаются по всему миру правами на интеллектуальную собственность. Дальнейшую информацию смотрите на сайте [www.vega.com](http://www.vega.com).

VEGA系列产品在全球享有知识产权保护。

进一步信息请参见网站[www.vega.com](http://www.vega.com)。

### 11.4 Trademark

All the brands as well as trade and company names used are property of their lawful proprietor/originator.

## INDEX

### A

Adjustment 38, 39  
– System 32  
Agitator 23

### B

Backlight 41

### C

Copy instrument settings 47  
Current output, min./max. 40  
Current output mode 39

### D

Damping 39  
Date/Time 45  
Default values 46  
Deviation 58

### E

Echo curve 43  
EDD (Enhanced Device Description) 53  
Electronics compartment 28  
Electronics temperature 41  
Error codes 57  
Event memory 54

### F

False signal suppression 43  
Fault rectification 58

### G

Grounding 27

### H

HART 50  
HART mode 47

### I

Instrument units 43  
Instrument version 48

### L

Language 40  
Linearisation curve 44  
Lock adjustment 40

### M

Main menu 33  
Measured value memory 54

Measurement loop name 34  
Measurement reliability 42  
Mounting socket 19

### N

NAMUR NE 107 55, 56, 57

### O

Overfill protection according to WHG 45

### P

Peak value indicator 41  
PIN 45

### R

Reflection properties, medium 34  
Repair 62  
Replacement parts  
– Supplementary electronics for power pack 13  
Reset 45

### S

Sensor status 41  
Service hotline 60  
Shielding 27  
Simulation 42  
Subsurface enclosure 24

### V

Vessel form 37  
Vessel height 37  
Vessel installations 23  
Voltage supply 11



Printing date:

# VEGA

All statements concerning scope of delivery, application, practical use and operating conditions of the sensors and processing systems correspond to the information available at the time of printing.

Subject to change without prior notice

© VEGA Grieshaber KG, Schiltach/Germany 2018



40795-EN-181127

VEGA Grieshaber KG  
Am Hohenstein 113  
77761 Schiltach  
Germany

Phone +49 7836 50-0  
Fax +49 7836 50-201  
E-mail: [info.de@vega.com](mailto:info.de@vega.com)  
[www.vega.com](http://www.vega.com)