

# Operating Instructions

Radiometric sensor for density  
measurement

## MINITRAC 31

Foundation Fieldbus



Document ID: 41782



# VEGA

## Contents

<b>1</b>	<b>About this document .....</b>	<b>4</b>
1.1	Function .....	4
1.2	Target group .....	4
1.3	Symbols used.....	4
<b>2</b>	<b>For your safety .....</b>	<b>5</b>
2.1	Authorised personnel .....	5
2.2	Appropriate use.....	5
2.3	Warning about incorrect use.....	5
2.4	General safety instructions .....	5
2.5	EU conformity.....	6
2.6	NAMUR recommendations .....	6
2.7	Installation and operation in the USA and Canada .....	6
2.8	Environmental instructions .....	6
<b>3</b>	<b>Product description .....</b>	<b>7</b>
3.1	Configuration.....	7
3.2	Principle of operation.....	8
3.3	Packaging, transport and storage.....	10
3.4	Accessories.....	10
3.5	Corresponding source container .....	12
<b>4</b>	<b>Mounting.....</b>	<b>14</b>
4.1	General instructions .....	14
4.2	Mounting instructions .....	15
<b>5</b>	<b>Connecting to power supply.....</b>	<b>21</b>
5.1	Preparing the connection .....	21
5.2	Connection - Density, mass flow rate measurement .....	24
5.3	Connection - Level detection .....	27
<b>6</b>	<b>Set up with the display and adjustment module .....</b>	<b>30</b>
6.1	Insert display and adjustment module .....	30
6.2	Adjustment system .....	31
6.3	Parameter adjustment - Level measurement .....	32
6.4	Parameter adjustment - Density measurement .....	36
6.5	Parameter adjustment - Point level detection.....	48
6.6	Parameter adjustment - X-ray alarm .....	58
6.7	Parameter adjustment - Real value correction .....	60
6.8	Saving the parameterisation data.....	62
<b>7</b>	<b>Setup with PACTware .....</b>	<b>63</b>
7.1	Connect the PC.....	63
7.2	Parameter adjustment with PACTware .....	63
7.3	Saving the parameterisation data .....	64
<b>8</b>	<b>Set up with other systems .....</b>	<b>65</b>
8.1	DD adjustment programs .....	65
8.2	Field Communicator 375, 475 .....	65
<b>9</b>	<b>Diagnostics and servicing .....</b>	<b>66</b>
9.1	Maintenance .....	66
9.2	Status messages.....	66

9.3	Rectify faults.....	69
9.4	Exchanging the electronics module.....	70
9.5	Software update .....	71
9.6	How to proceed if a repair is necessary.....	71
<b>10</b>	<b>Dismount.....</b>	<b>73</b>
10.1	Dismounting steps.....	73
10.2	Disposal .....	73
<b>11</b>	<b>Supplement .....</b>	<b>74</b>
11.1	Technical data .....	74
11.2	Device communication Foundation Fieldbus.....	79
11.3	Dimensions .....	83
11.4	Industrial property rights.....	86
11.5	Trademark .....	86



## Safety instructions for Ex areas

Take note of the Ex specific safety instructions for Ex applications. These instructions are attached as documents to each instrument with Ex approval and are part of the operating instructions.

Editing status: 2021-11-25

# 1 About this document

## 1.1 Function

This instruction provides all the information you need for mounting, connection and setup as well as important instructions for maintenance, fault rectification, the exchange of parts and the safety of the user. Please read this information before putting the instrument into operation and keep this manual accessible in the immediate vicinity of the device.

## 1.2 Target group

This operating instructions manual is directed to trained personnel. The contents of this manual must be made available to the qualified personnel and implemented.

## 1.3 Symbols used



### Document ID

This symbol on the front page of this instruction refers to the Document ID. By entering the Document ID on [www.vega.com](http://www.vega.com) you will reach the document download.



**Information, note, tip:** This symbol indicates helpful additional information and tips for successful work.



**Note:** This symbol indicates notes to prevent failures, malfunctions, damage to devices or plants.



**Caution:** Non-observance of the information marked with this symbol may result in personal injury.



**Warning:** Non-observance of the information marked with this symbol may result in serious or fatal personal injury.



**Danger:** Non-observance of the information marked with this symbol results in serious or fatal personal injury.



### Ex applications

This symbol indicates special instructions for Ex applications.



### List

The dot set in front indicates a list with no implied sequence.



### Sequence of actions

Numbers set in front indicate successive steps in a procedure.



### Battery disposal

This symbol indicates special information about the disposal of batteries and accumulators.

## 2 For your safety

### 2.1 Authorised personnel

All operations described in this documentation must be carried out only by trained, qualified personnel authorised by the plant operator.

During work on and with the device, the required personal protective equipment must always be worn.

### 2.2 Appropriate use

The MINITRAC 31 is a sensor for density measurement and level detection.

You can find detailed information about the area of application in chapter "*Product description*".

Operational reliability is ensured only if the instrument is properly used according to the specifications in the operating instructions manual as well as possible supplementary instructions.

### 2.3 Warning about incorrect use

Inappropriate or incorrect use of this product can give rise to application-specific hazards, e.g. vessel overfill through incorrect mounting or adjustment. Damage to property and persons or environmental contamination can result. Also, the protective characteristics of the instrument can be impaired.

### 2.4 General safety instructions

This is a state-of-the-art instrument complying with all prevailing regulations and directives. The instrument must only be operated in a technically flawless and reliable condition. The operator is responsible for the trouble-free operation of the instrument. When measuring aggressive or corrosive media that can cause a dangerous situation if the instrument malfunctions, the operator has to implement suitable measures to make sure the instrument is functioning properly.

The safety instructions in this operating instructions manual, the national installation standards as well as the valid safety regulations and accident prevention rules must be observed by the user.

For safety and warranty reasons, any invasive work on the device beyond that described in the operating instructions manual may be carried out only by personnel authorised by the manufacturer. Arbitrary conversions or modifications are explicitly forbidden. For safety reasons, only the accessory specified by the manufacturer must be used.

To avoid any danger, the safety approval markings and safety tips on the device must also be observed.

This measuring system uses gamma rays. Therefore take note of the instructions for radiation protection in chapter "*Product description*". Any work on the source container may only be carried out under the supervision of a qualified radiation protection officer.

## 2.5 EU conformity

The device fulfils the legal requirements of the applicable EU directives. By affixing the CE marking, we confirm the conformity of the instrument with these directives.

The EU conformity declaration can be found on our homepage.

### Electromagnetic compatibility

Instruments with plastic housing are designed for use in an industrial environment. Nevertheless, electromagnetic interference from electrical conductors and radiated emissions must be taken into account, as is usual with class A instruments according to EN 61326-1. If the instrument is used in a different environment, the electromagnetic compatibility to other instruments must be ensured by suitable measures.

## 2.6 NAMUR recommendations

NAMUR is the automation technology user association in the process industry in Germany. The published NAMUR recommendations are accepted as the standard in field instrumentation.

The device fulfils the requirements of the following NAMUR recommendations:

- NE 21 – Electromagnetic compatibility of equipment
- NE 43 – Signal level for fault information from measuring transducers
- NE 53 – Compatibility of field devices and display/adjustment components
- NE 107 – Self-monitoring and diagnosis of field devices

For further information see [www.namur.de](http://www.namur.de).

## 2.7 Installation and operation in the USA and Canada

This information is only valid for USA and Canada. Hence the following text is only available in the English language.

Installations in the US shall comply with the relevant requirements of the National Electrical Code (ANSI/NFPA 70).

Installations in Canada shall comply with the relevant requirements of the Canadian Electrical Code.

## 2.8 Environmental instructions

Protection of the environment is one of our most important duties. That is why we have introduced an environment management system with the goal of continuously improving company environmental protection. The environment management system is certified according to DIN EN ISO 14001.

Please help us fulfil this obligation by observing the environmental instructions in this manual:

- Chapter " *Packaging, transport and storage* "
- Chapter " *Disposal* "

## 3 Product description

### 3.1 Configuration

#### Type label

The type label contains the most important data for identification and use of the instrument:

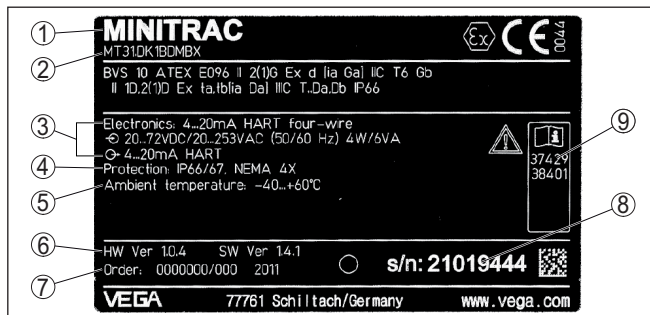


Fig. 1: Layout of the type label (example)

- 1 Instrument type
- 2 Product code
- 3 Electronics
- 4 Protection rating
- 5 Ambient temperature
- 6 Hardware and software version
- 7 Order number
- 8 Serial number of the instrument
- 9 ID numbers, instrument documentation

#### Serial number - Instrument search

The type label contains the serial number of the instrument. With it you can find the following instrument data on our homepage:

- Product code (HTML)
- Delivery date (HTML)
- Order-specific instrument features (HTML)
- Operating instructions and quick setup guide at the time of shipment (PDF)
- Test certificate (PDF) - optional

Move to "[www.vega.com](http://www.vega.com)" and enter in the search field the serial number of your instrument.

Alternatively, you can access the data via your smartphone:

- Download the VEGA Tools app from the "Apple App Store" or the "Google Play Store"
- Scan the QR-code on the type label of the device or
- Enter the serial number manually in the app

#### Scope of this operating instructions

This operating instructions manual applies to the following instrument versions:

- Hardware from 1.0.5
- Software from 2.1.0

**Electronics versions**

The instrument is available in different electronics versions. Each version can be identified via the product code on the type label:

- Standard electronics type PROTRACPAFF-XX

**Scope of delivery**

The scope of delivery encompasses:

- Radiometric sensor
- Mounting accessories
- Documentation
- Bluetooth module (optional)
  - This operating instructions manual
  - Ex-specific "*Safety instructions*" (with Ex versions)
  - If necessary, further certificates

**Application area**

### 3.2 Principle of operation

The instrument is suitable for applications in liquids and bulk solids in vessels under difficult process conditions. There are application possibilities in nearly all areas of industry.

The measured value is detected contactlessly right through the vessel wall. Neither a process fitting nor a vessel opening are required. The instrument is thus ideal for retro installation.

The instrument can be used for many different measuring tasks. Apart from the main applications such as density measurement and level detection, the MINITRAC 31 can also detect residues and the mass flow rate in conjunction with a flow meter.



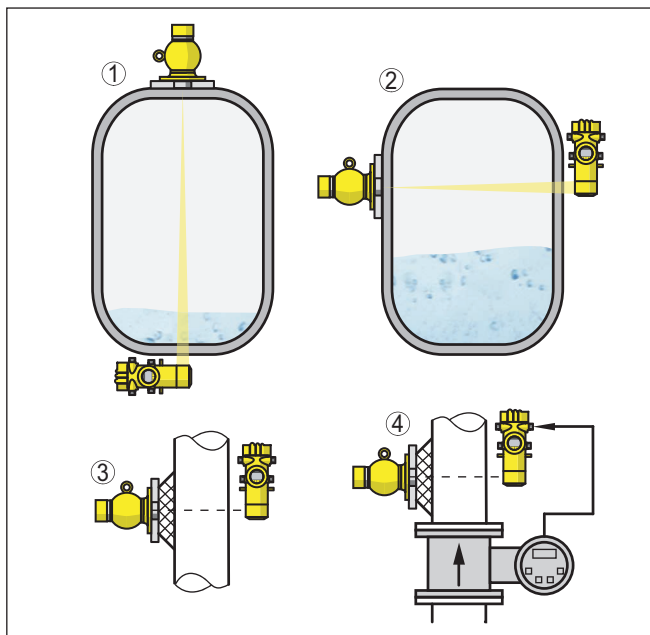


Fig. 2: MINITRAC 31 - Application possibilities

- 1 Level measurement - Residue detection
- 2 Point level detection
- 3 Density measurement
- 4 Mass flow measurement

Further application possibilities are also the use as X-ray alarm or real value correction.

If X-ray alarm is selected, the instrument detects radiation from external sources. Possible external radiation sources can be, for example, a weld joint test in a neighbouring facility or other radiometric instruments.

When the instrument operates as real value correction it transmits the real value to correct another radiometric sensor. The measurement can thus be adapted perfectly to the situation in the vessel.

## Functional principle

In radiometric measurement, a Caesium-137 or Cobalt-60 isotope emits focussed gamma rays that are attenuated when penetrating the tube wall and the medium. The NaI detector on the opposite side, on a pipeline for example, receives the radiation. The intensity of the radiation is dependent on the density of the measured media. The measuring principle has proven to be very reliable in conjunction with extreme process conditions because it measures contactlessly from outside through the tube wall. The measuring system ensures maximum safety, reliability and plant availability independent of the medium and its properties.

### 3.3 Packaging, transport and storage

#### Packaging

Your instrument was protected by packaging during transport. Its capacity to handle normal loads during transport is assured by a test based on ISO 4180.

The packaging consists of environment-friendly, recyclable cardboard. For special versions, PE foam or PE foil is also used. Dispose of the packaging material via specialised recycling companies.

#### Transport

Transport must be carried out in due consideration of the notes on the transport packaging. Nonobservance of these instructions can cause damage to the device.

#### Transport inspection

The delivery must be checked for completeness and possible transit damage immediately at receipt. Ascertained transit damage or concealed defects must be appropriately dealt with.

#### Storage

Up to the time of installation, the packages must be left closed and stored according to the orientation and storage markings on the outside.

Unless otherwise indicated, the packages must be stored only under the following conditions:

- Not in the open
- Dry and dust free
- Not exposed to corrosive media
- Protected against solar radiation
- Avoiding mechanical shock and vibration
- Storage and transport temperature see chapter " *Supplement - Technical data - Ambient conditions*"
- Relative humidity 20 ... 85 %

#### Storage and transport temperature

#### Lifting and carrying

With instrument weights of more than 18 kg (39.68 lbs) suitable and approved equipment must be used for lifting and carrying.

### 3.4 Accessories

#### PLICSCOM

The display and adjustment module is used for measured value indication, adjustment and diagnosis.

The integrated Bluetooth module (optional) enables wireless adjustment via standard adjustment devices.

#### VEGACONNECT

The interface adapter VEGACONNECT enables the connection of communication-capable instruments to the USB interface of a PC.

#### VEGADIS 81

The VEGADIS 81 is an external display and adjustment unit for VEGA plics® sensors.

#### Electronics module - PT30

The electronics module PT30... is a replacement part for radiometric sensors MINITRAC 31.

It is located in the large electronics and connection compartment.

The electronics module can only be exchanged by VEGA service technician.

**Supplementary electronics module - PROTRAC.ZE**

The supplementary electronics module PROTRAC.ZE... is a replacement part for radiometric sensors MINITRAC 31. It is located in the lateral adjustment and connection compartment.

**Mounting accessories**

Brackets and special mounting accessories are available for mounting the MINITRAC 31.

For mounting on pipelines, there are corresponding clamp brackets. Contact our sales staff.

**Device cooling**

The radiometric sensor has temperature limits which must not be exceeded. In case the max. permissible temperature is exceeded, faulty measurements and a permanent damage of the sensor can be caused.

You have several possibilities to avoid too high ambient temperatures:

**Passive sun shade**

Direct sun increases the temperature on the sensor by 20 °K. The best possibility to protect the sensor against the effects of direct sun is a suitable roof structure.

If this is not possible or only with great effort, then you can use the passive sun shade. The passive sun shade consists of a housing sun shade and a sun protection hose and can reduce the sensor temperature by 10 °K.

**Air cooling**


For ambient temperatures up to +80 °C you can use an air cooling. The cooling air is generated with vortex coolers. Please check if sufficient compressed air is available. You can find further information in the supplementary instructions of the air cooling. The air cooling cannot be retrofitted.

**Water cooling**

For ambient temperatures up to +100 °C you can use a water cooling. Please check if sufficient cooled water is available. You can find further information in the supplementary instructions of the water cooling. The water cooling cannot be retrofitted.

**Gamma modulator**

In order to exclude external interference radiation, you can mount a gamma modulator in front of the source holder. This allows reliable measurement even when interference radiation occurs.

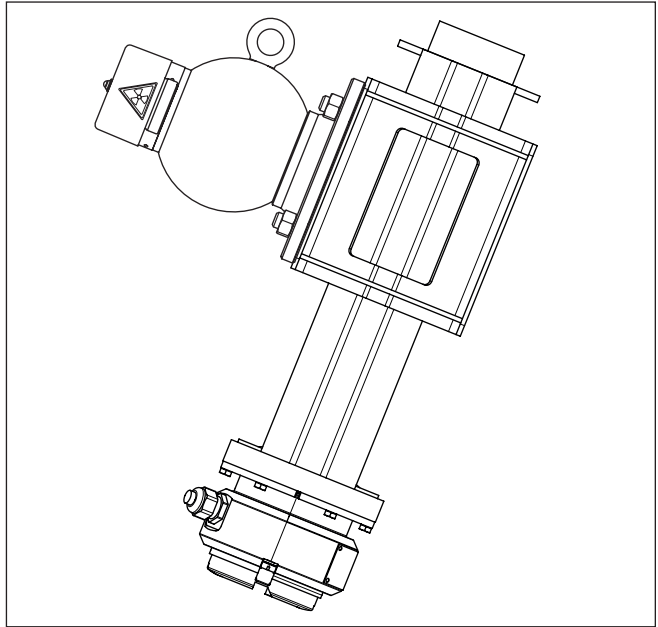

*Fig. 3: Gamma modulator (optional) for uninterrupted measurement even with interference radiation*

*1 Gamma modulator (mounted on the source holder)*

For ambient temperatures up to 120 °C (248 °C) the gamma modulator is optionally available with water cooling.

Any number of devices can be synchronized. To synchronize several gamma modulators, you need a controller.

### 3.5 Corresponding source container

A radioactive isotope in a suitable source holder is the prerequisite for a radiometric measurement setup.

The handling of radioactive substances is regulated by law. The radiation protection rules of the country in which the system is operated apply first and foremost.

In Germany, for example, the current radiation protection ordinance (StrlSchV) based on the Atomic Energy Law (AtG) applies.

The following points are important for measurement with radiometric methods:

#### Handling permit

A handling permit is required for operation of a system using gamma rays. This permit is issued by the respective government office or the responsible authority (in Germany, for example, offices for environmental protection, trade supervisory boards, etc.)

You can find further instructions in the operating instructions manual of the source container.

## General instructions for radiation protection

When handling radioactive sources, unnecessary radiation exposure must be avoided. An unavoidable radiation exposure must be kept as low as possible. Take note of the following three important measures:

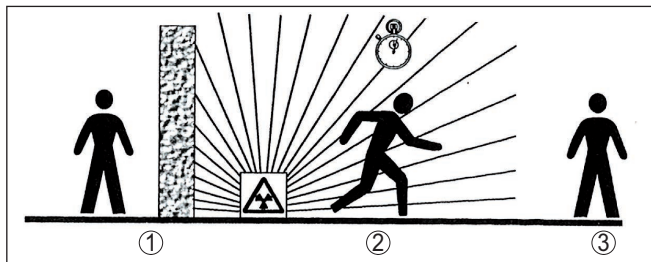


Fig. 4: Measures for protection against radioactive radiation

- 1 Shielding
- 2 Time
- 3 Distance

**Shielding:** Provide good shielding between the source and yourself as well as all other persons. Special source containers (e.g. VEGASOURCE) as well as all materials with high density (e.g. lead, iron, concrete, etc.) provide effective shielding.

**Time:** Stay as short a time as possible in radiation exposed areas.

**Distance:** Your distance to the source should be as large as possible. The local dose rate of the radiation decreases in proportion to the square of the distance to the radiation source.

## Radiation safety officer

The plant operator must appoint a radiation safety officer with the necessary expert knowledge. He is responsible for ensuring that the radiation protection ordinance is complied with and for implementing all radiation protection measures.

## Control area

Control areas are areas in which the local dose rate exceeds a certain value. Only persons who undergo official dose monitoring are allowed into these control areas. You can find the respectively valid limit values for control areas in the guideline of the respective authority (in Germany, for example, the radiation protection ordinance).

We are at your disposal for further information concerning radiation protection and regulations in other countries.

## 4 Mounting

### 4.1 General instructions

#### Switch off source

The source container is part of the measuring system. In case the source container is already equipped with an active isotope, the source container must be locked before mounting.



#### **Danger:**

Before mounting; make sure that the source is securely closed. Use a padlock to secure the source container in the closed condition and prevent it from being inadvertently opened.

#### Protection against moisture

Protect your instrument against moisture ingress through the following measures:

- Use a suitable connection cable (see chapter " *Connecting to power supply* ")
- Tighten the cable gland or plug connector
- Lead the connection cable downward in front of the cable entry or plug connector

This applies mainly to outdoor installations, in areas where high humidity is expected (e.g. through cleaning processes) and on cooled or heated vessels.



#### **Note:**

Make sure that during installation or maintenance no moisture or dirt can get inside the instrument.

To maintain the housing protection, make sure that the housing lid is closed during operation and locked, if necessary.

#### Process conditions



#### **Note:**

For safety reasons, the instrument must only be operated within the permissible process conditions. You can find detailed information on the process conditions in chapter " *Technical data* " of the operating instructions or on the type label.

Hence make sure before mounting that all parts of the instrument exposed to the process are suitable for the existing process conditions.

These are mainly:

- Active measuring component
- Process fitting
- Process seal

Process conditions in particular are:

- Process pressure
- Process temperature
- Chemical properties of the medium
- Abrasion and mechanical influences

## Cable glands

### Metric threads

In the case of instrument housings with metric thread, the cable glands are screwed in at the factory. They are sealed with plastic plugs as transport protection.

You have to remove these plugs before electrical connection.

### NPT thread

In the case of instrument housings with self-sealing NPT threads, it is not possible to have the cable entries screwed in at the factory. The free openings for the cable glands are therefore covered with red dust protection caps as transport protection.

Prior to setup you have to replace these protective caps with approved cable glands or close the openings with suitable blind plugs.

The suitable cable glands and blind plugs come with the instrument.

## 4.2 Mounting instructions

### Installation position



#### Note:

During the planning, our specialists will analyse the conditions of the measurement loop to dimension the isotope accordingly.

You get a "Source Sizing" document specifying the required source activity and containing all relevant mounting information for your measuring point.

You must follow the instructions in this "Source Sizing" document in addition to the following mounting instructions.

The following mounting information is applicable as long as there is nothing else specified in the "Source Sizing" document.

You can find information on protective barriers and the mounting of the corresponding source container in the operating instructions manual of the source container, e.g. VEGASOURCE.

You can mount the MINITRAC 31 in any position. If you have ordered your instrument with a lead cover as a protection against ambient radiation (optionally), the the sensor is shielded laterally against X-ray radiation. In this case, the radiation can only penetrate frontally.

Fasten the sensors in such a way that they cannot fall out of the holder.

Direct the exit angle of the source container to the MINITRAC 31.

Mount the source container as close as possible to the vessel. If there are gaps, secure the area with a safety fence and protective grating so that no one can reach into the dangerous area.



#### Caution:

Make sure that the tube is always completely filled. Mainly in horizontally arranged tube measuring distances, air bubbles or buildup in the tube can influence the measuring result. Measurement should be preferably through the centre of the tube.

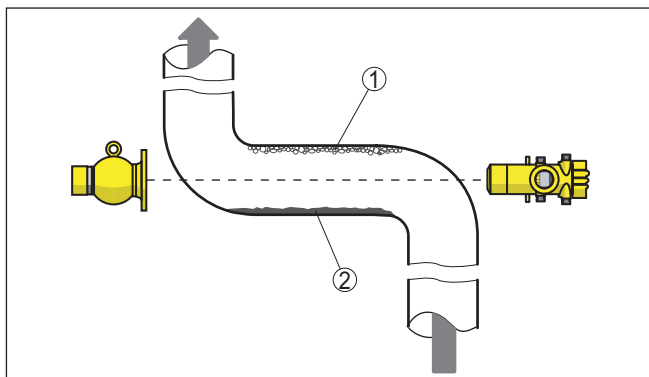


Fig. 5: Installation on a horizontal pipeline

- 1 Air bubbles
- 2 Buildup

### Density measurement

A density and concentration measurement is possible on pipelines and vessels. The accuracy of the measurement increases in proportion to the radiated length (L) of medium. This is particularly important in the case of products with low density or small tube diameters. There are different ways to increase the radiated length (L) of the medium.



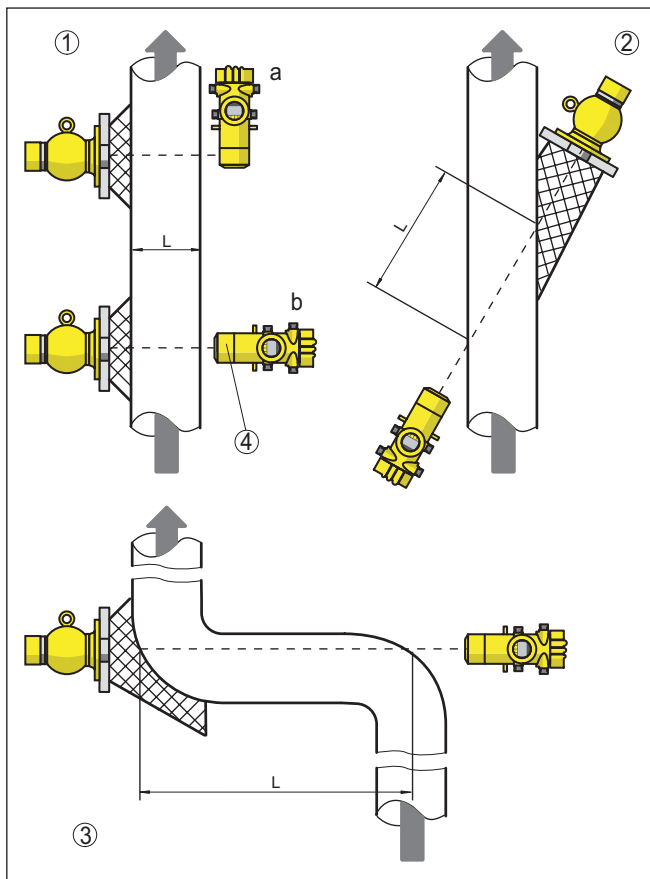


Fig. 6: Installation possibilities - Density measurement or concentration measurement

- 1a Radial radiation - vertical mounting
- 1b Axial radiation - Horizontal mounting or when the lead cover is used as protection against ambient radiation
- 2 Inclined radiation for extension of the radiated length (L)
- 3 Extension of the radiated length (L) by adding a tube angle piece as measuring distance
- 4 Integrated lead cover as protection against ambient radiation - the instrument is hence shielded laterally

With density measurement, the radiation difference with differing density is very low. Especially with small tube diameters, the change is negligible.

Therefore it is important to shield from interfering X-ray radiation. To protect the instrument against X-ray radiation, it can be equipped with an optional lead ring. A later retrofitting of the lead ring is not possible.

**Mass flow rate**

The mass flow rate can be determined with the MINITRAC 31 in conjunction with a flow meter.

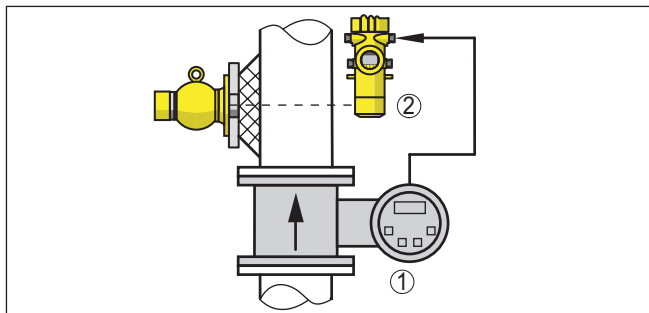


Fig. 7: Mass flow rate measurement

- 1 Flow meter
- 2 MINITRAC 31

**Point level detection**

For level detection, the sensor is generally mounted horizontally at the height of the requested limit level. Make sure that there are no struts or reinforcements at this position in the vessel.

Direct the exit beam of the source container exactly towards the measuring range of MINITRAC 31.

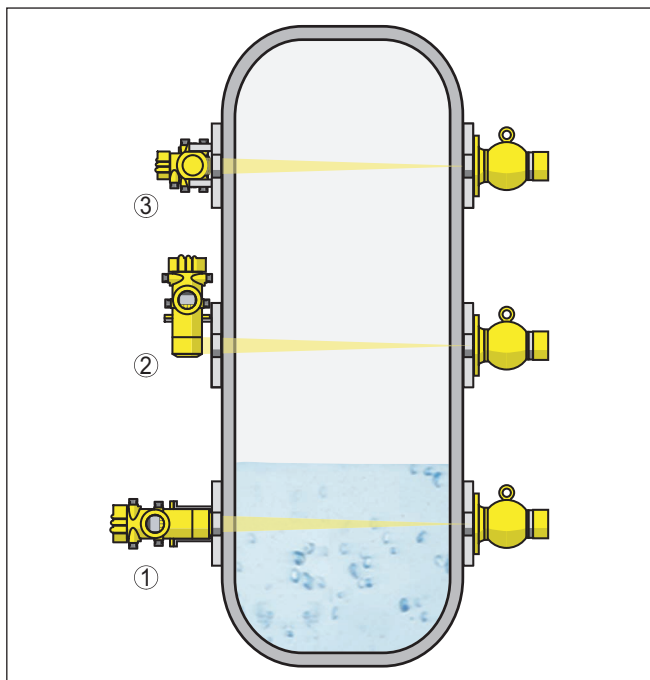


Fig. 8: Mounting position - level detection

- 1 Horizontal mounting
- 2 Vertical mounting
- 3 Mounting horizontally, at right angles to container

#### Level measurement - Residue detection

The MINITRAC 31 can be used for residue detection, e.g. in storage tanks for high-cost liquids. For this purpose, the instrument must be mounted at the lowest point of the vessel.

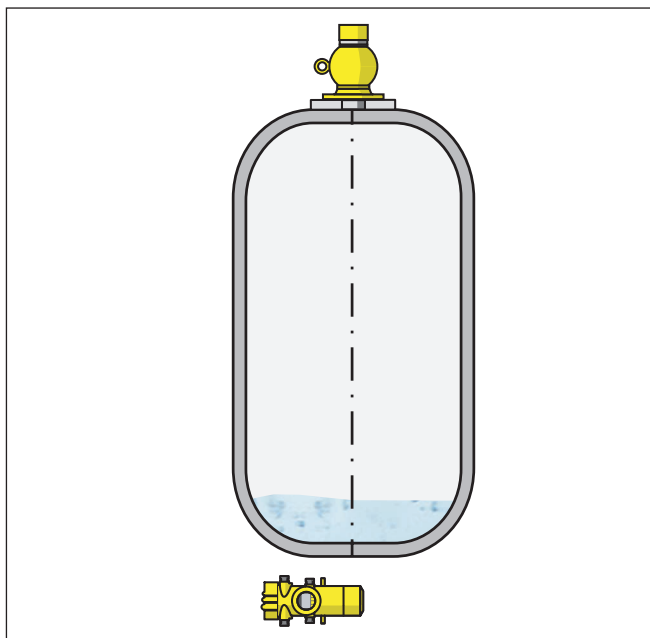


Fig. 9: Level measurement - Residue detection on a storage tank

### Protection against heat

If the max. ambient temperature is exceeded, you must take suitable measures to protect the instrument against overheating.

You can protect the instrument by providing a suitable insulation against the heat or mounting the instrument further away from the heat source.

Make sure these measures are taken into account already in the planning stage. If you want to carry out such measures later on, contact our specialists to ensure that the accuracy of the application is not impaired.

If these measures are not sufficient to maintain the max. ambient temperature, you could consider using the water or air cooling system we offer for MINITRAC 31.

The cooling system must also be included in the calculations for the measuring point. Contact our specialists regarding the dimensioning of the cooling.

## 5 Connecting to power supply

### 5.1 Preparing the connection

#### Safety instructions

Always keep in mind the following safety instructions:

- The electrical connection must only be carried out by trained, qualified personnel authorised by the plant operator.
- If overvoltage surges are expected, overvoltage arresters should be installed.



#### Warning:

Only connect or disconnect in de-energized state.



#### Note:

Install a disconnecting device for the instrument which is easy to access. The disconnecting device must be marked for the instrument (IEC/EN 61010).

#### Voltage supply via mains voltage

The instrument is designed in protection class I. To maintain this protection class, it is absolutely necessary that the ground conductor be connected to the internal ground terminal. Take note of the national installation regulations.

Supply voltage and signal output are carried on separate connection cables if reliable separation is required. The supply voltage range can differ depending on the instrument version.

The data for power supply are specified in chapter " *Technical data*".

#### Select connection cable

##### General requirements

- Make sure that the cable used has the required temperature resistance and fire safety for max. occurring ambient temperature
- Use cable with round cross section for instruments with housing and cable gland. To ensure the seal effect of the cable gland (IP protection rating), find out which cable outer diameter the cable gland is suitable for.
- Use a cable gland fitting the cable diameter.
- Unused cable glands do not offer sufficient protection against moisture and must be replaced by blind plugs.

##### Voltage supply

For power supply, an approved, three-wire installation cable with PE conductor is required.

##### Signal cable

Use for the signal output a cable according to the respective bus specifications.

#### Cable glands

##### Metric threads

In the case of instrument housings with metric thread, the cable glands are screwed in at the factory. They are sealed with plastic plugs as transport protection.

You have to remove these plugs before electrical connection.

**NPT thread**

In the case of instrument housings with self-sealing NPT threads, it is not possible to have the cable entries screwed in at the factory. The free openings for the cable glands are therefore covered with red dust protection caps as transport protection.

Before setup you have to replace these protective caps with approved cable glands or close the openings with suitable blind plugs. Unused cable glands do not provide sufficient protection against moisture and must be replaced with blind plugs.

The suitable cable glands and blind plugs come with the instrument.

**Cable screening and grounding**

Make sure that the cable screen and grounding are carried out according to Fieldbus specification. We recommend to connect the cable screening to ground potential on both ends.

In systems with potential equalisation, connect the cable screening directly to ground potential at the power supply unit, in the connection box and at the sensor. The screen in the sensor must be connected directly to the internal ground terminal. The ground terminal outside on the housing must be connected to the potential equalisation (low impedance).

**Connection technology**

The voltage supply and signal output are connected via the spring-loaded terminals in the housing.

Connection to the display and adjustment module or to the interface adapter is carried out via contact pins in the housing.

**Connection procedure**

Proceed as follows:

The procedure applies to instruments without explosion protection.

1. Unscrew the big housing cover
2. Loosen compression nut of the cable gland and remove blind plug
3. Remove approx. 10 cm (4 in) of the cable mantle, strip approx. 1 cm (0.4 in) of insulation from the ends of the individual wires
4. Insert the cable into the sensor through the cable entry

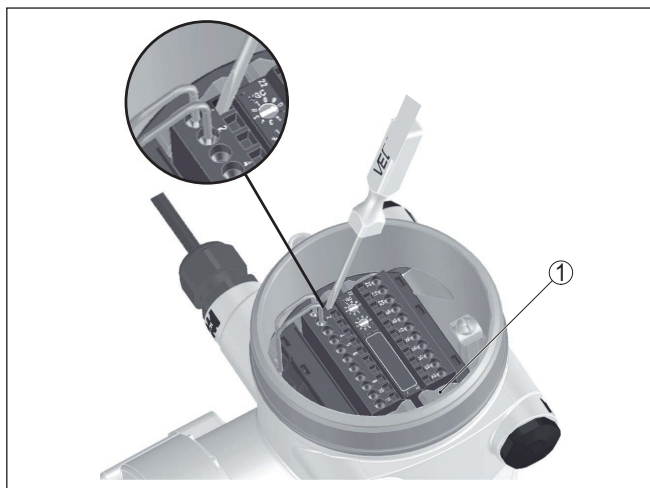


Fig. 10: Connection steps 4 and 5

1 Locking of the terminal blocks

5. Insert a small slotted screwdriver firmly into the rectangular lock openings of the respective connection terminal
6. Insert the wire ends into the round openings of the terminals according to the wiring plan



**Information:**

Solid cores as well as flexible cores with cable end sleeves are inserted directly into the terminal openings. In case of flexible cores without end sleeves, press the rectangular lock opening with a small screwdriver; the terminal opening is freed. When the screwdriver is released, the terminal opening closes again.

7. Check the hold of the wires in the terminals by lightly pulling on them  
To loosen a line, insert a small slotted screwdriver firmly into the rectangular lock opening according to the illustration
8. Connect the shielding to the internal ground terminal, connect the external ground terminal to potential equalisation
9. Tighten the compression nut of the cable entry gland. The seal ring must completely encircle the cable
10. Screw the housing lid back on

The electrical connection is finished.



**Information:**

The terminal blocks are pluggable and can be detached from the electronics. To do this, loosen the two lateral locking levers of the terminal block with a small screwdriver. When loosening the locking, the terminal block is automatically squeezed out. It must snap in place when re-inserted.

## 5.2 Connection - Density, mass flow rate measurement

Non-Ex instruments and instruments with non-intrinsically safe signal output

Electronics and connection compartment - Non-Ex instruments and instruments with non-intrinsically safe signal output

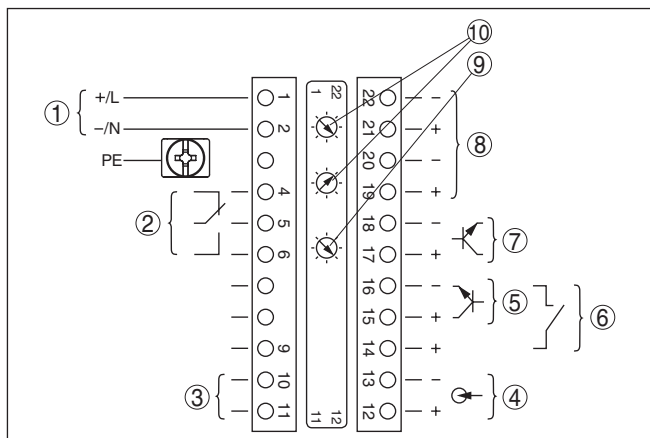


Fig. 11: Electronics and connection compartment with non-Ex instruments and instruments with non-intrinsically safe signal output

- 1 Voltage supply
- 2 Relay output
- 3 Signal output FF bus
- 4 Signal input 4 ... 20 mA (active sensor)
- 5 Switching input for NPN transistor
- 6 Switching input floating
- 7 Transistor output
- 8 Interface for sensor-sensor communication (MGC)
- 9 Simulation switch (1 = simulation on)
- 10 Setting the bus address for sensor-sensor communication (MGC) <sup>1)</sup>

Adjustment and connection compartment - Non-Ex instruments and instruments with non-intrinsically safe signal output

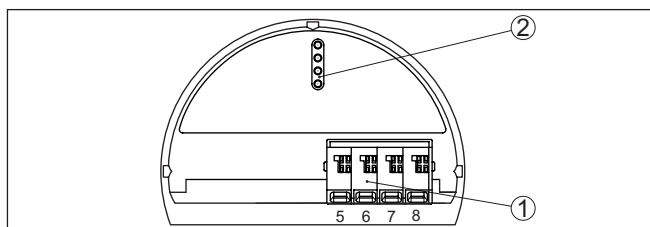


Fig. 12: Adjustment and connection compartment with non-Ex instruments and instruments with non-intrinsically safe signal output

- 1 Terminals for the external display and adjustment unit
- 2 Contact pins for the display and adjustment module or interface adapter

<sup>1)</sup> MGC = Multi Gauge Communication





### Instruments with intrinsically safe signal output

You can find detailed information on the explosion-protected versions (Ex-ia, Ex-d) in the Ex-specific safety instructions. These safety instructions are part of the scope of delivery and come with the Ex-approved instruments.

### Electronics and connection compartment - Instruments with intrinsically safe signal output

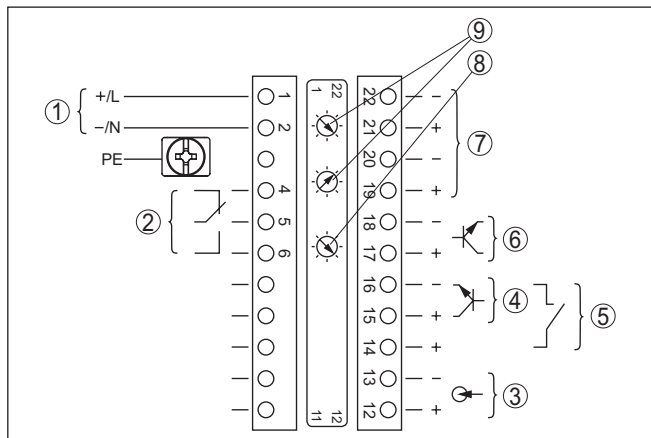


Fig. 13: Electronics and connection compartment (Ex-d) with instruments with intrinsically safe signal output

- 1 Voltage supply
- 2 Relay output
- 3 Signal input 4 ... 20 mA (active sensor)
- 4 Switching input for NPN transistor
- 5 Switching input floating
- 6 Transistor output
- 7 Interface for sensor-sensor communication (MGC)
- 8 Simulation switch (1 = simulation on)
- 9 Setting the bus address for sensor-sensor communication (MGC) <sup>2)</sup>

<sup>2)</sup> MGC = Multi Gauge Communication

### Adjustment and connection compartment - Instruments with intrinsically safe signal output

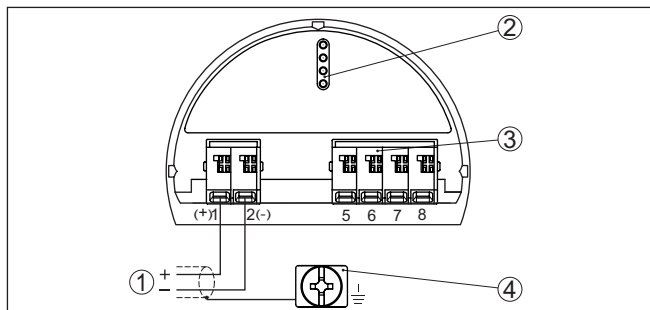


Fig. 14: Adjustment and connection compartment (Ex-ia) with instruments with intrinsically safe signal output

- 1 Terminals for intrinsically safe signal output FF bus
- 2 Contact pins for the display and adjustment module or interface adapter
- 3 Terminals for the external display and adjustment unit
- 4 Ground terminal

### 5.3 Connection - Level detection

#### Non-Ex instruments and instruments with non-intrinsically safe signal output

Electronics and connection compartment - Non-Ex instruments and instruments with non-intrinsically safe signal output

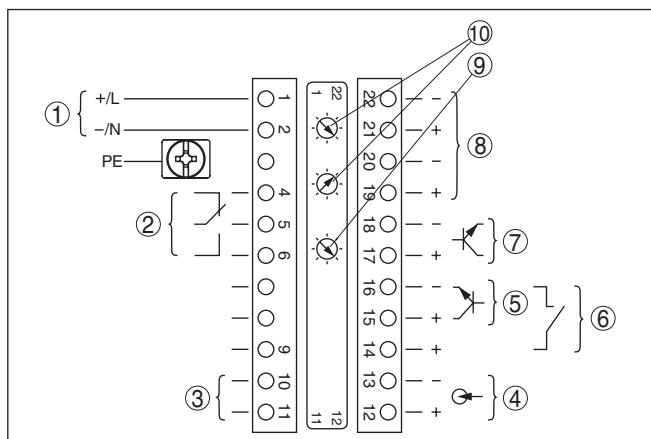


Fig. 15: Electronics and connection compartment with non-Ex instruments and instruments with non-intrinsically safe signal output

- 1 Voltage supply
- 2 Relay output
- 3 Signal output FF bus
- 4 Signal input 4 ... 20 mA (active sensor)
- 5 Switching input for NPN transistor
- 6 Switching input floating
- 7 Transistor output
- 8 Interface for sensor-sensor communication (MGC)
- 9 Simulation switch (1 = simulation on)
- 10 Setting the bus address for sensor-sensor communication (MGC) <sup>3)</sup>

Adjustment and connection compartment - Non-Ex instruments and instruments with non-intrinsically safe signal output

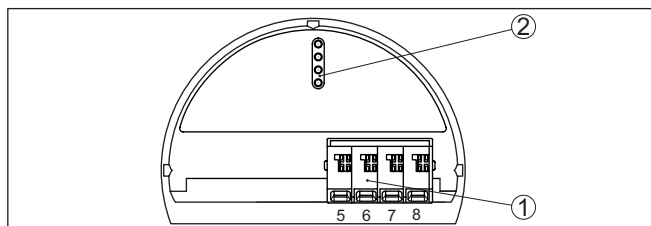


Fig. 16: Adjustment and connection compartment with non-Ex instruments and instruments with non-intrinsically safe signal output

- 1 Terminals for the external display and adjustment unit
- 2 Contact pins for the display and adjustment module or interface adapter

#### Connection to a PLC

If inductive loads or stronger currents are switched through, the gold plating on the relay contact surface will be permanently damaged.

<sup>3)</sup> MGC = Multi Gauge Communication

The contact is then no longer suitable for switching low-voltage circuits.

Inductive loads also result from the connection to a PLC input or output and/or in combination with long cables. It is imperative that you take measures to extinguish sparks to protect the relay contact (e.g. Z diode) or the transistor or 8/16 mA output.

### Instruments with intrinsically safe signal output



You can find detailed information on the explosion-protected versions (Ex-ia, Ex-d) in the Ex-specific safety instructions. These safety instructions are part of the scope of delivery and come with the Ex-approved instruments.

### Electronics and connection compartment - Instruments with intrinsically safe signal output

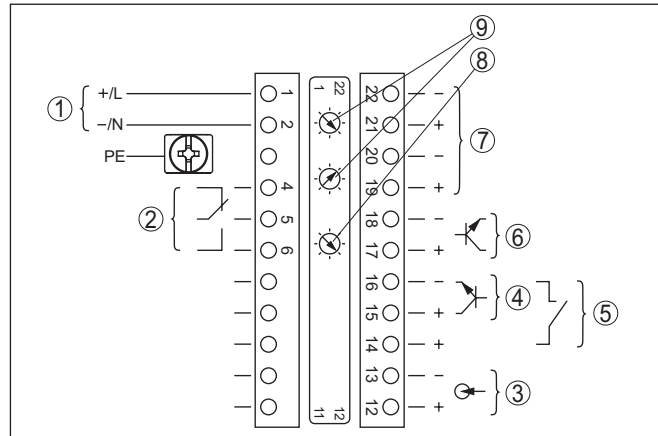


Fig. 17: Electronics and connection compartment (Ex-d) with instruments with intrinsically safe signal output

- 1 Voltage supply
- 2 Relay output
- 3 Signal input 4 ... 20 mA (active sensor)
- 4 Switching input for NPN transistor
- 5 Switching input floating
- 6 Transistor output
- 7 Interface for sensor-sensor communication (MGC)
- 8 Simulation switch (1 = simulation on)
- 9 Setting the bus address for sensor-sensor communication (MGC) <sup>4)</sup>

<sup>4)</sup> MGC = Multi Gauge Communication

### Adjustment and connection compartment - Instruments with intrinsically safe signal output

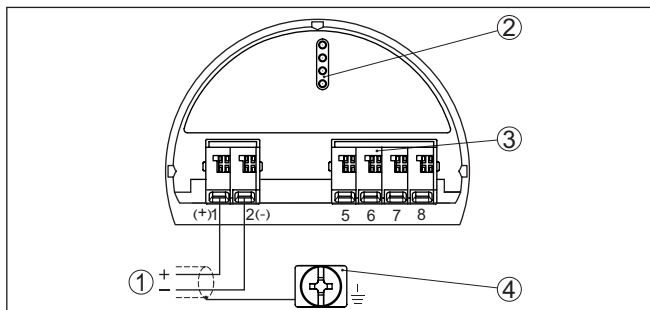


Fig. 18: Adjustment and connection compartment (Ex-ia) with instruments with intrinsically safe signal output

- 1 Terminals for intrinsically safe signal output FF bus
- 2 Contact pins for the display and adjustment module or interface adapter
- 3 Terminals for the external display and adjustment unit
- 4 Ground terminal

### Connection to a PLC

If inductive loads or stronger currents are switched through, the gold plating on the relay contact surface will be permanently damaged. The contact is then no longer suitable for switching low-voltage circuits.

Inductive loads also result from the connection to a PLC input or output and/or in combination with long cables. It is imperative that you take measures to extinguish sparks to protect the relay contact (e.g. Z diode) or the transistor or 8/16 mA output.

## 6 Set up with the display and adjustment module

### Mount/dismount display and adjustment module

### 6.1 Insert display and adjustment module

The display and adjustment module can be inserted into the sensor and removed again at any time. It is not necessary to interrupt the voltage supply.

Proceed as follows:

1. Unscrew the small housing cover
2. Place the display and adjustment module in the desired position on the electronics (you can choose any one of four different positions - each displaced by 90°)
3. Press the display and adjustment module onto the electronics and turn it to the right until it snaps in
4. Screw housing lid with inspection window tightly back on

Disassembly is carried out in reverse order.

The display and adjustment module is powered by the sensor, an additional connection is not necessary.

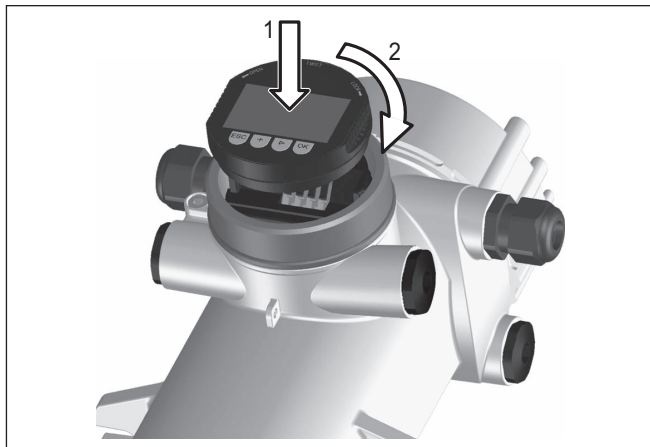


Fig. 19: Insert display and adjustment module



#### Note:

If you intend to retrofit the instrument with a display and adjustment module for continuous measured value indication, a higher lid with an inspection glass is required.

## 6.2 Adjustment system

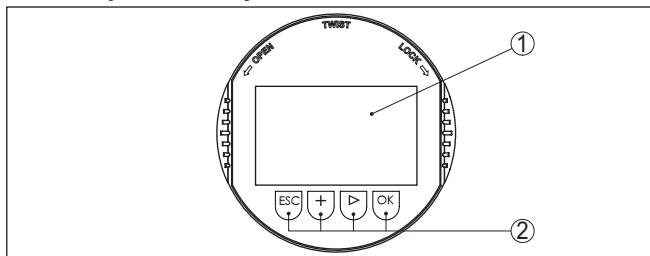


Fig. 20: Display and adjustment elements

- 1 LC display
- 2 Adjustment keys

### Key functions

- **[OK]** key:
  - Move to the menu overview
  - Confirm selected menu
  - Edit parameter
  - Save value
- **[>]** key:
  - Change measured value presentation
  - Select list entry
  - Select menu items
  - Select editing position
- **[+]** key:
  - Change value of the parameter
- **[ESC]** key:
  - Interrupt input
  - Jump to next higher menu

### Adjustment system

The instrument is operated via the four keys of the display and adjustment module. The individual menu items are shown on the LC display. You can find the function of the individual keys in the previous illustration.

### Time functions

When the **[+]** and **[>]** keys are pressed quickly, the edited value, or the cursor, changes one value or position at a time. If the key is pressed longer than 1 s, the value or position changes continuously.

When the **[OK]** and **[ESC]** keys are pressed simultaneously for more than 5 s, the display returns to the main menu. The menu language is then switched over to "English".

Approx. 60 minutes after the last pressing of a key, an automatic reset to measured value indication is triggered. Any values not confirmed with **[OK]** will not be saved.

### 6.3 Parameter adjustment - Level measurement

The instrument is adapted to the application conditions via the parameter adjustment. The parameter adjustment is carried out with an adjustment menu.

#### Instrument start



 
#### Caution:

During the first setup or after an instrument reset the instrument starts with preset standard values. These value are not suitable for your application and must be replaced by real values.

Carry out a setup in the sequence described in the following.

#### Main menu

The main menu is divided into five sections with the following functions:



**Setup:** Settings, e.g. for measurement loop name, isotope, application, background radiation, adjustment, signal output

**Display:** Settings, for example language, measured value display



**Diagnosis:** Information, for example, of device status, peak value, simulation

**Additional adjustments:** Instrument unit, reset, date/time, copying function

**Info:** Instrument name, hardware and software version, date of manufacture, instrument features

#### Procedure

  Check if the correct language is already set for the display. If not, you can change the language in the menu item "Display - Menu language".



Start with the setup of MINITRAC 31.

In the main menu item "Setup", the individual submenu items should be selected one after the other and provided with the correct parameters to ensure optimum setting of the measurement. The procedure is described in the following.

Stick with the normal sequence of the menu items as closely as possible.

#### 6.3.1 Setup

#### Isotope

In this menu item you can adjust the MINITRAC 31 to the isotope installed in the source container.

 
For this purpose, check which isotope is in the source container. You can find this information on the type label of the source container.



<b>Application</b>	<p>Enter here, the respective application.</p> <p>This menu item enables adaptation of the sensor to the requested application. You can choose between the following applications: "<i>Level</i>", "<i>Density</i>", "<i>Limit level</i>", "<i>X-ray alarm</i>" or "<i>Real value correction</i>".</p>
<b>Background radiation</b>	<p>The natural radiation on earth influences the accuracy of the measurement.</p> <p>With this menu item the natural background radiation can be faded out.</p> <p>For this purpose, the MINITRAC 31 measures the natural background radiation and sets the pulse rate to zero.</p> <p>In the future, the pulse rate from this background radiation will be automatically deducted from the total pulse rate. This means: only the component of the pulse rate originating from the source will be displayed.</p> <p>The source container must be closed for this setting.</p>
<b>Units</b>	<p>In this menu item you can select the units of the process value and the temperature.</p>
<b>Adjustment</b>	<p>In this menu item you can enter the measuring range (min. and max. process value) of the sensor.</p> <p>These settings influence the signal output of the sensor.</p> <p>Enter in the menu window "<i>Max. process value</i>" the max. level (full), e.g. in "<i>m</i>".</p> <p>Enter in the menu window "<i>Min. process value</i>" the min. level (empty), e.g. in "<i>m</i>".</p>
<b>Linearisation</b>	<p>In this menu item you can carry out the adjustment of the sensor.</p> <p>Due to the measuring principle itself, there is no linear relationship between pulse rate and level. Hence, this adjustment (i.e. linearisation) must in any case be carried out.</p> <div> <div><b>i</b></div> <div> <p><b>Note:</b></p> <p>If you cannot fill the vessel with the original medium, it is also possible to carry out the adjustment with water.</p> </div> </div> <p>Prerequisites:</p> <p>Radiation is switched on - Source container is set to "ON"</p> <p>The vessel is either completely filled (100 %) or completely emptied (0 %).</p> <p>Depending on whether the vessel is full or empty, you can first carry out the full or the empty adjustment. The MINITRAC 31 sorts the points automatically according to their level.</p> <p>Select "<i>Show table</i>" to display and edit the linearisation points.</p> <p>Select "<i>Linearisation - New</i>" to enter the first point.</p> <p>Select "<i>Determine count rate</i>" to enter the first point.</p> <p>The determination of the actual count rate lasts 2 minutes. After the count rate has been determined, you can accept the value (ct/s).</p>

Enter now the corresponding level (m).

By doing so, you assign a corresponding level to the actual count rate.



Accept the value pair with "OK".

Depending on whether you started with a full or an empty vessel, you have to continue emptying or filling the vessel.

Carry out such a linearisation with several different filling heights even if you have a linear vessel.

A maximum of 32 linearisation points is possible.

## Damping

In this menu item you can adjust the damping of the sensor. With it you can suppress fluctuations in the measured value indication, caused e.g. by an agitated product surface. This time can be between 1 and 1200 seconds. Keep in mind that the reaction time also increases and the instrument reacts to quick level changes with a delay. Generally a time of approximately 60 seconds is sufficient to smooth the measured value indication.

## X-ray alarm

Radiation from external sources can influence the measuring result of the sensor.

Possible external radiation sources can be, for example, a weld joint test on a neighbouring facility or other radiometric instruments.

An X-ray alarm is triggered if the impulses (ct/s) are more than 25 % above the max. value from the linearization table.

This fault message is only output for the period of the increased X-ray radiation. Then the fault message is automatically reset.

In this menu item you can determine the behaviour of the sensor when external radiation sources appear.

## Relay

In this menu item you can activate the relay output and determine its function as well as the switching points.

When the output of the process values is set, you can choose between overfill and dry run protection.

The relay outputs of the sensor react accordingly.

You can choose "no" reference value. In this case, the relay output operates as fail safe relay.

This does not apply if "X-ray alarm" is selected as reference value. In this case the fault message is not active.



### Caution:

 
Independent of the selected reference value, the relay will deenergize in case of failure.

Except with "X-ray radiation" as reference value. In this case a failure signal is not active.

## Reset

### 6.3.2 Additional adjustments

When a reset is carried out, all settings (with only a few exceptions) are reset. The exceptions are: PIN, language and SIL.



The following reset functions are available:

**Basic settings:** Resetting of the parameter adjustments to default values at the time of shipment. Order-specific settings are deleted.

**Default settings:** Resetting of the parameter adjustment like under "Basic settings". In addition, special parameters are reset to default values. Order-specific settings are deleted.

**Peak values of measured value:** Resetting of the parameter adjustments in the menu item "Setup" to the default values of the respective instrument. Order-specific settings remain but are not taken over into the current parameters.

**Peak values of temperature:** Resetting of the measured min. and max. temperatures to the actual measured value.

The following table shows the default values of the instrument. The values apply for the application "Level". First of all you have to select the application.

Depending on the instrument version, not all menu items may be available or they may be differently assigned:

Menu	Menu item	Default value
Setup	Measurement loop name	Sensor
	Isotope	Cs-137
	Application	Level
	Background radiation	0 ct/s
	Process value unit	%
	Temperature unit	° C
	Min. adjustment	Min. process value = 0 %
	Max. adjustment	Max. process value = 100 %
	Linearisation	0 ct/s = 100 %
		90000 ct/s = 0 %
	Damping	60 s
	Real value correction	0
	Mode	Overfill protection
	Upper switching point - Process value	0 %
	Lower switching point - Process value	0 %
	Upper switching point - Temperature	50 °C
	Upper switching point - Temperature	25 °C
	Reference value - Relay	None
	Lock adjustment	Released
	Address - Summation Secondary	free
Display	Language	Selected language
	Displayed value	Pulse rate
	Display unit	ct/s
Additional adjustments	Temperature unit	°C
	Linearisation curve	Empty
	HART mode	Standard Address 0

## 6.4 Parameter adjustment - Density measurement

The instrument is adapted to the application conditions via the parameter adjustment. The parameter adjustment is carried out with an adjustment menu.

### Prerequisites

The following requirements must be fulfilled for reliable and safe operation:

- The tube must be filled. There must be no air bubbles in the tube
- The source container is switched on
- A sample point is close to the measuring point



### Warning:

When the source container is switched on, the tube must always be filled. If the tube is empty, there can be an increased local dose rate. Make sure that the tube is filled even in case of plant downtime, or switch the source container off.

### Instrument start

Carry out a setup in the sequence described in the following.

 


### Caution:

During the first setup or after an instrument reset the instrument starts with preset standard values. These value are not suitable for your application and must be replaced by real values.

### Main menu

The main menu is divided into five sections with the following functions:



**Setup:** Settings, e.g. for measurement loop name, isotope, application, background radiation, adjustment, signal output

**Display:** Settings, for example language, measured value display



**Diagnosis:** Information, for example, of device status, peak value, simulation

**Additional adjustments:** Instrument unit, reset, date/time, copying function

**Info:** Instrument name, hardware and software version, date of manufacture, instrument features

### Procedure

  Check if the correct language is already set for the display. If not, you can change the language in the menu item "Display - Menu language".



Start with the setup of MINITRAC 31.

In the main menu item "Setup", the individual submenu items should be selected one after the other and provided with the correct parameters to ensure optimum setting of the measurement. The procedure is described in the following.

Stick with the normal sequence of the menu items as closely as possible.

#### 6.4.1 Setup

In this menu item you can adjust the MINITRAC 31 to the isotope installed in the source container.

For this purpose, check which isotope is in the source container. You can find this information on the type label of the source container.

### Isotope



Through this selection, the sensitivity of the sensor is adapted perfectly to the isotope. The normal reduction of source activity through radioactive decay is thus taken into account.

 
The MINITRAC 31 requires this information for the automatic decay compensation. This ensures error-free measurement over the entire lifetime of the gamma emitter - an annual recalibration is not necessary.

Enter the requested parameters via the appropriate keys, save your settings with **[OK]** and jump to the next menu item with the **[ESC]** and the **[→]** key.

## Application

Enter here, the respective application.

This menu item enables adaptation of the sensor to the requested application. You can choose between the following applications: "Level", "Density", "Limit level", "X-ray alarm" or "Real value correction".



## Background radiation

The natural radiation on earth influences the accuracy of the measurement.

With this menu item the natural background radiation can be faded out.



 
### Note:

Make sure that some products have a self-radiation. This is for example the case with oil or potash salt lye. Therefore the tube must be filled to determine the background radiation.

For this purpose, the MINITRAC 31 measures the natural background radiation and sets the pulse rate to zero.

In the future, the pulse rate from this background radiation will be automatically deducted from the total pulse rate. This means: only the component of the pulse rate originating from the source will be displayed.

The source container must be closed for this setting (OFF).



## Units

In this menu item you can select the units of the process value and the temperature.

Unit of the process value <b>g/cm<sup>3</sup></b>	Unit of the process value % SGU <input checked="" type="checkbox"/> <b>g/cm<sup>3</sup></b> kg/m <sup>3</sup> lb/gal	Temperature unit <input checked="" type="checkbox"/> <b>°C</b> °F
--	---	---

### Adjustment

In this menu item you can enter the measuring range (min. and max. process value) of the sensor.

These settings influence the current output of the sensor.

Adjustment

Max. process value  
**1.500 g/cm<sup>3</sup>**

Min. process value  
**0.500 g/cm<sup>3</sup>**

Enter in the menu window "Max. process value" the max. density value, for example in "g/cm<sup>3</sup>". This corresponds to an output current of 20 mA.

Max. process value

**01.500**

g/cm<sup>3</sup>

0.000 99.999

Enter in the menu window "Min. process value" the min. density value, for example in "g/cm<sup>3</sup>". This corresponds to an output current of 4 mA.

Min. process value

**00.500**

g/cm<sup>3</sup>

0.000 99.999

### Inner diameter

In this menu item you can enter the inside diameter of the tube or the radiated length (L).

This setting influences the accuracy of the sensor.

Inner diameter

**0.20 m**

First of all, select the unit of the inside diameter.

Inner diameter

m  
ft  
mm  
in  
☒ **cm**

Enter in the menu window "Inside diameter" the inside diameter of the tube, for example in "cm".

If the tube is not radiated with 90°, then you have to enter the radiated length (L) instead of the tube inside diameter.

Enter also here the radiated length without the wall thickness of the tube.


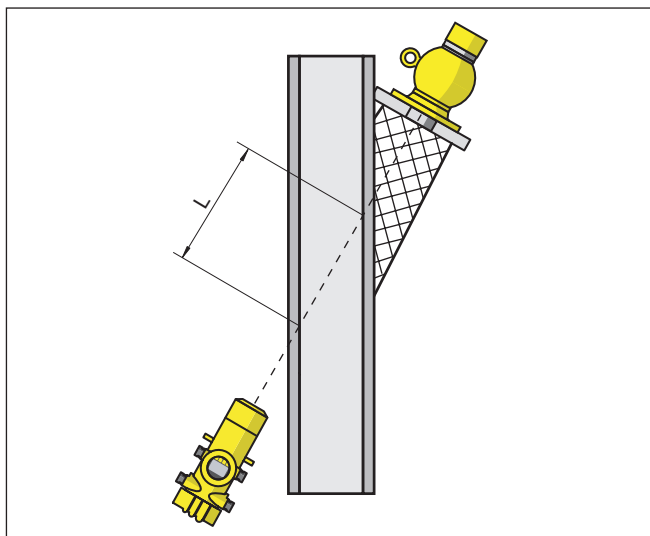


Fig. 21: With inclined mounting, the radiated length of the tube is applicable

 

## Linearisation

In this menu item you can carry out the adjustment of the sensor.



### Caution:

During the first setup or after an instrument reset, the linearization stands at the preset value pair (90000 ct/s and 0.500 g/cm<sup>3</sup>). These values are not suitable for your application and must be replaced by real values. Delete this value pair in the following procedure and carry out the linearization.

Due to the measuring principle, there is no linear relationship between pulse rate and density. Hence, this adjustment (i.e. linearization) must be carried out in any event.

Carry out this adjustment with several points to increase the accuracy of the measurement.



### Note:

Water has as a known density value of 1 g/cm<sup>3</sup>. Carry out the adjustment with water, if possible.

 
#### ● Prerequisites:

Radiation is switched on - Source container is set to "ON"


The tube is completely filled. Possible gas bubbles or air inclusions can influence the measurement.

The MINITRAC 31 sorts the points automatically according to their density.






 
Select "Show table" to display and edit the linearisation points.



 Select "Linearisation - New" to enter the first point.




 Select "Determine count rate" to enter the first point.



The determination of the actual count rate lasts 2 minutes. After the count rate has been determined, you can accept the value (ct/s).

 The count rate is stated in ct/s. This is the number of counts per second, i.e. the measured radioactive radiation dose actually reaching the sensor.



Enter now the corresponding density value (g/cm³).


You thus assign a corresponding density to the actual count rate.



### Note:

 If possible, take a product sample and determine the density simultaneously in your sampling position.

It has proven marking the product samples with date and respective count rate. Hence the values can be assigned later on without problems.



Accept the value pair with "OK".

Enter as many linearization points as possible. You can influence the accuracy of the density measurement by doing this. The more linearization points you enter and the higher the difference between the density values, the more reliable the measurement.

Value pairs that are not yet complete, e.g. due to a missing density determination, can be edited later with the function "Setup - Linearization" under the item "Change/Edit".

A maximum of 32 linearisation points is possible.




### Note:

 If you cannot change the medium during the adjustment process, it is possible to carry out the linearization with only one point. However, you should enter further linearization points later, if possible.


- Show diagram

This menu item is only available if a linearization was already carried out.





- Show table

 In this menu item you can show the individual value pairs of the linearization.







- Linearization - Delete

  You can also delete individual linearization points. Enter the number of the point you want to delete.




- Linearization - Modify

    You can also modify individual linearization points.



 After editing, you have to activate the complete value pair so that the linearization point will be effective.




You recognize active linearization points by a small square with a cross next to the number of the linearization point.

### Damping

In this menu item you can adjust the damping of the sensor. With it you can suppress fluctuations in the measured value indication, caused e.g. by an agitated product surface. This time can be between 1 and 1200 seconds. Keep in mind that the reaction time also increases and the instrument reacts to quick level changes with a delay. Generally a time of approximately 60 seconds is sufficient to smooth the measured value indication.

With the setting "Automatic", the instrument itself calculates a suitable damping on the basis of the adjustment and the measured value changes. This setting is particularly suitable for application where fast and slow level changes occur.

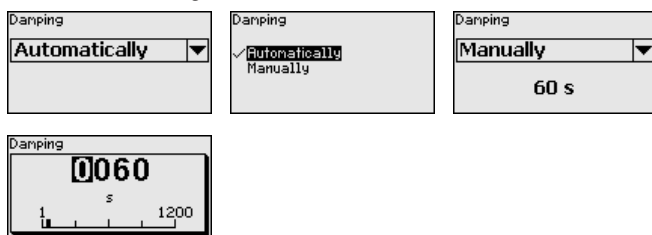


### Real value correction (manually)

The implementation of a real value correction is only necessary if the requirements of the measurement loop have changed, for example with abrasion in a tube.

If you know the density of a certain medium, you can enter the determined real density in this menu item to correct the measured value. The function shifts the linearization curve to this determined point.

 The measurement can thus be adapted exactly to the conditions in the tube.



### Relay

In this menu item you can activate the relay output and determine its function as well as the switching points.

 
When the output of the process values is set, you can choose between overfill and dry run protection.

The relay outputs of the sensor react accordingly.

You can choose "no" reference value. In this case, the relay output operates as fail safe relay.

This does not apply if "X-ray alarm" is selected as reference value. In this case the fault message is not active.


- None - Relay operates as fail safe relay
- Electronics temperature
- Process value
- External radiation



Push the  $\rightarrow$  button, to reach the relay settings.

Example for the setting the process value

First of all select the requested mode (overflow or dry run protection).

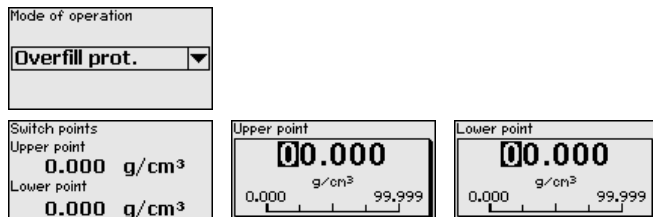

#### Caution:

Independent of the selected reference value, the relay will deenergize in case of failure.

This does not apply if "X-ray alarm" is selected as reference value. In this case the fault message is not active.

### Lock/Unlock adjustment

In the menu item "Lock/unlock adjustment", you can protect the sensor parameters against unauthorized or inadvertent modification. The sensor is locked/unlocked permanently.

With locked instrument, only the following adjustment functions are possible without entering a PIN:

- Select menu items and show data
- Read data from the sensor into the display and adjustment module



Before you lock the sensor in unlocked condition, you can modify the four-digit PIN number.

Keep the entered PIN number in mind. Operation of the sensor is only possible with this PIN number.



#### Caution:

When the PIN is active, adjustment via PACTware/DTM as well as other systems is also blocked.

In delivery status, the PIN is **0000**.

Call our service department if you have modified and forgotten the PIN.

 
### 6.4.2 Display

In the main menu point "Display", the individual submenu points should be selected one after the other and provided with the correct

parameters to ensure the optimum adjustment of the display. The procedure is described in the following.

### Menu language


This menu item enables the setting of the requested national language.



In delivery status, the sensor is set to the ordered national language. If no language is preset, you will be asked during setup.

### Displayed value

 
With this parameter you can change the indication of the display. You can choose if the display should show the actual pulse rate, the electronics temperature or the percentage value. You can choose whether the display should show the current pulse rate, the electronics temperature, the process value or the output signal.



## 6.4.3 Diagnostics

### Device status

 In this menu item, you can enquire the status of your sensor. In normal operation, the sensor displays the message "OK". In case of fault, you will find the corresponding fault code here.



### Peak value indicator

The peak value function holds the max. and min. values during operation.

- Pulse rates - min./max.
- Temperature - min./max./actually

 
Peak values	
Pulse/sec. min.	0ct/s
Pulse/sec. max.	35467ct/s
T.-min.	21,5 °C
T.-max.	31,5 °C
T.-act.	31,0 °C

### Adjustment data

Here you can retrieve the adjustment value of the sensor. This is the percentage value of the difference of the min. and max. adjustment points (Delta I). The value is an indication for the reliability and non-repeatability of the measurement.

The higher the difference between the two adjustment points, the higher the differential value (Delta I) and the more reliable the measurement. A Delta I value below 10 % is an indication for a critical measurement.

To increase the Delta I value, you have to increase the distance of the min. and max. adjustment points in the linearization.



## Simulation

In this menu item you can simulate measured values via the signal output. This allows the signal path to be tested, e.g. through downstream indicating instruments or the input card of the control system.

 


### Note:

To carry out a simulation with the display and adjustment module, you have to switch on the simulation switch on the electronics module (switch position 1).

You can find the rotary switch on the electronics module in the electronics and connection department (large cover).


You can simulate different values:




Pulse rate of the sensor



 Process value



Switching function of the relay

 


### Information:


The simulation is automatically terminated 10 minutes after the last pressing of a key.

## 6.4.4 Additional adjustments
 
### Date/Time




 In this menu item you can set the actual date, time and display format.



### Reset

 When a reset is carried out, all settings (with only a few exceptions) are reset. The exceptions are: PIN, language, SIL and HART mode.



The following reset functions are available:

**Basic settings:** Resetting of the parameter adjustments to default values at the time of shipment. Order-specific settings are deleted.

**Default settings:** Resetting of the parameter adjustment like under "Basic settings". In addition, special parameters are reset to default values. Order-specific settings are deleted.

**Peak values of measured value:** Resetting of the parameter adjustments in the menu item "Setup" to the default values of the respective instrument. Order-specific settings remain but are not taken over into the current parameters.

**Peak values of temperature:** Resetting of the measured min. and max. temperatures to the actual measured value.

The following table shows the default values of the instrument. The values apply for the application "Density". First of all you have to select the application.


Depending on the instrument version, not all menu items may be available or they may be differently assigned:

Menu	Menu item	Default value
Setup	Measurement loop name	Sensor
	Isotope	Cs-137
	Application	Density
	Background radiation	0 ct/s
	Process value unit	g/cm <sup>3</sup>
	Temperature unit	° C
	Adjustment min. process value	0.500 g/cm <sup>3</sup>
	Adjustment max. process value	1.500 g/cm <sup>3</sup>
	Inner diameter	0.20 m
	Linearisation	90000 ct/s and 0.500 g/cm <sup>3</sup>
	Damping	60 s
	Real value correction	0
	Reference value - Relay	None
	Lock adjustment	Released

Menu	Menu item	Default value
Display	Language	Selected language
	Displayed value	Pulse rate
	Display unit	ct/s

### Copy instrument settings With this function

 - Load parameter adjustment data from the sensor into the display and adjustment module
- Write parameter adjustment data from the display and adjustment module into the sensor



The copied data are permanently saved in an EEPROM memory in the display and adjustment module and remain there even in case of a power failure. From there, they can be written into one or more sensors or kept as backup for a possible sensor exchange.



#### Note:

Before the data are copied into the sensor, a check is carried out to determine if the data fit the sensor. If the data do not fit, a fault signal is triggered. When data are being written into the sensor, the display shows which instrument type the data originate from and which TAG number this sensor had.

### 6.4.5 Info

#### Info

In this menu you will find the following menu items:

- Instrument name - shows instrument name and serial number
- Instrument version - shows hardware and software version of the instrument
- Date of manufacture - shows calibration date and the date of the last change
- Device ID - shows the device ID and the sensor TAG (PD\_TAG)
- Instrument features - shows further instrument features, such as e.g. approval, electronics ...

Examples for info display:

Softwareversion <b>2.0.1</b> Hardwareversion <b>1.06</b>	Kalibrierdatum <b>3. April 2013</b> Letzte Änderung <b>4. Nov 2016</b>	Geräteneigenschaften Housing / Protection Aluminium / IP66/IP67
---	---	---

### 6.5 Parameter adjustment - Point level detection

The instrument is adapted to the application conditions via the parameter adjustment. The parameter adjustment is carried out with an adjustment menu.



### Instrument start



 
#### Caution:

During the first setup or after an instrument reset the instrument starts with preset standard values. These value are not suitable for your application and must be replaced by real values.

Carry out a setup in the sequence described in the following.

### Main menu

The main menu is divided into five sections with the following functions:



**Setup:** Settings, e.g. for measurement loop name, isotope, application, background radiation, adjustment, signal output

**Display:** Settings, for example language, measured value display



**Diagnosis:** Information, for example, of device status, peak value, simulation

**Additional adjustments:** Instrument unit, reset, date/time, copying function

**Info:** Instrument name, hardware and software version, date of manufacture, instrument features

### Procedure

  Check if the correct language is already set for the display. If not, you can change the language in the menu item "Display - Menu language".



Start with the setup of MINITRAC 31.

In the main menu item "Setup", the individual submenu items should be selected one after the other and provided with the correct parameters to ensure optimum setting of the measurement. The procedure is described in the following.



Stick with the normal sequence of the menu items as closely as possible.

### 6.5.1 Setup
  
#### Isotope

In this menu item you can adjust the MINITRAC 31 to the isotope installed in the source container.

For this purpose, check which isotope is in the source container. You can find this information on the type label of the source container.



Through this selection, the sensitivity of the sensor is adapted perfectly to the isotope. The normal reduction of source activity through radioactive decay is thus taken into account.


The MINITRAC 31 requires this information for the automatic decay compensation. This ensures error-free measurement over the entire lifetime of the gamma emitter - an annual recalibration is not necessary.

Enter the requested parameters via the appropriate keys, save your settings with **[OK]** and jump to the next menu item with the **[ESC]** and the **[->]** key.

## Application

 Enter here, the respective application.

This menu item enables adaptation of the sensor to the requested application. You can choose between the following applications: "Level", "Point level" or "Summation Secondary".



## Background radiation

 
The natural radiation on earth influences the accuracy of the measurement.

With this menu item the natural background radiation can be faded out.

For this purpose, the MINITRAC 31 measures the natural background radiation and sets the pulse rate to zero.


In the future, the pulse rate from this background radiation will be automatically deducted from the total pulse rate. This means: only the component of the pulse rate originating from the source will be displayed.

The source container must be closed for this setting.



## Unit

 In this menu item you can select the temperature unit.



## Adjustment mode

in this menu item you can select if you want to carry out a single or double point adjustment on the sensor.

 
With the double point adjustment, the Delta I value is selected automatically.

We recommend selecting the double point adjustment. To use this, you must be able to change the level of the vessel so as to carry out

the adjustment of the sensor with full status (covered) and with empty status (uncovered).

Hence, you will get a very reliable switching point.

With single point adjustment, you have to define the difference between the min. and max. adjustment points (Delta I) yourself during the following setup.



### Adjustment "uncovered" (single point adjustment)

This menu item appears only if you have selected "**Single point adjustment**" as adjustment mode (Setup - Adjustment mode).

In this menu item you determine the point at which the MINITRAC 31 should switch in uncovered status.

 
Empty the vessel until the sensor is uncovered.

For this enter the requested pulse rate manually or let the rate be determined by MINITRAC 31. Automatic determination of the pulse rate should be given preference.


The count rate is stated in ct/s. This is the number of counts per second, i.e. the measured radioactive radiation dose actually reaching the sensor.

Prerequisites:

- Radiation is switched on - Source container is set to "ON"
- There is no medium between source container and sensor



 You can enter the value for "*Adjustment uncovered*" (ct/s) manually.



You can have the value for "*Adjustment uncovered*" determined by MINITRAC 31.



### Delta I (single point adjustment)

This menu item appears only if you have selected "**Single point adjustment**" as adjustment mode (Setup - Adjustment mode).

 
In this menu item you can adjust at which percentage value of the max. pulse rate the sensor should switch over.

Since in most cases the radiation is almost completely absorbed when the sensor is covered, the pulse rate when the sensor is covered is very low.

The change between the two statuses is sufficiently clear.

Hence a percentage value of 90 % for the Delta I value is recommended.

You select lower values for sensitive detection of material cones or buildup which cause only partial absorption of the radiation.



### Adjustment "covered" (two-point adjustment)

 
This menu item appears only if you have selected "**Two point adjustment**" as adjustment mode (Setup - Adjustment mode).

In this menu item you can set the min. pulse rate (ct/s) at which the sensor should switch over.


Fill the vessel until the MINITRAC 31 is covered.

You thus get the min. pulse rate (ct/s) for the "covered" adjustment.

Enter the requested pulse rate manually or let the rate be determined by MINITRAC 31. Automatic determination of the pulse rate should be given preference.



 You can enter the adjustment point (ct/s) manually.



You can let the adjustment point be determined by MINITRAC 31.



### Adjustment "uncovered" (two-point adjustment)

This menu item appears only if you have selected "**Two point adjustment**" as adjustment mode (Setup - Adjustment mode).

In this menu item you can set the max. pulse rate (ct/s) at which the sensor should switch over.

 
Empty the vessel until the MINITRAC 31 is uncovered.

You thus get the max. pulse rate (ct/s) for the "uncovered" adjustment.

Enter the requested pulse rate manually or let the rate be determined by MINITRAC 31. Automatic determination of the pulse rate should be given preference.



You can enter the adjustment point (ct/s) manually.



You can let the adjustment point be determined by MINITRAC 31.



## Relay

 
In this menu item you can select which mode the sensor should operate in.

You can choose between overfill and dry run protection.

The relay outputs of the sensor react accordingly.

Overfill protection = the relay will deenergise (safe state) when the max. level is reached.

Dry run protection = the relay will deenergise (safe state) when the min. level is reached.



## Lock/Unlock adjustment

In the menu item "Lock/unlock adjustment", you can protect the sensor parameters against unauthorized or inadvertent modification. The sensor is locked/unlocked permanently.

With locked instrument, only the following adjustment functions are possible without entering a PIN:

- Select menu items and show data
- Read data from the sensor into the display and adjustment module



Before you lock the sensor in unlocked condition, you can modify the four-digit PIN number.

Keep the entered PIN number in mind. Operation of the sensor is only possible with this PIN number.



### Caution:

When the PIN is active, adjustment via PACTware/DTM as well as other systems is also blocked.

In delivery status, the PIN is 0000.

 
Call our service department if you have modified and forgotten the PIN.

### 6.5.2 Display

In the main menu point "Display", the individual submenu points should be selected one after the other and provided with the correct parameters to ensure the optimum adjustment of the display. The procedure is described in the following.

#### Menu language

This menu item enables the setting of the requested national language.




In delivery status, the sensor is set to the ordered national language. If no language is preset, you will be asked during setup.

#### Displayed value

 With this parameter you can change the indication of the display.

You can choose if the display should show the actual pulse rate or the electronics temperature.



### 6.5.3 Diagnostics

#### Device status

In this menu item, you can enquire the status of your sensor. In normal operation, the sensor displays the message "OK". In case of fault, you will find the corresponding fault code here.



#### Peak value indicator

The peak value function holds the max. and min. values during operation.

- Pulse rates - min./max.
- Temperature - min./max./actually

Peak values	
Pulse/sec. min.	0 ct/s
Pulse/sec. max.	35467 ct/s
T.-min.	21.5 °C
T.-max.	31.5 °C
T.-act.	31.0 °C

#### Adjustment data

 
Here, you can retrieve the adjustment value of the sensor. This is the percentage value of the max. pulse rate at which the sensor switches over.

If you have carried out a single point adjustment, this is the entered value. With a two-point adjustment, this is the calculated value.

The value is an indication for the reliability and non-repeatability of the switching point.

The greater the difference in the pulse rate between covered and uncovered status, the greater the differential value (Delta I) and the more reliable the measurement. The automatically calculated damping is also oriented around the Delta I value. The higher the value, the lower the damping.

A Delta I value below 10 % is an indication for a critical measurement.



### Simulation

In this menu item you can simulate measured values via the signal output. This allows the signal path to be tested, e.g. through downstream indicating instruments or the input card of the control system.

 


#### Note:

To carry out a simulation with the display and adjustment module, you have to switch on the simulation switch on the electronics module (switch position 1).

You can find the rotary switch on the electronics module in the electronics and connection department (large cover).


You can simulate different values:



Pulse rate of the sensor



 Switching function of the relay




#### Information:

10 minutes after the key was pressed for the last time, the simulation is interrupted automatically. You can also interrupt the simulation with the switch on the electronics module.


### Calculated damping

 The sensor calculates a suitable integration time automatically.






#### 6.5.4 Additional adjustments
 
##### Date/Time






   In this menu item you can set the actual date, time and display format.



##### Reset

   When a reset is carried out, all settings (with only a few exceptions) are reset. The exceptions are: PIN, language, SIL and HART mode.



The following reset functions are available:

**Basic settings:** Resetting of the parameter adjustments to default values at the time of shipment. Order-specific settings are deleted.

**Default settings:** Resetting of the parameter adjustment like under "Basic settings". In addition, special parameters are reset to default values. Order-specific settings are deleted.

**Peak values of measured value:** Resetting of the parameter adjustments in the menu item "Setup" to the default values of the respective instrument. Order-specific settings remain but are not taken over into the current parameters.

**Peak values of temperature:** Resetting of the measured min. and max. temperatures to the actual measured value.

The following table shows the default values of the instrument. The values apply for the application "Limit level". First of all you have to select the application.


Depending on the instrument version, not all menu items may be available or they may be differently assigned:



Menu	Menu item	Default value
Setup	Measurement loop name	Sensor
	Isotope	Cs-137
	Application	Limit level
	Adjustment mode	Single point adjustment
	Adjustment - uncovered	90000 ct/s
	Adjustment - covered	9000 ct/s only with two-point adjustment
	Delta I	90 %
	Background radiation	0 ct/s
	Temperature unit	° C
	Adjustment mode	1-point
	Adjustment uncovered	900000 ct/s
	Delta I	90 %
	Mode - Relay	Overfill protection
	Lock adjustment	Released
Display	Language	Selected language
	Displayed value	Pulse rate
	Display unit	ct/s

### Copy instrument settings With this function

 - Load parameter adjustment data from the sensor into the display and adjustment module
- Write parameter adjustment data from the display and adjustment module into the sensor



The copied data are permanently saved in an EEPROM memory in the display and adjustment module and remain there even in case of a power failure. From there, they can be written into one or more sensors or kept as backup for a possible sensor exchange.



#### Note:

Before the data are copied into the sensor, a check is carried out to determine if the data fit the sensor. If the data do not fit, a fault signal is triggered. When data are being written into the sensor, the display shows which instrument type the data originate from and which TAG number this sensor had.

### 6.5.5 Info

#### Info

In this menu you will find the following menu items:

- Instrument name - shows instrument name and serial number

- Instrument version - shows hardware and software version of the instrument
- Date of manufacture - shows calibration date and the date of the last change
- Device ID - shows the device ID and the sensor TAG (PD\_TAG)
- Instrument features - shows further instrument features, such as e.g. approval, electronics ...

Examples for info display:

Softwareversion <b>2.0.1</b> Hardwareversion <b>1.06</b>	Kalibrierdatum <b>3. April 2013</b> Letzte Änderung <b>4. Nov 2016</b>	Geräteerkennung Housing / Protection  Aluminium / IP66/IP67
---	---	--

## 6.6 Parameter adjustment - X-ray alarm

### X-ray alarm

X-ray radiation, for example, cause with weld joint tests can influence your measured values unnoticeably. Hence it is important to recognize interfering X-ray radiation.

The MINITRAC 31 recognizes the X-ray radiation and reacts from an individually definable radiation volume.

 
The level or density measuring instrument acts as Master and the MINITRAC 31 operates as Slave.

First of all, define the function of the Secondary instruments before you define the Primary instrument. The Primary instrument can thus immediately recognize the connected Secondaries.

For this purpose, the Secondary instrument must be defined as "X-ray alarm". Select under the menu item "Setup - Application" the function "X-ray alarm".

The address setting (MGC) on the Secondary instruments can be freely selected. Only the address "0 - 0" is reserved for the Primary instrument.


Set the address setting (MGC) on the Primary instrument to "0 - 0".



You have to enter the addresses of the Secondary instruments in the list of the Primary instruments. This function is not possible in the supply and adjustment module. To do this you need PACTware with the respective DTM.

### Main menu

 The main menu is divided into five sections with the following functions:



**Setup:** Settings, e.g. for measurement loop name, isotope, application, background radiation, adjustment, signal output

**Display:** Settings, for example language, measured value display


**Diagnosis:** Information, for example, of device status, peak value, simulation

**Additional adjustments:** Instrument unit, reset, date/time, copying function

**Info:** Instrument name, hardware and software version, date of manufacture, instrument features

## Procedure

 Check if the correct language is already set for the display. If not, you can change the language in the menu item " *Display - Menu language*".



Start with the setup of MINITRAC 31.

In the main menu item " *Setup*", the individual submenu items should be selected one after the other and provided with the correct parameters to ensure optimum setting of the measurement. The procedure is described in the following.

Stick with the normal sequence of the menu items as closely as possible.

### 6.6.1 Setup

## Isotope

In this menu item you can adjust the MINITRAC 31 to the isotope installed in the source container.

For this purpose, check which isotope is in the source container. You can find this information on the type label of the source container.



With this selection, the sensitivity of the sensor is adapted in an optimum way to the isotope.

 
The MINITRAC 31 requires this information for the decay compensation. An annual recalibration is hence not necessary.

Enter the requested parameters via the appropriate keys, save your settings with **[OK]** and jump to the next menu item with the **[ESC]** and **[>]** key.

## Application

Enter here, the respective application.

This menu item enables adaptation of the sensor to the requested application. You can choose between the following applications: " *Level*", " *Density*", " *Limit level*", " *X-ray alarm*" or " *Real value correction*".



**Lock/Unlock adjustment**

In the menu item " *Lock/unlock adjustment*", you can protect the sensor parameters against unauthorized or inadvertent modification. The sensor is locked/unlocked permanently.

With locked instrument, only the following adjustment functions are possible without entering a PIN:

- Select menu items and show data
- Read data from the sensor into the display and adjustment module



Before you lock the sensor in unlocked condition, you can modify the four-digit PIN number.

Keep the entered PIN number in mind. Operation of the sensor is only possible with this PIN number.

**Caution:**

When the PIN is active, adjustment via PACTware/DTM as well as other systems is also blocked.

In delivery status, the PIN is **0000**.

Call our service department if you have modified and forgotten the PIN.

**6.7 Parameter adjustment - Real value correction****Real value correction**

To correct a level measurement, a real value correction can be carried out when a certain level is reached. This is for example necessary in case of recurring buildup on the vessel wall.

The level measurement can thus be reset to the correct real value.

The level measuring instrument acts as Primary and the MINITRAC 31 operates as Secondary.

 
First of all, define the function of the Secondary instruments before you define the Primary instrument. The Primary instrument can thus immediately recognize the connected Secondaries.

For this purpose, the Secondary instrument must be defined as "Real value correction". Select under the menu item " *Setup - Application*" the function "Real value correction".

The address setting (MGC) on the Secondary instruments can be freely selected. Only the address "0 - 0" is reserved for the Primary instrument.

The Primary instrument must have the function "Level". For this purpose, select under the menu item " *Setup - Application*" the function "Level".


Set the address setting (MGC) on the Primary instrument to "0 - 0".



You have to enter the addresses of the Secondary instruments in the list of the Primary instruments. This function is not possible in the supply and adjustment module. To do this you need PACTware with the respective DTM.

## Main menu

 The main menu is divided into five sections with the following functions:



**Setup:** Settings, e.g. for measurement loop name, isotope, application, background radiation, adjustment, signal output

**Display:** Settings, for example language, measured value display


**Diagnostics:** Information, for example, of device status, peak value, simulation

**Additional adjustments:** Instrument unit, reset, date/time, copying function

**Info:** Instrument name, hardware and software version, date of manufacture, instrument features

## Procedure

 Check if the correct language is already set for the display. If not, you can change the language in the menu item "Display - Menu language".



Start with the setup of MINITRAC 31.

In the main menu item "Setup", the individual submenu items should be selected one after the other and provided with the correct parameters to ensure optimum setting of the measurement. The procedure is described in the following.

Stick with the normal sequence of the menu items as closely as possible.

### 6.7.1 Setup

## Isotope

In this menu item you can adjust the MINITRAC 31 to the isotope installed in the source container.

For this purpose, check which isotope is in the source container. You can find this information on the type label of the source container.



With this selection, the sensitivity of the sensor is adapted in an optimum way to the isotope.

 
The MINITRAC 31 requires this information for the decay compensation. An annual recalibration is hence not necessary.

Enter the requested parameters via the appropriate keys, save your settings with **[OK]** and jump to the next menu item with the **[ESC]** and the **[→]** key.

## Application

Enter here, the respective application.

This menu item enables adaptation of the sensor to the requested application. You can choose between the following applications: "Level", "Density", "Limit level", "X-ray alarm" or "Real value correction".



## Lock/Unlock adjustment

In the menu item "Lock/unlock adjustment", you can protect the sensor parameters against unauthorized or inadvertent modification. The sensor is locked/unlocked permanently.

With locked instrument, only the following adjustment functions are possible without entering a PIN:

- Select menu items and show data
- Read data from the sensor into the display and adjustment module



Before you lock the sensor in unlocked condition, you can modify the four-digit PIN number.

Keep the entered PIN number in mind. Operation of the sensor is only possible with this PIN number.



### Caution:

When the PIN is active, adjustment via PACTware/DTM as well as other systems is also blocked.

In delivery status, the PIN is **0000**.

Call our service department if you have modified and forgotten the PIN.

## 6.8 Saving the parameterisation data

### On paper

We recommended writing down the adjustment data, e.g. in this operating instructions manual, and archiving them afterwards. They are thus available for multiple use or service purposes.

### In the display and adjustment module

If the instrument is equipped with a display and adjustment module, the parameter adjustment data can be saved therein. The procedure is described in menu item "Copy device settings".

## 7 Setup with PACTware

### 7.1 Connect the PC

Via the interface adapter directly on the sensor

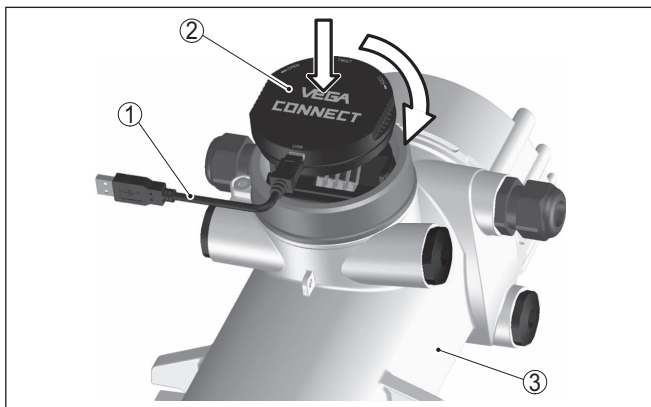


Fig. 22: Connection of the PC directly to the sensor via the interface adapter

- 1 USB cable to the PC
- 2 Interface adapter VEGACONNECT 4
- 3 Sensor



#### Information:

The interface adapter VEGACONNECT 3 is not suitable for connection to the sensor.

### 7.2 Parameter adjustment with PACTware

#### Prerequisites

For parameter adjustment of the sensor via a Windows PC, the configuration software PACTware and a suitable instrument driver (DTM) according to FDT standard are required. The up-to-date PACTware version as well as all available DTMs are compiled in a DTM Collection. The DTMs can also be integrated into other frame applications according to FDT standard.



#### Note:

To ensure that all instrument functions are supported, you should always use the latest DTM Collection. Furthermore, not all described functions are included in older firmware versions. You can download the latest instrument software from our homepage. A description of the update procedure is also available in the Internet.

Further setup steps are described in the operating instructions manual "DTM Collection/PACTware" attached to each DTM Collection and which can also be downloaded from the Internet. Detailed descriptions are available in the online help of PACTware and the DTMs.

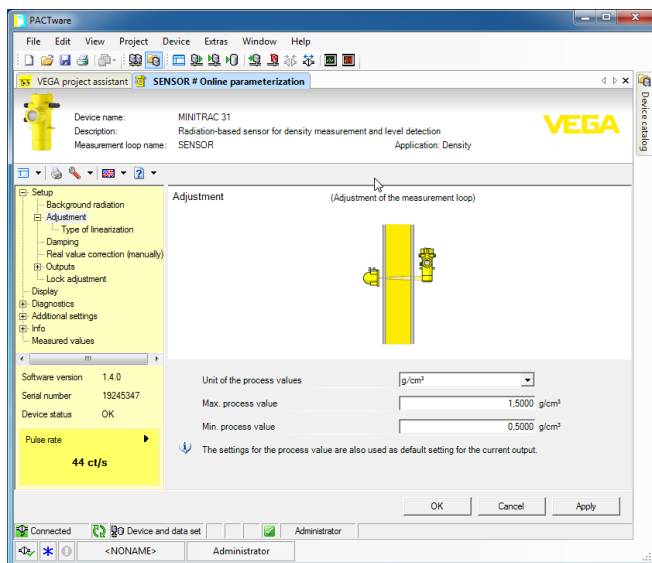


Fig. 23: Example of a DTM view

### Standard/Full version

All device DTMs are available as a free-of-charge standard version and as a full version that must be purchased. In the standard version, all functions for complete setup are already included. An assistant for simple project configuration simplifies the adjustment considerably. Saving/printing the project as well as import/export functions are also part of the standard version.

In the full version there is also an extended print function for complete project documentation as well as a save function for measured value and echo curves. In addition, there is a tank calculation program as well as a multiviewer for display and analysis of the saved measured value and echo curves.

The standard version is available as a download under [www.vega.com/downloads](http://www.vega.com/downloads) and "Software". The full version is available on CD from the agency serving you.

## 7.3 Saving the parameterisation data

We recommend documenting or saving the parameterisation data via PACTware. That way the data are available for multiple use or service purposes.



## 8 Set up with other systems

### 8.1 DD adjustment programs

Device descriptions as Enhanced Device Description (EDD) are available for DD adjustment programs such as, for example, AMS™ and PDM.

The files can be downloaded at [www.vega.com/downloads](http://www.vega.com/downloads) under "*Software*".

### 8.2 Field Communicator 375, 475

Device descriptions for the instrument are available as EDD for parameterisation with Field Communicator 375 or 475.

Integrating the EDD into the Field Communicator 375 or 475 requires the "Easy Upgrade Utility" software, which is available from the manufacturer. This software is updated via the Internet and new EDDs are automatically accepted into the device catalogue of this software after they are released by the manufacturer. They can then be transferred to a Field Communicator.

## 9 Diagnostics and servicing

### 9.1 Maintenance

If the device is used properly, no special maintenance is required in normal operation.

The corresponding source container must be checked in regular intervals. You can find further information in the operating instructions manual of the source container.

### 9.2 Status messages

The instrument features self-monitoring and diagnostics according to NE 107 and VDI/VDE 2650. In addition to the status messages in the following tables there are more detailed error messages available under the menu item "Diagnostics" via the respective adjustment module.

#### Status messages

The status messages are divided into the following categories:

- Failure
- Function check
- Out of specification
- Maintenance required

and explained by pictographs:

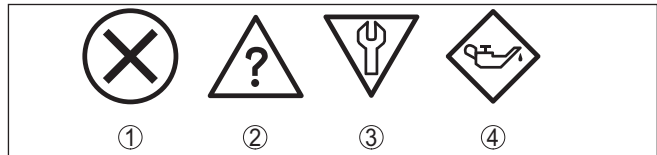


Fig. 24: Pictographs of the status messages

- 1 Failure - red
- 2 Out of specification - yellow
- 3 Function check - orange
- 4 Maintenance required - blue

**Failure:** Due to a malfunction in the instrument, a fault signal is output.

This status message is always active. It cannot be deactivated by the user.

**Function check:** The instrument is being worked on, the measured value is temporarily invalid (for example during simulation).

This status message is inactive by default.

**Out of specification:** The measured value is unreliable because an instrument specification was exceeded (e.g. electronics temperature).

This status message is inactive by default.

**Maintenance required:** Due to external influences, the instrument function is limited. The measurement is affected, but the measured value is still valid. Plan in maintenance for the instrument because a failure is expected in the near future (e.g. due to buildup).

This status message is inactive by default.

## Failure

Code Text message	Cause	Rectification
F008 Error multi sensor communication	Additional sensors not switched on EMC influences No other sensor available	Check wiring between the sensors Connect the sensors correctly and make them ready for operation
F013 Sensor signals a fault	Error on the current input/digital input No valid measured value Connected instruments without function	Check current input Check connected instruments (Secondary instrument)
F016 Adjustment data exchanged	Values of the min. and max. adjustment exchanged	Correct adjustment data
F017 Adjustment span too small	The values of the min. and max. adjustment are too close together	Correct adjustment data
F025 Invalid linearization table	Wrong or empty linearization table (1074, 1075, 1080, 1100, 1106) Wrong value in the linearization table (1143, 1144)	Create linearization table Correct linearization table
F030 Process value out of limits	Process values are not within the adjusted measuring range	Repeat adjustment
F034 EPROM hardware error	Electronics defective	Restart instrument Exchanging the electronics
F035 EPROM data error	Error in the internal instrument communication	Carry out a reset Exchanging the electronics
F036 Faulty program memory	Error during software update	Repeat software update Exchanging the electronics
F037 RAM hardware error	Error in RAM	Restart instrument Exchanging the electronics
F038 Secondary signals failure	Connection cable to the Secondary instrument interrupted Instrument not defined as Secondary instrument One of the Secondary instruments signals a failure	Check the connection cable to the Secondary instrument Define instrument as Secondary Check Secondary instruments
F040 Hardware error	Instrument defective (1092, 1126) Temperature outside the specification (1091)	Restart instrument Exchanging the electronics Cool the instrument or protect it with isolation material against heat/cold
F041 Photomultiplier error	Error in the measured value recording	Restart instrument Exchanging the electronics
F052 Faulty configuration	Invalid parameter adjustment	Carry out a reset

Code Text message	Cause	Rectification
F066 Faulty adjustment	Adjustment not yet carried out Error during adjustment or when entering the linearisation table	Carry out adjustment Carry out linearisation
F068 Count rate too high	Faulty instrument settings (1031) Faulty steam density compensation (1101)	Carry out a reset Check Secondary instrument (steam density)
F072 Limit exceeded	Faulty instrument settings	Carry out a reset
F073 Error real value correction	Faulty real value correction	Carry out real value correction again
F080 System error	Instrument error	Restart instrument Call our service
F086 Communication error	Error in the Fieldbus communication	Restart instrument Call our service
F114 Error real time clock	Discharge accumulator	Readjust real time clock
F120 Filter time error	Faulty or missing instrument adjustment	Carry out adjustment
F121 Faulty participant list on the multisensor communication bus	Secondary instruments not found Secondary instrument with wrong address	Check Secondary instruments Check Secondary list in Primary instrument Correct address of Secondary instruments
F122 Double addresses on the multisensor communication bus	Instrument address was assigned several times	Change instrument addresses
F123 X-ray alarm	External instruments cause radiation Radiation above the max. adjustment value	Determine reason for X-ray alarm In case of brief X-ray radiation: Monitor switching outputs for this time manually
F124 Alarm due to increased radiation	Radiation dose too high	Determine reason for increased radiation
F125 Ambient temperature too high	Ambient temperature on the housing outside the specification	Cool the instrument or protect it with isolating material against radiation heat
F126 Error in the trend recording	Instrument error	Call our service
F141 Communication error on the multisensor communication bus	Secondary instrument does not answer	Check Secondary instruments

Tab. 4: Error codes and text messages, information on causes as well as corrective measures

## Function check

Code Text message	Cause	Rectification
C029 Simulation	Simulation active	Finish simulation Wait for the automatic end after 60 mins.

Tab. 5: Error codes and text messages, information on causes as well as corrective measures

## Out of specification

Code Text message	Cause	Rectification
S017 Accuracy outside the specification	Accuracy outside the specification	Correct adjustment data
S025 Bad linearization table	Bad linearization table	Carry out linearisation
S038 Secondary outside the specification	Secondary instrument outside the specification	Check Secondary instruments
S125 Ambient temperature too high/too low	Ambient temperature too high/too low	Protect instrument with isolating material against extreme temperatures

Tab. 6: Error codes and text messages, information on causes as well as corrective measures

## Maintenance

The instrument has no status messages to the section "Maintenance".

## 9.3 Rectify faults

### Reaction when malfunction occurs

The operator of the system is responsible for taking suitable measures to rectify faults.

### Procedure for fault rectification

The first measures are:

- Evaluation of fault messages via the display and adjustment module
- Checking the output signal
- Treatment of measurement errors

Further comprehensive diagnosis possibilities are offered by a PC with the software PACTware and suitable DTM.

In many case, the failure reasons can thus be determined and faults rectified.

### Check output signal (level measurement)

The following table describes possible errors with the output signal and helps to remove them:

Error	Cause	Rectification
Output signal not stable	Level fluctuations	Set damping appropriate to the instrument via the display and adjustment module or PACTware/DTM
Output signal missing	Electrical connection faulty	Check connection according to chapter "Connection steps" and if necessary, correct according to chapter "Wiring plan"
	Voltage supply missing	Check cables for breaks; repair if necessary
	Operating voltage too low	Check, adapt if necessary

### Check output signal (level detection)

The following table describes possible faults that may not generate an error message:

Error	Cause	Rectification
<p>The instrument signals covered without being covered by the measured medium</p> <p>The instrument signals uncovered while covered with the measured medium</p>	Voltage supply missing	Check cables for breaks; repair if necessary
	Operating voltage too low	Check, adapt if necessary
	Electrical connection faulty	Check connection according to chapter "Connection steps" and if necessary, correct according to chapter "Wiring plan"
	Electronics defective	Change the switching behaviour of the sensors under "Diagnosis/Simulation". If the instrument does not switch over, send it in for repair.
	Buildup on the inner wall of the vessel	<p>Remove buildup</p> <p>Check the Delta I value.</p> <p>Improve the switching threshold - carry out a double point adjustment</p>

### Reaction after fault rectification

Depending on the reason for the fault and the measures taken, the steps described in chapter "Setup" must be carried out again or must be checked for plausibility and completeness.

### 24 hour service hotline

Should these measures not be successful, please call in urgent cases the VEGA service hotline under the phone no. **+49 1805 858550**.

The hotline is also available outside normal working hours, seven days a week around the clock.

Since we offer this service worldwide, the support is provided in English. The service itself is free of charge, the only costs involved are the normal call charges.

## 9.4 Exchanging the electronics module

If the electronics module is defective, it can be replaced by the user.



In Ex applications, only instruments and electronics modules with appropriate Ex approval may be used.

If there is no electronics module available on site, the electronics module can be ordered through the agency serving you. The electronics modules are adapted to the respective sensor and differ in signal output or voltage supply.

The new electronics module must be loaded with the default settings of the sensor. These are the options:

- In the factory
- Or on site by the user

In both cases, the serial number of the sensor is needed. The serial numbers are stated on the type label of the instrument, on the inside of the housing as well as on the delivery note.

When loading on site, the order data must first be downloaded from the Internet (see operating instructions " *Electronics module*").



**Caution:**

All application-specific settings must be entered again. That's why you have to carry out a fresh setup after exchanging the electronics.

If you saved the parameter settings during the first setup of the sensor, you can transfer them to the replacement electronics module. A fresh setup is then not necessary.

## 9.5 Software update

The following components are required to update the instrument software:

- Instrument
- Voltage supply
- Interface adapter VEGACONNECT
- PC with PACTware
- Current instrument software as file

You can find the current instrument software as well as detailed information on the procedure in the download area of our homepage: [www.vega.com](http://www.vega.com).

You can find information about the installation in the download file.



**Caution:**

Instruments with approvals can be bound to certain software versions. Therefore make sure that the approval is still effective after a software update is carried out.

You can find detailed information in the download area at [www.vega.com](http://www.vega.com).

## 9.6 How to proceed if a repair is necessary

The following procedure refers only to the sensor. Should a repair of the source container be necessary, you can find the respective instructions in the operating instructions manual of the source container.

You can find an instrument return form as well as detailed information about the procedure in the download area of our homepage: [www.vega.com](http://www.vega.com)

By doing this you help us carry out the repair quickly and without having to call back for needed information.

If a repair is necessary, please proceed as follows:

- Print and fill out one form per instrument
- Clean the instrument and pack it damage-proof
- Attach the completed form and, if need be, also a safety data sheet outside on the packaging
- Please contact the agency serving you to get the address for the return shipment. You can find the agency on our home page [www.vega.com](http://www.vega.com).



## 10 Dismount

### 10.1 Dismounting steps

**Warning:**

Before dismounting, be aware of dangerous process conditions such as e.g. pressure in the vessel or pipeline, high temperatures, corrosive or toxic media etc.

Take note of chapters "*Mounting*" and "*Connecting to voltage supply*" and carry out the listed steps in reverse order.

### 10.2 Disposal

The instrument consists of materials which can be recycled by specialised recycling companies. We use recyclable materials and have designed the electronics to be easily separable.

**WEEE directive**

The instrument does not fall in the scope of the EU WEEE directive. Article 2 of this Directive exempts electrical and electronic equipment from this requirement if it is part of another instrument that does not fall in the scope of the Directive. These include stationary industrial plants.

Pass the instrument directly on to a specialised recycling company and do not use the municipal collecting points.

If you have no way to dispose of the old instrument properly, please contact us concerning return and disposal.

11 Supplement

11.1 Technical data

Note for approved instruments

The technical data in the respective safety instructions which are included in delivery are valid for approved instruments (e.g. with Ex approval). These data can differ from the data listed herein, for example regarding the process conditions or the voltage supply.  
All approval documents can be downloaded from our homepage.

General data

316L corresponds to 1.4404 or 1.4435

Materials, non-wetted parts

- Scintillation material Nal (sodium iodide)
- Aluminium die-cast housing Aluminium die-casting AlSi10Mg, powder-coated (Basis: Polyester)
- Stainless steel housing 316L
- Seal between housing and housing lid NBR (stainless steel housing, investment casting), silicone (Aluminium housing)
- Inspection window in housing cover (optional) Polycarbonate or glass
- Ground terminal 316L
- Cable gland PA, stainless steel, brass
- Sealing, cable gland NBR
- Blind plug, cable gland PA, stainless steel

Process fittings

- Fastening lugs  $\varnothing$  9 mm (0.35 in), hole centre distance 119 mm (4.69 in)

Weight

- Aluminium housing, with electronics 4.1 kg (9 lbs)
- Stainless steel housing, with electronics 9.1 kg (20.1 lbs)
- Maximum total weight, incl. accessory 72 kg (158 lbs)

Max. torque, mounting screws

- Fastening lugs in the sensor housing 15 Nm (11.1 lbf ft), stainless steel A4-70

Max. torque for NPT cable glands and Conduit tubes

- Aluminium/Stainless steel housing 50 Nm (36.88 lbf ft)

Input variable

Measured variable The measured variable is the intensity of the gamma radiation of an isotope. If the radiation intensity decreases, e.g. due to increasing product density, the measured value of MINITRAC 31 changes in proportion to the density.

Analogue input

- Input type 4 ... 20 mA, passive

– Internal load	250 $\Omega$
– Input voltage	max. 6 V

## Switching input

– Type of input - Open Collector	10 mA
– Type of input - Relay contact	100 mA
– Input voltage	max. 24 V

## Output variable - Level measurement

### Output

– Signal	digital output signal, Foundation Fieldbus protocol
– Physical layer	according to IEC 61158-2

Damping (63 % of the input variable) 0 ... 999 s, adjustable

### Channel Numbers

– Channel 1	Process value (level)
– Channel 8	Electronics temperature
– Channel 9	Pulse rate

Transmission rate 31.25 Kbit/s

Current value 10 mA,  $\pm 0.5$  mA

Resolution, digital > 0.1 mm (0.004 in)

## Output variable - Density measurement

### Output

– Signal	digital output signal, Foundation Fieldbus protocol
– Physical layer	according to IEC 61158-2

Damping (63 % of the input variable) 0 ... 999 s, adjustable

### Channel Numbers

– Channel 1	Process value (density)
– Channel 3	Process temperature (with external temperature sensor)
– Channel 8	Electronics temperature
– Channel 9	Pulse rate

Transmission rate 31.25 Kbit/s

Current value 10 mA,  $\pm 0.5$  mA

Resolution, digital > 0.1 mm (0.004 in)

## Output variable - Level detection

### Output

– Signal	digital output signal, Foundation Fieldbus protocol
– Physical layer	according to IEC 61158-2

Damping (63 % of the input variable) 0 ... 999 s, adjustable

### Channel Numbers

– Channel 1	Process value (switching status)
– Channel 8	Electronics temperature

– Channel 9	Pulse rate
Transmission rate	31.25 Kbit/s
Current value	10 mA, $\pm 0.5$ mA
Resolution, digital	> 0.1 mm (0.004 in)

---

**Output variable - X-ray alarm**


---

Output	
– Signal	digital output signal, Foundation Fieldbus protocol
– Physical layer	according to IEC 61158-2
Damping (63 % of the input variable)	0 ... 999 s, adjustable
Channel Numbers	
– Channel 1	Process value
– Channel 8	Electronics temperature
– Channel 9	Pulse rate
Transmission rate	31.25 Kbit/s
Current value	10 mA, $\pm 0.5$ mA
Resolution, digital	> 0.1 mm (0.004 in)

---

**Output variable - Real value correction**


---

Output	
– Signal	digital output signal, Foundation Fieldbus protocol
– Physical layer	according to IEC 61158-2
Damping (63 % of the input variable)	0 ... 999 s, adjustable
Channel Numbers	
– Channel 1	Process value
– Channel 8	Electronics temperature
– Channel 9	Pulse rate
Transmission rate	31.25 Kbit/s
Current value	10 mA, $\pm 0.5$ mA
Resolution, digital	> 0.1 mm (0.004 in)

---

**Relay output**


---

Output	Relay output (SPDT), floating spdt
Switching voltage	max. 253 V AC/DC With circuits > 150 V AC/DC, the relay contacts must be in the same circuit.
Switching current	max. 3 A AC ( $\cos \phi > 0.9$ ), 1 A DC
Switching current	
– Standard	max. 3 A AC ( $\cos \phi > 0.9$ ), 1 A DC
– USA, Canada	max. 3 A AC ( $\cos \phi > 0.9$ )
Breaking capacity	
– Min.	50 mW

– Max.	Standard: 750 VA AC, 40 W DC (at U < 40 V DC) USA, Canada: 750 VA AC If inductive loads or stronger currents are switched through, the gold plating on the relay contact surface will be permanently damaged. The contact is then no longer suitable for switching low-level signal circuits.
Contact material (relay contacts)	AgNi or AgSnO <sub>2</sub> each with 3 µm gold plating

## Transistor output

Output	Floating transistor output, permanently shortcircuit-proof
Load current	< 400 mA
Voltage loss	< 1 V
Switching voltage	< 55 V DC
Blocking current	< 10 µA

## Measurement accuracy (according to DIN EN 60770-1)

Process reference conditions according to DIN EN 61298-1

– Temperature	+18 ... +30 °C (+64 ... +86 °F)
– Relative humidity	45 ... 75 %
– Air pressure	860 ... 1060 mbar/86 ... 106 kPa (12.5 ... 15.4 psig)
Non-repeatability	≤ 0.1 %
Deviation with bulk solids	The values depend to a great extent on the application. Binding specifications are thus not possible.
Deviation under EMC influence	≤ 1 %

## Characteristics and performance data

Step response time <sup>5)</sup>	≤ 5 s (with damping 1 s)
----------------------------------	--------------------------

## Ambient conditions

Storage and transport temperature	-40 ... +60 °C (-40 ... +140 °F)
-----------------------------------	----------------------------------

## Process conditions

For the process conditions, please also note the specifications on the type label. The lower value always applies.

Process pressure	Unpressurized
Process temperature (measured on the detector tube)	-40 ... +60 °C (-40 ... +140 °F) With temperatures of more than 60 °C we recommend the use of water cooling
Vibration resistance <sup>6)</sup>	mechanical vibrations up to 5 g in the frequency range 5 ... 200 Hz

<sup>5)</sup> Time span after a sudden measuring distance change by max. 0.5 m in liquid applications, max 2 m with bulk solids applications, until the output signal has taken for the first time 90 % of the final value (IEC 61298-2).

<sup>6)</sup> Tested according to the guidelines of German Lloyd, GL directive 2.

**Electromechanical data - version IP66/IP67**

## Options of the cable entry

- Cable entry M20 x 1.5; ½ NPT
- Cable gland M20 x 1.5; ½ NPT (cable diameter see below table)
- Blind plug M20 x 1.5; ½ NPT
- Closing cap ½ NPT

Material cable gland	Material seal insert	Cable diameter				
		4.5 ... 8.5 mm	5 ... 9 mm	6 ... 12 mm	7 ... 12 mm	10 ... 14 mm
PA	NBR	–	●	●	–	●
Brass, nickel-plated	NBR	●	●	●	–	–
Stainless steel	NBR	–	●	●	–	●

Flammability class - Supply lines at least VW-1

## Wire cross-section (spring-loaded terminals)

- Massive wire, stranded wire 0.2 ... 2.5 mm<sup>2</sup> (AWG 24 ... 14)
- Stranded wire with end sleeve 0.2 ... 1.5 mm<sup>2</sup> (AWG 24 ... 16)

**Integrated clock**

Date format	Day.Month.Year
Time format	12 h/24 h
Time zone, factory setting	CET
Max. rate deviation	10.5 min/year

**Additional output parameter - Electronics temperature**

## Output of the temperature values

– Analogue	Via the current output
– Digital	Via the digital output signal (depending on the electronics version)
Range	-40 ... +50 °C (-40 ... +122 °F)
Resolution	< 0.1 K
Accuracy	±5 K

**Voltage supply**

## Operating voltage

- Sensor power supply 24 ... 65 V DC (-15 ... +10 %) or 24 ... 230 V AC (-15 ... +10 %), 50/60 Hz
- FF bus 9 ... 32 V DC

**Electrical protective measures**

Application area	Outdoor areas
Altitude above sea level	2000 m (6561 ft)

Protection class	I
Pollution degree	4 <sup>7)</sup>
Relative humidity	max. 100 %
Protection, depending on housing version	IP66/IP67 (NEMA Type 4X) <sup>8)</sup>
Overvoltage category	III <sup>9)</sup>

## 11.2 Device communication Foundation Fieldbus

In the following, the necessary device-specific details are shown. You can find further information of Foundation Fieldbus on [www.fieldbus.com](http://www.fieldbus.com).

### Overview

The following table gives you an overview of the instrument versions and the corresponding device descriptions, the electrical characteristics of the bus system as well as the applied function blocks.

Revisions Data	DD-Revision	Rev_02
	CFF-File	020101.cff
	Device Revision	0201.ffo 0201.sym
	Cff-Revision	xx xx 01
	Device software revision	> 1.7.0
	ITK (Interoperability Test Kit) Number	6.0.1
Electrical Characteristics	Physical Layer Type	Low-power signaling, bus-powered, FISCO I.S.
	Input Impedance	> 3000 Ohms between 7.8 KHz - 39 KHz
	Unbalanced Capacitance	< 250 pF to ground from either input terminal
	Output Amplitude	0.8 V P-P
	Electrical Connection	4 Wire
	Polarity Insensitive	Yes
	Max. Current Load	10 mA
	Device minimum operating voltage	9 V
Transmitter Function Blocks	Resource Block (RB)	1
	Transducer Block (TB)	1
	Standard Block (AI)	3
	Execution Time	30 ms

<sup>7)</sup> Micro-environment in housing: pollution degree 2

<sup>8)</sup> A suitable cable is required for maintaining the protection rating.

<sup>9)</sup> Alternative: Overvoltage category II with operating height up to 5000 m

Diagnostics	Standard	Yes
	Advanced	Yes
	Performance	No
	Function Blocks Instantiable	No
General Information	LAS (Link Active Scheduler)	No
	Primary Capable	No
	Number of VCRs (Virtual Communication Relationships)	24

## Parameter list

The following table gives you an overview of the parameters used.

FF descriptor	Rel. Index	Description	Unit
PRIMARY_VALUE	13	PRIMARY_VALUE (Linearized value). This is the process value after min/max adjustment and Linearization with the status of the transducer block. The unit is defined in "PRIMARY_VALUE_UNIT"	FF_PRIMARY_VALUE_UNIT
FF_PRIMARY_VALUE_UNIT	14	Selected unit code for "PRIMARY_VALUE"	-
FF_VAPOR_DENSITY	15	Density with Temperature correction	FF_VAPOR_DENSITY_UNIT
FF_VAPOR_DENSITY_UNIT	16	Selected unit code for "FF_VAPOR_DENSITY"	-
FF_PROCESS_TEMPERATURE	17	Process temperature	FF_PROCESS_TEMPERATURE_UNIT
FF_PROCESS_TEMPERATURE_UNIT	18	Selected unit code for "FF_PROCESS_TEMPERATURE"	-
FF_DENSITY	19	Density	FF_DENSITY_UNIT
FF_DENSITY_UNIT	20	Selected unit code for "FF_DENSITY"	-
FF_VOLUMETRIC_FLOW	21	Volumetric flow	FF_VOLUMETRIC_FLOW_UNIT
FF_VOLUMETRIC_FLOW_UNIT	22	Selected unit code for "FF_VOLUMETRIC_FLOW"	-
FF_WEIGHT	23	Weight on belt	FF_WEIGHT_UNIT
FF_WEIGHT_UNIT	24	Selected unit code for "FF_WEIGHT"	-
FF_BELT_SPEED	25	Belt speed	FF_BELT_SPEED_UNIT
FF_BELT_SPEED_UNIT	26	Selected unit code for "FF_BELT_SPEED"	-
FF_ELECTRONIC_TEMPERATURE	27	Electronics temperature	FF_ELECTRONIC_TEMPERATURE_UNIT
FF_ELECTRONIC_TEMPERATURE_UNIT	28	Selected unit code for "FF_ELECTRONIC_TEMPERATURE"	-



FF descriptor	Rel. Index	Description	Unit
FF_COUNT_RATE	29	Count rate	FF_COUNT_RATE_UNIT
FF_COUNT_RATE_UNIT	30	Selected unit code for "FF_COUNT_RATE"	-
DEVICE_TAG	31	Tagname	-
DEVICE_NAME	32	Device type	-
DEVICE_STATE	33	Error code	-
PEAK_MEAS_VAL_MIN	34	Pulse rate (min.)	-
PEAK_MEAS_VAL_MAX	35	Pulse rate (max.)	-
PEAK_TEMP_VAL_MIN	36	Electronics temperature (min.)	-
PEAK_TEMP_VAL_MAX	37	Electronics temperature (max.)	-
APPLICATION_TYPE_SEL	38	Selected application	-
TEMP_COMP_UNIT	39	Selected unit code for process temperature	-
DELTA_I	40	Calculated percent delta I	-
GAUGE_TEMPERATURE	41	Electronics temperature	-
DECAY_COMPENSATION_FACTOR	42	Factor for the decay compensation	-
PMT_VOLTAGE_CALIBRATION	43	Photomultiplier voltage on delivery	-
CORRELATION_COEFF	44	Correlation coefficient for linearizer table	-
ERROR_TEXT	45	Error text	-
PMT_VOLTAGE_ACTUAL	46	Current photomultiplier voltage	-
STANDARDIZATION_FACTOR	47	Factor for the real value correction	-
SERIALNUMBER	48	Serial number	-
NAMUR_STATE	49	NAMUR state	-
NULL_COUNT_RATE	50	Zero count rate	-
COUNT_RATE_PMT	51	Pulse rate photomultiplier (raw values)	-
ADJ_DENSITY_ABS_COEFF	52	Process absorption coefficient	-
DEV_SW_VER_ASCII	53	Software version	-
POINT_LEVEL_ADJUST_MODE	54	Point level adjustment mode	-
RELAY_VALUE_SEL	55	Relay basic value	-
DIGITAL_IN	56	Frequency of digital input	-
DIGITAL_IN_BOOL	57	State of digital input	-

FF descriptor	Rel. Index	Description	Unit
ANALOG_IN	58	Current on analog input	-
FF_CHANNEL_AVAILABLE	59	Available channels	-
FF_CHANNEL_USED	60	Used channels	-

### Mapping of Process Value Status

Hex	Quality	Sub-Status	Condition
0x00	Bad	Non-specific	Unexpected error
0x01	Bad	Configuration Error	It was tried to set a wrong unit with FF interface On user error codes: 16, 17, 25, 52, 57, 66, 72, 117, 120
0x0C	Bad	Device Failure	Five or more internal communications have failed while "Process Data Update". Last usable value is displayed On user error codes: 8, 34, 35, 36, 37, 38, 73, 80, 86, 121, 122, 141
0x10	Bad	Sensor Failure	On user error codes: 40, 41, 53, 68, 123, 124, 125
0x1C	Bad	Out of Service	Transducer block is in mode "Out of Service" Channel is not assigned to an AIFB Channel is not available in running application
0x20	Bad	Transducer in MAN	Transducer block is in mode "Manual"
0x44	Uncertain	Last Usable Value	Three or more internal communications have failed while "Process Data Update". Last usable value is displayed
0x48	Uncertain	Substitute	On user error codes: 29
0x4C	Uncertain	Initial Value	After startup of device or channel assignment in AIFB was changed. The channel unit may be unknown until next "Process Data Update" On user error codes: 13
0x80	Good (NC)	Non-specific	No errors concerning to channel handling On user error codes: 0, 33, 45, 71, 126, 127

### Mapping of User Error Codes to FF Field Diagnostics

Priority	Description	User Error Codes	NE-107 Status
31	Hardware failure	40, 41	FAILURE
30	Memory failure	34, 35, 36, 37	FAILURE
29	Software failure	80	FAILURE
28	Parameterization corrupt	72	FAILURE
27	Undefined 27	-	-
26	Undefined 26	-	-

Priority	Description	User Error Codes	NE-107 Status
25	Paramerization error	16, 17, 25, 52, 53, 57, 66, 117, 120	FAILURE
24	Conflict in MGC	121, 122, 141	FAILURE
23	Communication error in MGC	8	FAILURE
22	MGC secondary reports error	38	FAILURE
21	Undefined 21	-	-
20	Undefined 20	-	-
19	Undefined 19	-	-
18	Detector temperature critical	125	OUT_OF_SPEC
17	Error while auto-standardization	73	FAILURE
16	Excessive radiation	123, 124	FAILURE
15	Input out of bounds	13	OUT_OF_SPEC
14	Error while signal processing	68	FAILURE
13	Undefined 13	-	-
12	Undefined 12	-	-
11	Undefined 11	-	-
10	Undefined 10	-	-
9	Undefined 9	-	-
8	Undefined 8	-	-
7	AITB simulated	29	FUNCTION_CHECK
6	Undefined 6	-	-
5	Undefined 5	-	-
4	Undefined 4	-	-
3	Undefined 3	-	-
2	Undefined 2	-	-
1	Error while trend recording	126, 127	GOOD
0	Reserved	-	Reserved
Not displayed		33, 45, 71, 86	-

## 11.3 Dimensions

The following dimensional drawings represent only an extract of all possible versions. Detailed dimensional drawings can be downloaded at [www.vega.com/downloads](http://www.vega.com/downloads) under " *Drawings*".

Aluminium and stainless steel housing

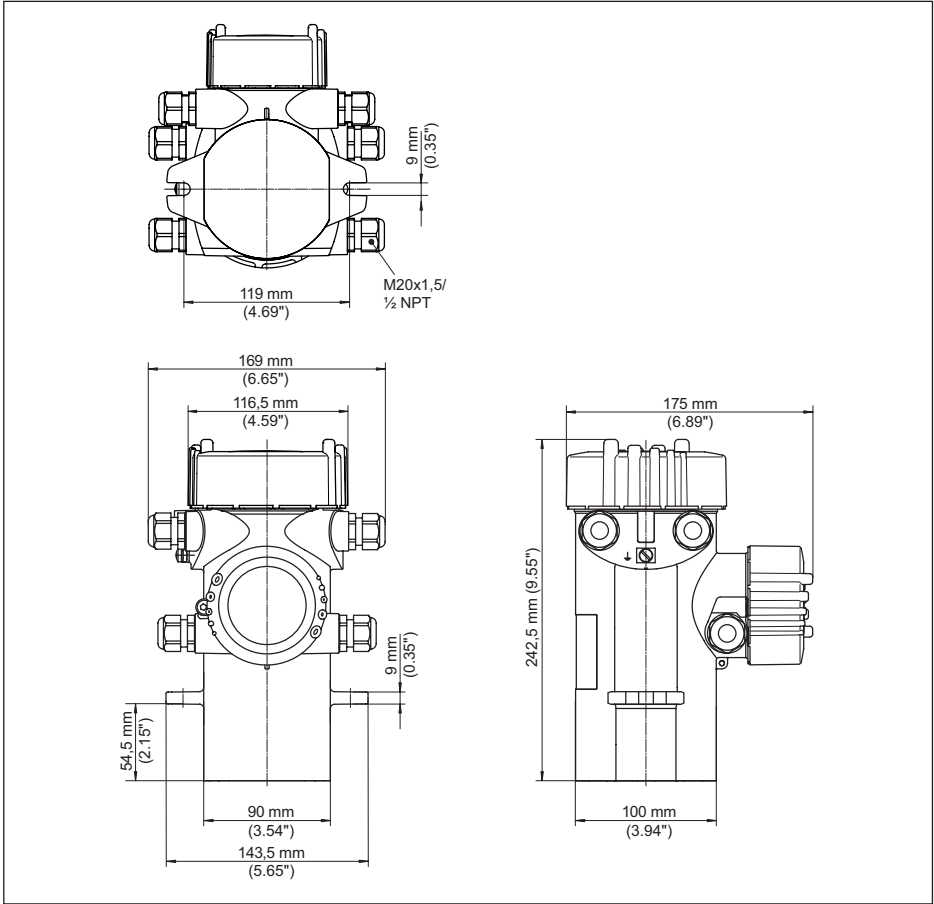


Fig. 25: Aluminium housing or stainless steel housing (precision casting)

# MINITRAC 31

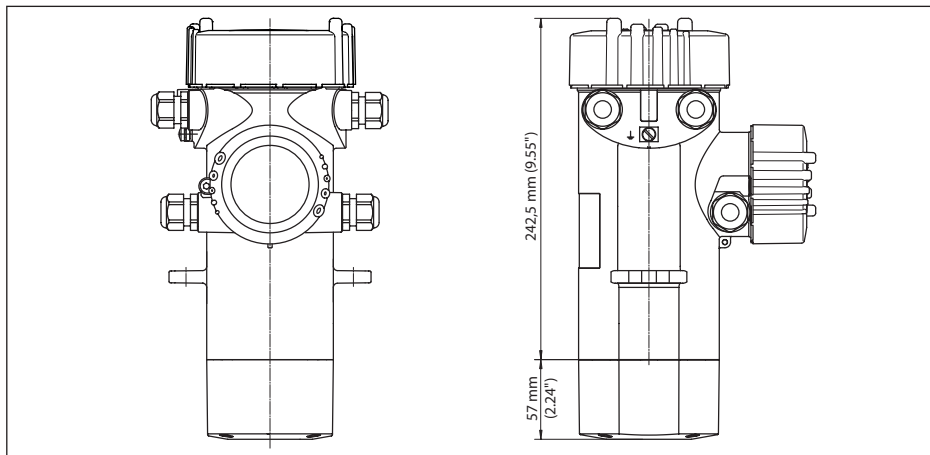


Fig. 26: MINITRAC 31

L Measuring range

## 11.4 Industrial property rights

VEGA product lines are global protected by industrial property rights. Further information see [www.vega.com](http://www.vega.com).

VEGA Produktfamilien sind weltweit geschützt durch gewerbliche Schutzrechte.

Nähere Informationen unter [www.vega.com](http://www.vega.com).

Les lignes de produits VEGA sont globalement protégées par des droits de propriété intellectuelle. Pour plus d'informations, on pourra se référer au site [www.vega.com](http://www.vega.com).

VEGA lineas de productos están protegidas por los derechos en el campo de la propiedad industrial. Para mayor información revise la pagina web [www.vega.com](http://www.vega.com).

Линии продукции фирмы ВЕГА защищаются по всему миру правами на интеллектуальную собственность. Дальнейшую информацию смотрите на сайте [www.vega.com](http://www.vega.com).

VEGA系列产品在全球享有知识产权保护。

进一步信息请参见网站< [www.vega.com](http://www.vega.com)。

## 11.5 Trademark

All the brands as well as trade and company names used are property of their lawful proprietor/originator.

# INDEX

## A

- Accessories 11
  - Display and adjustment module 10
  - External display and adjustment unit 10
  - Gamma modulator 11
- Adjustment 33, 39
  - System 31
- Adjustment data 45, 54
- Adjustment mode 50
- Adjustment point 51
- Application 33, 38, 50, 59, 62

## B

- Background radiation 33, 38, 50

## C

- Cable entry 15, 21
- Cable gland 15, 21
- Check signal 69, 70
- Connection cable 21
- Connection procedure 22
- Connection technology 22
- Control areas 13
- Cooling 11

## D

- Damping 34, 43, 55
- Date 46, 56
- Date of manufacture 48, 57
- Default values 35, 47, 56
- Delta I 51
- Device DTM 63
- Device name 48, 57
- Device settings Copy 48, 57
- Device status 45, 54
- Displayed value 45, 54

## E

- EDD (Enhanced Device Description) 65

## F

- Fault rectification 69
- FF parameter 80
- Functional principle 9

## G

- Gamma modulator 11

## H

- Handling permit 12

Heat 20

## I

- Inner diameter 39
- Installation position 15
- Instrument features 48, 57
- Instrument return form 71
- Isotope 32
  - Co-60 32, 37, 49, 59, 61
  - Cs-137 32, 37, 49, 59, 61

## L

- Language 45, 54
- Linearisation 33, 40
- Lock adjustment 44, 53, 60, 62

## M

- Main menu 32, 37, 49, 58, 61
- Mounting accessories 11
- Mounting bracket 11

## N

- NAMUR NE 107 66
  - Failure 67
  - Function check 69
  - Maintenance 69
  - Out of specification 69

## P

- PACTware 63
- Peak value indicator 45, 54
- Protection class 21

## R

- Radiation protection 13
- Radiation safety officer 13
- Real value correction 43, 60
- Relay 34, 43, 53
- Repair 71
- Replacement parts
  - Electronics module 10
- Reset 35, 47, 56

## S

- Service hotline 70
- Simulation 46, 55
- Source 32, 37, 49, 59, 61
- Source holder 12

## T

- Time 46, 56

Type label 7

## U

Unit 50

Units 33, 38

## V

Voltage supply 21, 78

## W

Water cooling 20

## X

X-ray alarm 34, 58









Printing date:

# VEGA

All statements concerning scope of delivery, application, practical use and operating conditions of the sensors and processing systems correspond to the information available at the time of printing.

Subject to change without prior notice

© VEGA Grieshaber KG, Schiltach/Germany 2021



41782-EN-211203

VEGA Grieshaber KG  
Am Hohenstein 113  
77761 Schiltach  
Germany

Phone +49 7836 50-0  
E-mail: [info.de@vega.com](mailto:info.de@vega.com)  
[www.vega.com](http://www.vega.com)