

# Operating Instructions

Pressure transmitter with metallic  
measuring cell

## VEGABAR 83

4 ... 20 mA/HART

With SIL qualification



Document ID: 45036



# VEGA

## Contents

|          |  |           |
|----------|--|-----------|
| <b>1</b> | <b>About this document .....</b>                           | <b>4</b>  |
| 1.1      | Function .....   | 4         |
| 1.2      | Target group .....   | 4         |
| 1.3      | Symbols used.....  | 4         |
| <b>2</b> | <b>For your safety .....</b>                               | <b>5</b>  |
| 2.1      | Authorised personnel .....                                 | 5         |
| 2.2      | Appropriate use.....                                       | 5         |
| 2.3      | Warning about incorrect use.....                           | 5         |
| 2.4      | General safety instructions .....                          | 5         |
| 2.5      | EU conformity.....   | 5         |
| 2.6      | SIL qualification according to IEC 61508.....              | 6         |
| 2.7      | NAMUR recommendations .....                                | 6         |
| 2.8      | Installation and operation in the USA and Canada .....     | 6         |
| 2.9      | Environmental instructions .....                           | 7         |
| <b>3</b> | <b>Product description .....</b>                           | <b>8</b>  |
| 3.1      | Configuration.....   | 8         |
| 3.2      | Principle of operation.....                                | 9         |
| 3.3      | Supplementary cleaning procedures.....                     | 12        |
| 3.4      | SIL features .....   | 13        |
| 3.5      | Packaging, transport and storage.....                      | 13        |
| 3.6      | Accessories.....   | 14        |
| <b>4</b> | <b>Mounting.....</b>                                       | <b>16</b> |
| 4.1      | General instructions .....                                 | 16        |
| 4.2      | Instructions for oxygen applications .....                 | 17        |
| 4.3      | Ventilation and pressure compensation.....                 | 18        |
| 4.4      | Process pressure measurement.....                          | 20        |
| 4.5      | Level measurement.....                                     | 22        |
| 4.6      | External housing .....                                     | 23        |
| <b>5</b> | <b>Connecting to power supply.....</b>                     | <b>24</b> |
| 5.1      | Preparing the connection .....                             | 24        |
| 5.2      | Connecting.....  | 25        |
| 5.3      | Single chamber housing.....                                | 26        |
| 5.4      | Double chamber housing .....                               | 27        |
| 5.5      | Ex-d-ia double chamber housing.....                        | 29        |
| 5.6      | Double chamber housing with VEGADIS-Adapter .....          | 30        |
| 5.7      | Housing IP66/IP68 (1 bar) .....                            | 31        |
| 5.8      | External housing with version IP68 (25 bar) .....          | 31        |
| 5.9      | Connection example .....                                   | 33        |
| 5.10     | Switch-on phase.....                                       | 34        |
| <b>6</b> | <b>Functional safety (SIL) .....</b>                       | <b>35</b> |
| 6.1      | Objective .....  | 35        |
| 6.2      | SIL qualification.....                                     | 35        |
| 6.3      | Application area .....                                     | 35        |
| 6.4      | Safety concept of the parameterization .....               | 36        |
| <b>7</b> | <b>Set up with the display and adjustment module .....</b> | <b>38</b> |
| 7.1      | Insert display and adjustment module .....                 | 38        |

|           |   |           |
|-----------|---|-----------|
| 7.2       | Adjustment system .....                                     | 39        |
| 7.3       | Measured value indication.....                              | 40        |
| 7.4       | Parameter adjustment .....                                  | 41        |
| 7.5       | Menu overview .....   | 54        |
| 7.6       | Save parameter adjustment data.....                         | 56        |
| <b>8</b>  | <b>Setup with PACTware .....</b>                            | <b>57</b> |
| 8.1       | Connect the PC.....   | 57        |
| 8.2       | Parameterization .....                                      | 57        |
| 8.3       | Save parameter adjustment data.....                         | 59        |
| <b>9</b>  | <b>Set up with other systems .....</b>                      | <b>60</b> |
| 9.1       | DD adjustment programs .....                                | 60        |
| 9.2       | Field Communicator 375, 475 .....                           | 60        |
| <b>10</b> | <b>Diagnosis, asset management and service .....</b>        | <b>61</b> |
| 10.1      | Maintenance .....   | 61        |
| 10.2      | Diagnosis memory .....                                      | 61        |
| 10.3      | Asset Management function.....                              | 62        |
| 10.4      | Rectify faults.....   | 65        |
| 10.5      | Exchange process module on version IP68 (25 bar) .....      | 66        |
| 10.6      | Exchanging the electronics module.....                      | 67        |
| 10.7      | Software update .....                                       | 67        |
| 10.8      | How to proceed if a repair is necessary.....                | 68        |
| <b>11</b> | <b>Dismount.....</b>  | <b>69</b> |
| 11.1      | Dismounting steps.....                                      | 69        |
| 11.2      | Disposal .....  | 69        |
| <b>12</b> | <b>Supplement .....</b>                                     | <b>70</b> |
| 12.1      | Technical data .....  | 70        |
| 12.2      | Calculation of the total deviation.....                     | 86        |
| 12.3      | Calculation of the total deviation - Practical example..... | 87        |
| 12.4      | Dimensions .....  | 89        |
| 12.5      | Industrial property rights.....                             | 100       |
| 12.6      | Trademark.....  | 100       |

### Safety instructions for Ex areas:



Take note of the Ex specific safety instructions for Ex applications. These instructions are attached as documents to each instrument with Ex approval and are part of the operating instructions.

Editing status: 2022-04-20

# 1 About this document

## 1.1 Function

This instruction provides all the information you need for mounting, connection and setup as well as important instructions for maintenance, fault rectification, the exchange of parts and the safety of the user. Please read this information before putting the instrument into operation and keep this manual accessible in the immediate vicinity of the device.

## 1.2 Target group

This operating instructions manual is directed to trained personnel. The contents of this manual must be made available to the qualified personnel and implemented.

## 1.3 Symbols used



### Document ID

This symbol on the front page of this instruction refers to the Document ID. By entering the Document ID on [www.vega.com](http://www.vega.com) you will reach the document download.



**Information, note, tip:** This symbol indicates helpful additional information and tips for successful work.



**Note:** This symbol indicates notes to prevent failures, malfunctions, damage to devices or plants.



**Caution:** Non-observance of the information marked with this symbol may result in personal injury.



**Warning:** Non-observance of the information marked with this symbol may result in serious or fatal personal injury.



**Danger:** Non-observance of the information marked with this symbol results in serious or fatal personal injury.



### Ex applications

This symbol indicates special instructions for Ex applications.



### List

The dot set in front indicates a list with no implied sequence.



### Sequence of actions

Numbers set in front indicate successive steps in a procedure.



### Disposal

This symbol indicates special instructions for disposal.

## 2 For your safety

### 2.1 Authorised personnel

All operations described in this documentation must be carried out only by trained, qualified personnel authorised by the plant operator.

During work on and with the device, the required personal protective equipment must always be worn.

### 2.2 Appropriate use

The VEGABAR 83 is a pressure transmitter for process pressure and hydrostatic level measurement.

You can find detailed information about the area of application in chapter " *Product description*".

Operational reliability is ensured only if the instrument is properly used according to the specifications in the operating instructions manual as well as possible supplementary instructions.

### 2.3 Warning about incorrect use

Inappropriate or incorrect use of this product can give rise to application-specific hazards, e.g. vessel overfill through incorrect mounting or adjustment. Damage to property and persons or environmental contamination can result. Also, the protective characteristics of the instrument can be impaired.

### 2.4 General safety instructions

This is a state-of-the-art instrument complying with all prevailing regulations and directives. The instrument must only be operated in a technically flawless and reliable condition. The operator is responsible for the trouble-free operation of the instrument. When measuring aggressive or corrosive media that can cause a dangerous situation if the instrument malfunctions, the operator has to implement suitable measures to make sure the instrument is functioning properly.

The safety instructions in this operating instructions manual, the national installation standards as well as the valid safety regulations and accident prevention rules must be observed by the user.

For safety and warranty reasons, any invasive work on the device beyond that described in the operating instructions manual may be carried out only by personnel authorised by the manufacturer. Arbitrary conversions or modifications are explicitly forbidden. For safety reasons, only the accessory specified by the manufacturer must be used.

To avoid any danger, the safety approval markings and safety tips on the device must also be observed.

### 2.5 EU conformity

The device fulfils the legal requirements of the applicable EU directives. By affixing the CE marking, we confirm the conformity of the instrument with these directives.

The EU conformity declaration can be found on our homepage.

Due to the design of its process fittings, the device does not subject of EU pressure device directive if it is operated at process pressures  $\leq 200$  bar.<sup>1)</sup>

## 2.6 SIL qualification according to IEC 61508

The Safety Integrity Level (SIL) of an electronic system is used to assess the reliability of integrated safety functions.

For detailed specification of the safety requirements, multiple SIL levels are specified according to safety standard IEC 61508. You can find detailed information in chapter "Functional safety (SIL)" of the operating instructions.

The instrument meets the specifications of IEC 61508: 2010 (Edition 2). It is qualified for single-channel operation up to SIL2. The instrument can be used homogeneously redundant up to SIL3 in multi-channel architecture with HFT 1.

## 2.7 NAMUR recommendations

NAMUR is the automation technology user association in the process industry in Germany. The published NAMUR recommendations are accepted as the standard in field instrumentation.

The device fulfils the requirements of the following NAMUR recommendations:

- NE 21 – Electromagnetic compatibility of equipment<sup>2)</sup>
- NE 43 – Signal level for fault information from measuring transducers
- NE 53 – Compatibility of field devices and display/adjustment components
- NE 107 – Self-monitoring and diagnosis of field devices

For further information see [www.namur.de](http://www.namur.de).

## 2.8 Installation and operation in the USA and Canada

This information is only valid for USA and Canada. Hence the following text is only available in the English language.

Installations in the US shall comply with the relevant requirements of the National Electrical Code (ANSI/NFPA 70).

Installations in Canada shall comply with the relevant requirements of the Canadian Electrical Code

A Class 2 power supply unit has to be used for the installation in the USA and Canada.

<sup>1)</sup> Exception: Versions with measuring ranges from 250 bar. These are subject of the EU Pressure Device Directive.

<sup>2)</sup> Not fulfilled when connecting to an external display and adjustment unit.

## 2.9 Environmental instructions

Protection of the environment is one of our most important duties. That is why we have introduced an environment management system with the goal of continuously improving company environmental protection. The environment management system is certified according to DIN EN ISO 14001.

Please help us fulfil this obligation by observing the environmental instructions in this manual:

- Chapter " *Packaging, transport and storage* "
- Chapter " *Disposal* "

## 3 Product description

### 3.1 Configuration

#### Scope of delivery

The scope of delivery encompasses:

- VEGABAR 83 pressure transmitter

The further scope of delivery encompasses:

- Documentation
  - Quick setup guide VEGABAR 83
  - Safety Manual (SIL)
  - Documentation instrument parameters (default values)
  - Documentation order-relating instrument parameters (deviation from default values)
  - Test certificate for pressure transmitters
  - Instructions for optional instrument features
  - Ex-specific "*Safety instructions*" (with Ex versions)
  - If necessary, further certificates



#### Information:

Optional instrument features are also described in this operating instructions manual. The respective scope of delivery results from the order specification.

#### Scope of this operating instructions

This operating instructions manual applies to the following instrument versions:

- Hardware from 1.0.0
- Software version from 1.2.6



#### Note:

You can find the hardware and software version of the instrument as follows:

- On the type plate of the electronics module
- In the adjustment menu under "*Info*"

#### Type label

The type label contains the most important data for identification and use of the instrument:





Fig. 1: Layout of the type label (example)

- 1 Product code
- 2 Field for approvals
- 3 Technical data
- 4 Serial number of the instrument
- 5 QR code
- 6 Symbol of the device protection class
- 7 ID numbers, instrument documentation
- 8 SIL identification

### Serial number - Instrument search

The type label contains the serial number of the instrument. With it you can find the following instrument data on our homepage:

- Product code (HTML)
- Delivery date (HTML)
- Order-specific instrument features (HTML)
- Operating instructions, quick setup guide and Safety Manual at the time of shipment (PDF)
- Test certificate (PDF) - optional

Move to "[www.vega.com](http://www.vega.com)" and enter in the search field the serial number of your instrument.

Alternatively, you can access the data via your smartphone:

- Download the VEGA Tools app from the "Apple App Store" or the "Google Play Store"
- Scan the DataMatrix code on the type label of the instrument or
- Enter the serial number manually in the app

## 3.2 Principle of operation

### Application area

VEGABAR 83 is suitable for applications in virtually all industries. It is used for the measurement of the following pressure types.

- Gauge pressure
- Absolute pressure
- Vacuum

### Measured products

Measured products are gases, vapours and liquids.

The device is especially suitable for applications with higher temperatures and high pressures.

### Measured variables

The VEGABAR 83 is suitable for the measurement of the following process variables:

- Process pressure

- Level

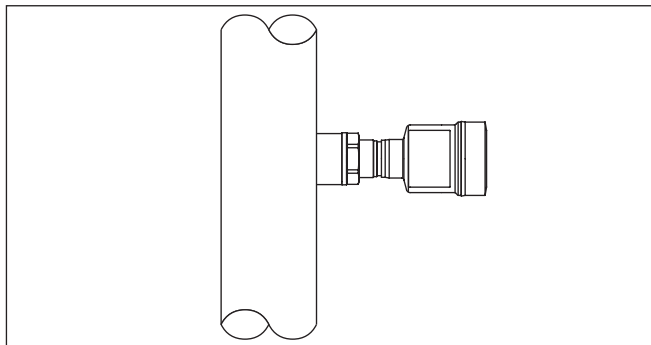


Fig. 2: Process pressure measurement VEGABAR 83

### Electronic differential pressure

Depending on the version, the VEGABAR 83 is also suitable for electronic differential pressure measurement. For this, the instrument is combined with a Secondary sensor.

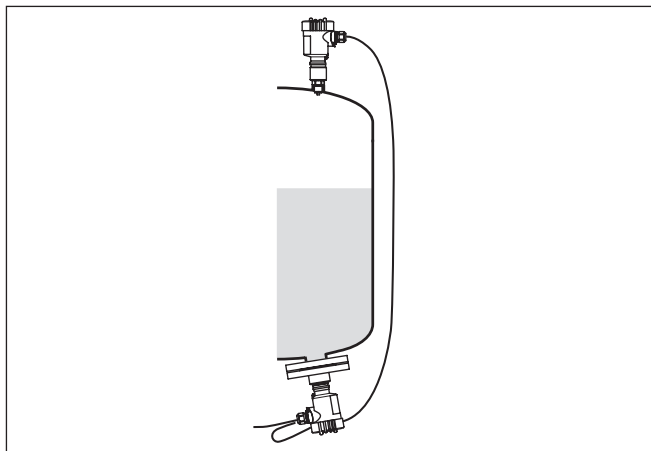


Fig. 3: Electronic differential pressure measurement via a Primary/Secondary sensor combination

You can find detailed information in the operating instructions of the respective Secondary sensor.



To reach the Safety Integrity Level (SIL) for the electronic differential pressure, both instruments must be SIL-qualified.

### Measuring system pressure

The process pressure acts on the sensor element via the process diaphragm. The process pressure causes a resistance change which is converted into a corresponding output signal and output as measured value.

### Piezoresistive sensor element

Measuring ranges up to 40 bar: piezoresistive sensor element with internal isolating liquid is used.

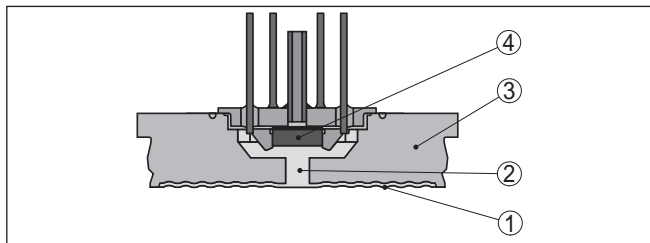


Fig. 4: Configuration of the measuring system with piezoresistive sensor element

- 1 Diaphragm
- 2 Isolating liquid
- 3 Base element
- 4 Sensor element

### Strain gauge (DMS) sensor element

For measuring ranges above 100 bar, a strain gauge (DMS) sensor element (dry system) is used.

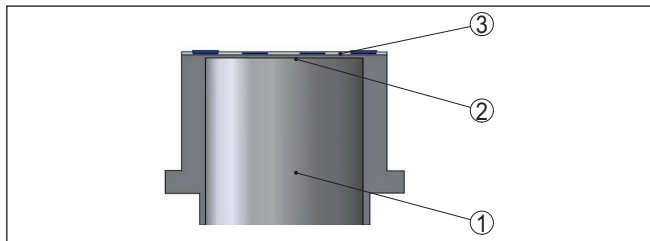


Fig. 5: Configuration of the measuring system with strain gauge (DMS) sensor element

- 1 Pressure cylinder
- 2 Process diaphragm
- 3 Sensor element

### Measuring system temperature

A temperature sensor on the respective sensor element for pressure records the current process temperature. The temperature value is output via:

- The display and adjustment module
- The current output or the additional current output
- The digital signal output

### Ceramic/metallic measuring cell

With small measuring ranges or higher temperatures, the ceramic/metallic METEC® measuring cell is the measuring unit. It consists of the ceramic-capacitive CERTEC® measuring cell and a special, temperature-compensated chemical seal system.

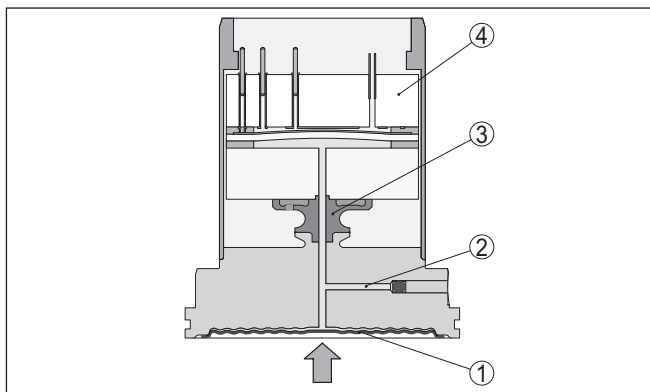


Fig. 6: Configuration of the METEC® measuring cell

- 1 Process diaphragm
- 2 Isolating liquid
- 3 FeNi adapter
- 4 CERTEC® measuring cell

#### Measuring system temperature

Temperature sensors in the ceramic diaphragm and the ceramic base of the CERTEC® measuring cell detect the actual process temperature. The temperature value is output via:

- The display and adjustment module
- The current output or the additional current output
- The digital signal output

#### Pressure types

The measuring cell design depends on the selected pressure type.

**Relative pressure:** the measuring cell is open to the atmosphere. The ambient pressure is detected in the measuring cell and compensated. It thus has no influence on the measured value.

**Absolute pressure:** the measuring cell contains vacuum and is encapsulated. The ambient pressure is not compensated and does hence influence the measured value.

#### Seal concept

The measuring system is completely welded and thus sealed against the process.

The process fitting is sealed against the process by a suitable seal. It must be provided by the customer, depending on the process fitting also included in the scope of delivery, see chapter "Technical data", "Materials and weights".

### 3.3 Supplementary cleaning procedures

The VEGABAR 83 is also available in the version "Oil, grease and silicone-free". These instruments have passed through a special cleaning procedure to remove oil, grease and paint-wetting impairment substances (PWIS).

The cleaning is carried out on all wetted parts as well as on surfaces accessible from outside. To keep the purity level, the instruments are immediately packed in plastic foil after the cleaning process. The purity level remains as long as the instrument is kept in the closed original packaging.



**Caution:**

The VEGABAR 83 in this version may not be used in oxygen applications. For this purpose, instruments are available in the special version "Oil, grease and silicone-free for oxygen applications".

### 3.4 SIL features



The VEGABAR 83 4 ... 20 mA/HART with SIL qualification differs from the standard instrument in the following points:

- Type label: with SIL logo
- Scope of delivery: with Safety Manual and documentation of the device parameters
- Parameter adjustment: Device status "Function Check" is output during the parameter adjustment, the safety function is deactivated
- Measured value output: "Failure" is output when the measured value < -20% or > +120% of the nominal measuring range
- Adjustment menu, "Current output": Failure mode 20.5 mA not selectable
- Adjustment menu, "HART mode": Selection "Analogue current output" is unmodifiably preset
- Electronics temperature: in case of temperature values outside the permitted range, "Failure" is output
- Some diaphragm coatings not permissible



**Information:**

The measures that must be implemented to use the instrument in safety-instrumented systems are described in the "Safety Manual". The SIL function can be deactivated neither by the user nor by service personnel.

### 3.5 Packaging, transport and storage

#### Packaging

Your instrument was protected by packaging during transport. Its capacity to handle normal loads during transport is assured by a test based on ISO 4180.

The packaging consists of environment-friendly, recyclable cardboard. For special versions, PE foam or PE foil is also used. Dispose of the packaging material via specialised recycling companies.

#### Transport

Transport must be carried out in due consideration of the notes on the transport packaging. Nonobservance of these instructions can cause damage to the device.

|  |   |
|--|---|
| <b>Transport inspection</b>  | The delivery must be checked for completeness and possible transit damage immediately at receipt. Ascertained transit damage or concealed defects must be appropriately dealt with.   |
| <b>Storage</b>   | <p>Up to the time of installation, the packages must be left closed and stored according to the orientation and storage markings on the outside.</p> <p>Unless otherwise indicated, the packages must be stored only under the following conditions:</p> <ul style="list-style-type: none"> <li>● Not in the open</li> <li>● Dry and dust free</li> <li>● Not exposed to corrosive media</li> <li>● Protected against solar radiation</li> <li>● Avoiding mechanical shock and vibration</li> </ul> |
| <b>Storage and transport temperature</b>   | <ul style="list-style-type: none"> <li>● Storage and transport temperature see chapter " <i>Supplement - Technical data - Ambient conditions</i>"</li> <li>● Relative moisture 20 ... 85 %</li> </ul>   |
| <b>Lifting and carrying</b>  | With instrument weights of more than 18 kg (39.68 lbs) suitable and approved equipment must be used for lifting and carrying.   |
| <h3>3.6 Accessories</h3> <p>The instructions for the listed accessories can be found in the download area on our homepage.</p> |   |
| <b>Display and adjustment module</b>   | <p>The display and adjustment module is used for measured value indication, adjustment and diagnosis.</p> <p>The integrated Bluetooth module (optional) enables wireless adjustment via standard adjustment devices.</p>  |
| <b>VEGACONNECT</b>   | The interface adapter VEGACONNECT enables the connection of communication-capable instruments to the USB interface of a PC.   |
| <b>Secondary sensors</b>   | Secondary sensors of VEGABAR series 80 enable in conjunction with VEGABAR 83 an electronic differential pressure measurement.   |
| <b>VEGADIS 81</b>  | The VEGADIS 81 is an external display and adjustment unit for VEGA plics® sensors.  |
| <b>VEGADIS adapter</b>   | The VEGADIS adapter is an accessory part for sensors with double chamber housings. It enables the connection of VEGADIS 81 to the sensor housing via an M12 x 1 plug.   |
| <b>VEGADIS 82</b>  | VEGADIS 82 is suitable for measured value indication and adjustment of sensors with HART protocol. It is looped into the 4 ... 20 mA/HART signal cable.   |
| <b>Overvoltage protection</b>  | The overvoltage arrester B81-35 is used instead of the terminals in the single or double chamber housing.   |

|   |   |
|---|---|
| <b>Protective cover</b>                             | The protective cover protects the sensor housing against soiling and intense heat from solar radiation.   |
| <b>Flanges</b>                                      | Screwed flanges are available in different versions according to the following standards: DIN 2501, EN 1092-1, BS 10, ASME B 16.5, JIS B 2210-1984, GOST 12821-80.  |
| <b>Welded socket, threaded and hygienic adapter</b> | Welded sockets are used to connect the devices to the process.<br>Threaded and hygienic adapters enable simple adaptation of devices with standard threaded fittings to process-side hygiene connections. |

## 4 Mounting

### 4.1 General instructions

#### Process conditions



##### Note:

For safety reasons, the instrument must only be operated within the permissible process conditions. You can find detailed information on the process conditions in chapter " *Technical data* " of the operating instructions or on the type label.

Hence make sure before mounting that all parts of the instrument exposed to the process are suitable for the existing process conditions.

These are mainly:

- Active measuring component
- Process fitting
- Process seal

Process conditions in particular are:

- Process pressure
- Process temperature
- Chemical properties of the medium
- Abrasion and mechanical influences

#### Protection against moisture

Protect your instrument against moisture ingress through the following measures:

- Use a suitable connection cable (see chapter " *Connecting to power supply* ")
- Tighten the cable gland or plug connector
- Lead the connection cable downward in front of the cable entry or plug connector

This applies mainly to outdoor installations, in areas where high humidity is expected (e.g. through cleaning processes) and on cooled or heated vessels.



##### Note:

Make sure that during installation or maintenance no moisture or dirt can get inside the instrument.

To maintain the housing protection, make sure that the housing lid is closed during operation and locked, if necessary.

#### Screwing in

Devices with threaded fitting are screwed into the process fitting with a suitable wrench via the hexagon.

See chapter " *Dimensions* " for wrench size.



##### Warning:

The housing or the electrical connection may not be used for screwing in! Depending on the device version, tightening can cause damage, e.g. to the rotation mechanism of the housing.

#### Vibrations

Avoid damages on the device by lateral forces, for example by vibrations. It is thus recommended to fix the devices with process fitting



thread G½ of plastic at the installation site via a suitable measuring instrument holder.

If there is strong vibration at the mounting location, the instrument version with external housing should be used. See chapter " *External housing*".

#### Permissible process pressure (MWP) - Device

The permissible process pressure range is specified by "MWP" (Maximum Working Pressure) on the type label, see chapter " *Structure*". The MWP takes the element of the measuring cell and processing fitting combination with the weakest pressure into consideration and may applied permanently. The specification refers to a reference temperature of +20 °C (+68 °F). It also applies when a measuring cell with a higher measuring range than the permissible pressure range of the process fitting is installed order-related.

In order to prevent damage to the device, a test pressure may only exceed the specified MWP briefly by 1.5 times at reference temperature. The pressure stage of the process fitting as well as the overload resistance of the measuring cell are taken into consideration here (see chapter " *Technical Data*").

In addition, a temperature derating of the process fitting, e. g. with flanges, can limit the permissible process pressure range according to the respective standard.

#### Permissible process pressure (MWP) - Mounting accessory

The permissible process pressure range is stated on the type label. The instrument should only be operated with these pressures if the mounting accessory used also fulfils these values. This should be ensured by suitable flanges, welded sockets, tension rings with Clamp connections, sealings, etc.

#### Temperature limits

Higher process temperatures often mean also higher ambient temperatures. Make sure that the upper temperature limits stated in chapter " *Technical data*" for the environment of the electronics housing and connection cable are not exceeded.

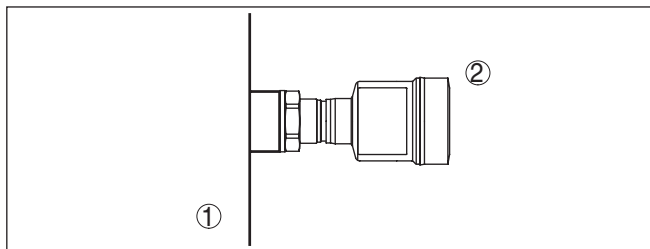


Fig. 7: Temperature ranges

- 1 Process temperature
- 2 Ambient temperature

## 4.2 Instructions for oxygen applications

Oxygen and other gases can be explosive when brought into contact with oils, grease and plastics, so the following measures must also be taken:

### Oxygen applications

- All components of the system, e.g. measuring instruments, must be cleaned in accordance with the requirements of recognized regulations or standards
- Depending on the seal material, certain temperatures and pressures must not be exceeded in oxygen applications, see chapter "*Technical data*"

**Danger:**

Instruments for oxygen applications must be unpacked just before mounting. After removing the protective cover of the process fitting, the label "O<sub>2</sub>" will be visible on the process fitting. Penetration of oil, grease and dirt should be avoided. Danger of explosion!

### 4.3 Ventilation and pressure compensation

**Filter element - Function**

The filter element in the electronics housing has the following functions:

- Ventilation of the electronics housing
- Atmospheric pressure compensation (with relative pressure measuring ranges)

**Caution:**

The filter element causes a time-delayed pressure compensation. When quickly opening/closing the housing cover, the measured value can change for approx. 5 s by up to 15 mbar.

For an effective ventilation, the filter element must be always free from buildup. In case of horizontal mounting, turn the housing so that the filter element points downward after the instrument is installed. This provides better protection against buildup.

**Caution:**

Do not use a high-pressure cleaner. The filter element could be damaged, which would allow moisture into the housing.

The following paragraphs describe how the filter element is arranged in the different instrument versions.

### Filter element - Position

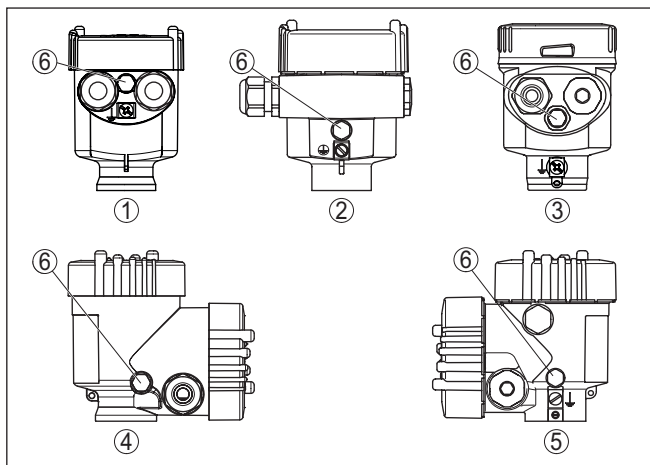


Fig. 8: Position of the filter element

- 1 Plastic, stainless steel single chamber (precision casting)
- 2 Aluminium - single chamber
- 3 Stainless steel single chamber (electropolished)
- 4 Plastic double chamber
- 5 Aluminium, stainless steel double chamber housing (precision casting)
- 6 Filter element

With the following instruments a blind plug is installed instead of the filter element:

- Instruments in protection IP66/IP68 (1 bar) - ventilation via capillaries in non-detachable cable
- Instruments with absolute pressure

### Filter element - Position Ex-d version

→ Turn the metal ring in such a way that the filter element points downward after installation of the instrument. This provides better protection against buildup.

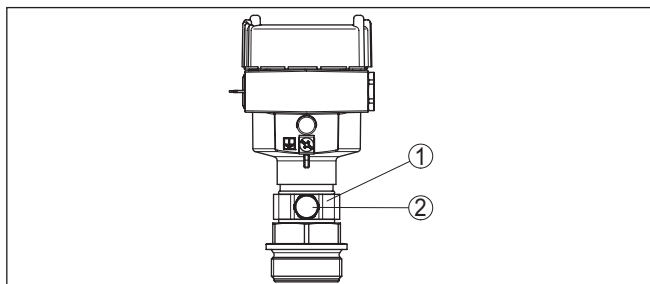


Fig. 9: Position of the filter element - Ex-d version

- 1 Rotatable metal ring
- 2 Filter element

Instruments with absolute pressure have a blind plug mounted instead of the filter element.

### Filter element - Position Second Line of Defense

The Second Line of Defense (SLOD) is a second level of the process separation in form of a gas-tight leadthrough in the housing neck, preventing products from penetrating into the housing.

With these instruments, the process assembly is completely encapsulated. An absolute pressure measuring cell is used so that no ventilation is required.

With relative pressure measuring ranges, the ambient pressure is detected and compensated by a reference sensor in the electronics.

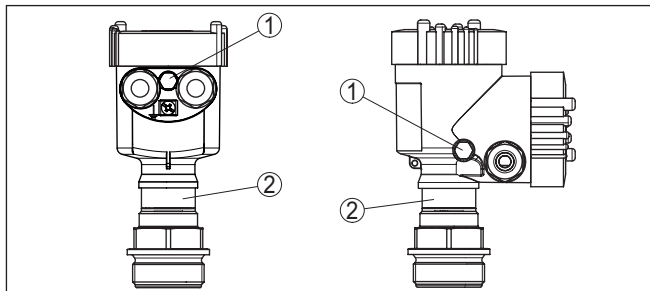


Fig. 10: Position of the filter element - gastight leadthrough

- 1 Filter element
- 2 Gas-tight leadthrough

### Filter element - Position IP69K version

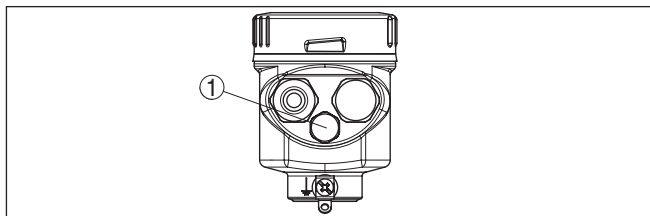


Fig. 11: Position of the filter element - IP69K version

- 1 Filter element

Instruments with absolute pressure have a blind plug mounted instead of the filter element.

## 4.4 Process pressure measurement

Keep the following in mind when setting up the measuring system:

- Mount the instrument above the measuring point

Possible condensation can then drain off into the process line.

### Measurement setup in gases

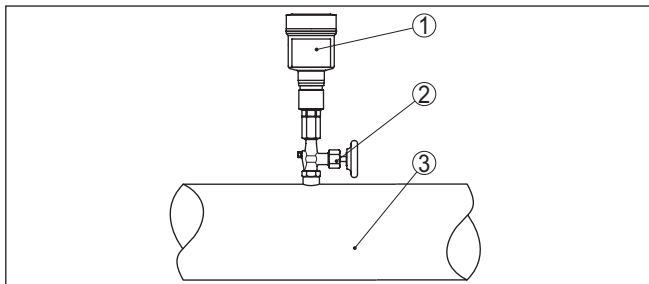


Fig. 12: Measurement setup for process pressure measurement of gases in pipelines

- 1 VEGABAR 83
- 2 Blocking valve
- 3 Pipeline

### Measurement setup in vapours

Keep the following in mind when setting up the measuring system:

- Connect via a siphon
- Do not insulate the siphon
- Fill the siphon with water before setup

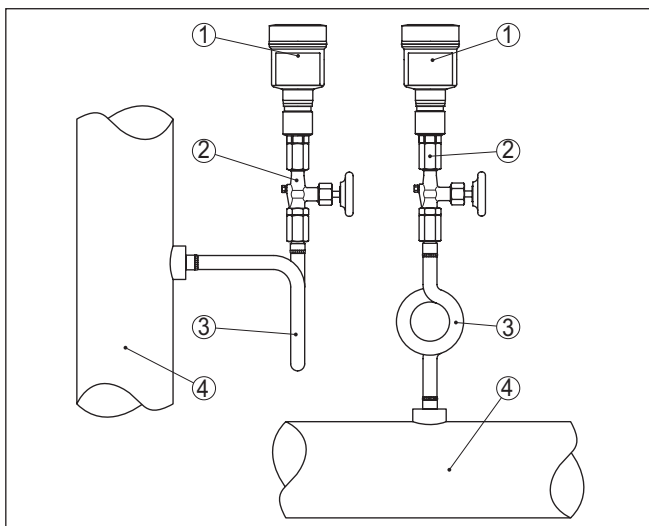


Fig. 13: Measurement setup for the process pressure measurement of gases in pipelines

- 1 VEGABAR 83
- 2 Blocking valve
- 3 Siphon in U or circular form
- 4 Pipeline

A protective accumulation of water is formed through condensation in the pipe bends. Even in applications with hot steam, a medium temperature < 100 °C on the transmitter is ensured.

### Measurement setup in liquids

Keep the following in mind when setting up the measuring system:

- Mount the instrument below the measuring point

The effective pressure line is always filled with liquid and gas bubbles can bubble up to the process line.

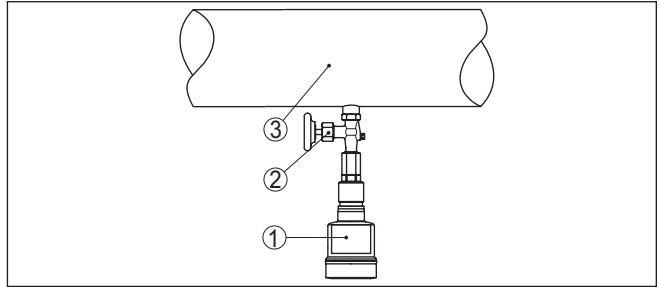


Fig. 14: Measurement setup for the process pressure measurement of liquids in pipelines

- 1 VEGABAR 83
- 2 Blocking valve
- 3 Pipeline

## 4.5 Level measurement

### Measurement setup

Keep the following in mind when setting up the measuring system:

- Mount the instrument below the min. level
- Do not mount the instrument close to the filling stream or emptying area
- Mount the instrument so that it is protected against pressure shocks from the stirrer

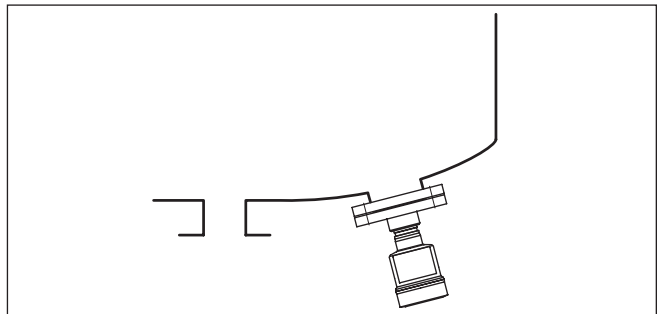


Fig. 15: Measurement setup for the level measurement

## 4.6 External housing

### Configuration

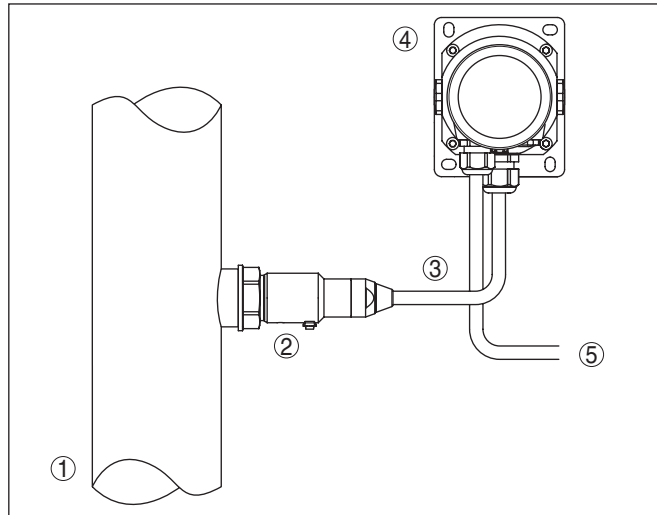


Fig. 16: Configuration, process module, external housing

- 1 Pipeline
- 2 Process module
- 3 Connection cable process assembly - External housing
- 4 External housing
- 5 Signal cable

## 5 Connecting to power supply

### 5.1 Preparing the connection

#### Safety instructions

Always keep in mind the following safety instructions:

- Carry out electrical connection by trained, qualified personnel authorised by the plant operator
- If overvoltage surges are expected, overvoltage arresters should be installed



#### Warning:

Only connect or disconnect in de-energized state.

#### Voltage supply

Power supply and current signal are carried on the same two-wire cable. The operating voltage can differ depending on the instrument version.

The data for power supply are specified in chapter " *Technical data*".

Provide a reliable separation between the supply circuit and the mains circuits according to DIN EN 61140 VDE 0140-1.

Power the instrument via an energy-limited circuit acc. to IEC 61010-1, e.g. via Class 2 power supply unit.

Keep in mind the following additional factors that influence the operating voltage:

- Lower output voltage of the power supply unit under nominal load (e.g. with a sensor current of 20.5 mA or 22 mA in case of fault signal)
- Influence of additional instruments in the circuit (see load values in chapter " *Technical data*")

#### Connection cable

The instrument is connected with standard two-wire cable without shielding. If electromagnetic interference is expected which is above the test values of EN 61326-1 for industrial areas, shielded cable should be used.

Use cable with round cross section for instruments with housing and cable gland. Use a cable gland suitable for the cable diameter to ensure the seal effect of the cable gland (IP protection rating).

We generally recommend the use of shielded cable for HART multidrop mode.

#### Cable screening and grounding

If shielded cable is required, we recommend connecting the cable screening on both ends to ground potential. In the sensor, the cable screening must be connected directly to the internal ground terminal. The ground terminal on the outside of the housing must be connected to the ground potential (low impedance).



In Ex systems, the grounding is carried out according to the installation regulations.

In electroplating plants as well as plants for cathodic corrosion protection it must be taken into account that significant potential differences



exist. This can lead to unacceptably high currents in the cable screen if it is grounded at both ends.



**Note:**

The metallic parts of the instrument (process fitting, sensor, concentric tube, etc.) are connected with the internal and external ground terminal on the housing. This connection exists either directly via the conductive metallic parts or, in case of instruments with external electronics, via the screen of the special connection cable.

You can find specifications on the potential connections inside the instrument in chapter " *Technical data*".

## Cable glands

### Metric threads:

In the case of instrument housings with metric thread, the cable glands are screwed in at the factory. They are sealed with plastic plugs as transport protection.



**Note:**

You have to remove these plugs before electrical connection.

### NPT thread:

In the case of instrument housings with self-sealing NPT threads, it is not possible to have the cable entries screwed in at the factory. The free openings for the cable glands are therefore covered with red dust protection caps as transport protection.



**Note:**

Prior to setup you have to replace these protective caps with approved cable glands or close the openings with suitable blind plugs.

On plastic housings, the NPT cable gland or the Conduit steel tube must be screwed into the threaded insert without grease.

Max. torque for all housings, see chapter " *Technical data*".

## 5.2 Connecting

### Connection technology

The voltage supply and signal output are connected via the spring-loaded terminals in the housing.

Connection to the display and adjustment module or to the interface adapter is carried out via contact pins in the housing.



**Information:**

The terminal block is pluggable and can be removed from the electronics. To do this, lift the terminal block with a small screwdriver and pull it out. When reinserting the terminal block, you should hear it snap in.

### Connection procedure

Proceed as follows:

1. Unscrew the housing lid
2. If a display and adjustment module is installed, remove it by turning it slightly to the left
3. Loosen compression nut of the cable gland and remove blind plug

4. Remove approx. 10 cm (4 in) of the cable mantle, strip approx. 1 cm (0.4 in) of insulation from the ends of the individual wires
5. Insert the cable into the sensor through the cable entry

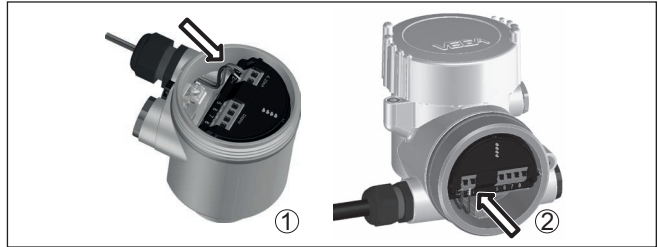


Fig. 17: Connection steps 5 and 6

- 1 Single chamber housing
- 2 Double chamber housing

6. Insert the wire ends into the terminals according to the wiring plan



**Note:**

Solid cores as well as flexible cores with wire end sleeves are inserted directly into the terminal openings. In case of flexible cores without end sleeves, press the terminal from above with a small screwdriver, the terminal opening is then free. When the screwdriver is released, the terminal closes again.

7. Check the hold of the wires in the terminals by lightly pulling on them
8. Connect the shielding to the internal ground terminal, connect the external ground terminal to potential equalisation
9. Tighten the compression nut of the cable entry gland. The seal ring must completely encircle the cable
10. Reinsert the display and adjustment module, if one was installed
11. Screw the housing lid back on

The electrical connection is finished.

### 5.3 Single chamber housing



The following illustration applies to the non-Ex, Ex-ia and Ex-d version.

### Electronics and connection compartment

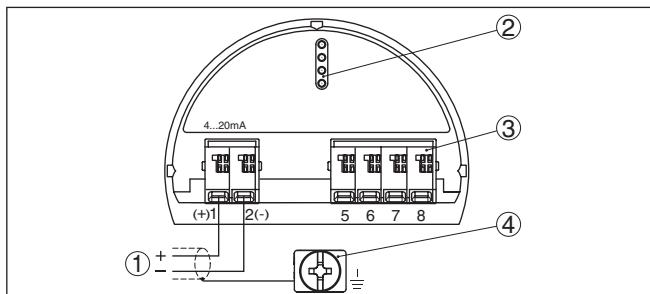


Fig. 18: Electronics and connection compartment - single chamber housing

- 1 Voltage supply, signal output
- 2 For display and adjustment module or interface adapter
- 3 For external display and adjustment unit or Secondary sensor
- 4 Ground terminal for connection of the cable screening

### 5.4 Double chamber housing



The following illustrations apply to the non-Ex as well as to the Ex-ia version.

### Electronics compartment

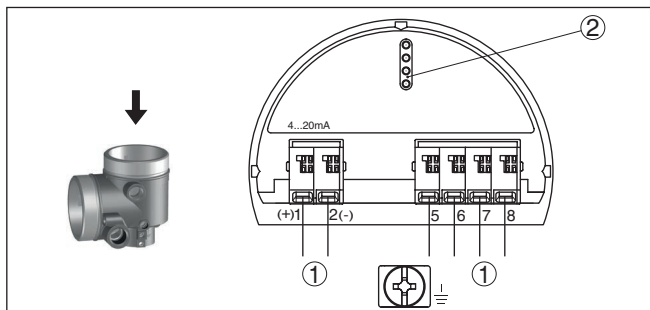


Fig. 19: Electronics compartment - double chamber housing

- 1 Internal connection to the connection compartment
- 2 For display and adjustment module or interface adapter

## Connection compartment

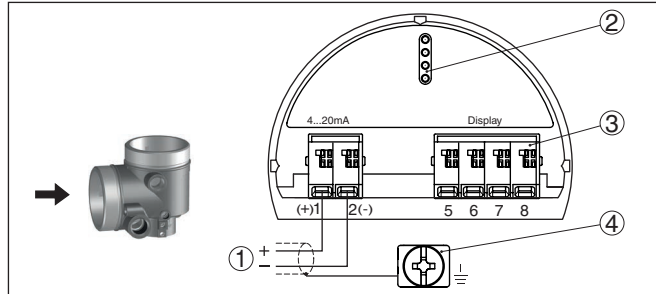


Fig. 20: Connection compartment - double chamber housing

- 1 Voltage supply, signal output
- 2 For display and adjustment module or interface adapter
- 3 For external display and adjustment unit
- 4 Ground terminal for connection of the cable screening

## Supplementary electronics - Additional current output

To make a second measured value available for use, you can use the supplementary electronics - additional current output.

Both current outputs are passive and need a power supply.

**SIL**

The additional current output (II) cannot be used in safety-instrumented systems according to SIL.

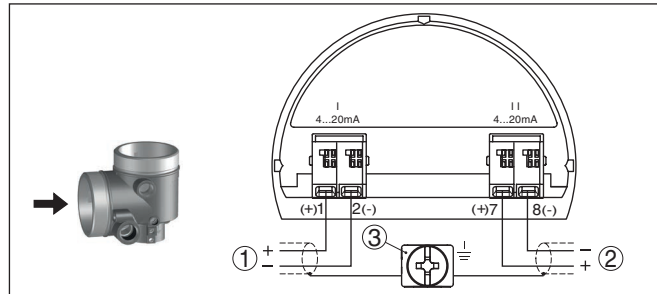


Fig. 21: Connection compartment, double chamber housing, supplementary electronics - additional current output

- 1 Current output (I) - Voltage supply of the sensor and signal output (with HART)
- 2 Additional current output (II) - Voltage supply and signal output (without HART)
- 3 Ground terminal for connection of the cable screening

## Connection compartment - Radio module PLICSMOBILE 81

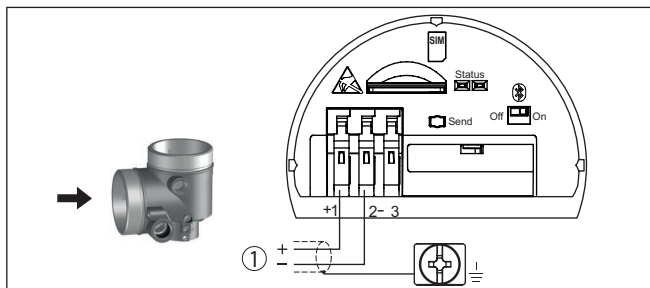


Fig. 22: Connection compartment - Radio module PLICSMOBILE 81

1 Voltage supply

You can find detailed information for connection in the operating instructions "PLICSMOBILE".

## 5.5 Ex-d-ia double chamber housing

### Electronics compartment

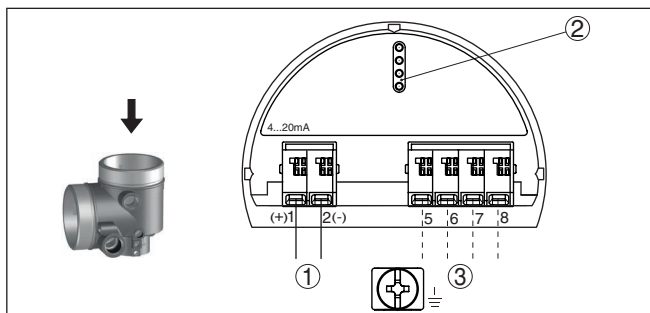


Fig. 23: Electronics compartment - Ex-d-ia double chamber housing

- 1 Internal connection to the connection compartment
- 2 For display and adjustment module or interface adapter
- 3 Internal connection to the plug connector for external display and adjustment unit (optional)



### Note:

HART multidrop mode is not possible when using an Ex-d-ia instrument.

## Connection compartment

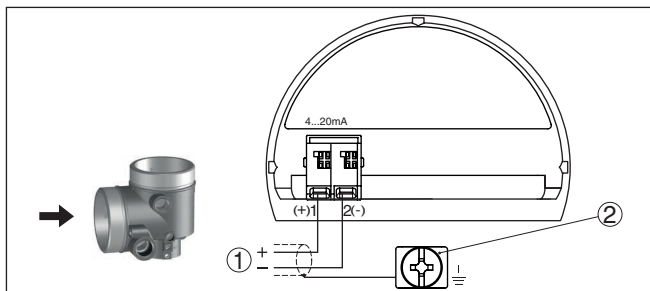


Fig. 24: Connection compartment - Ex-d-ia double chamber housing

- 1 Voltage supply, signal output
- 2 Ground terminal for connection of the cable screening

## 5.6 Double chamber housing with VEGADIS-Adapter

## Electronics compartment

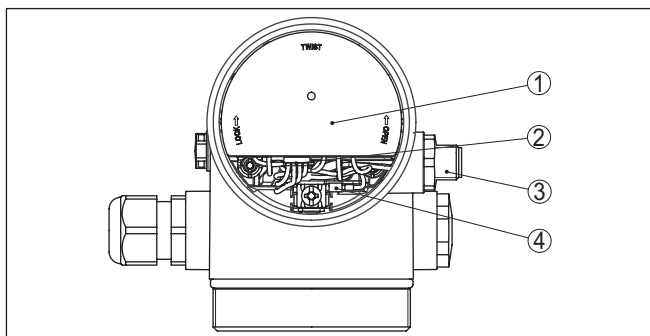


Fig. 25: View to the electronics compartment with VEGADIS adapter for connection of the external display and adjustment unit

- 1 VEGADIS adapter
- 2 Internal plug connection
- 3 M12 x 1 plug connector

## Assignment of the plug connector

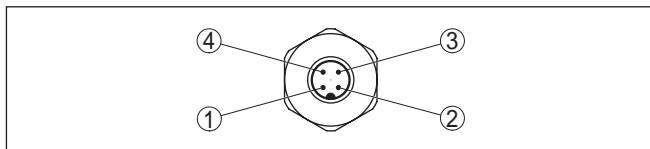


Fig. 26: Top view of the M12 x 1 plug connector

- 1 Pin 1
- 2 Pin 2
- 3 Pin 3
- 4 Pin 4

| Contact pin | Colour, connection cable in the sensor | Terminal, electronics module |
|-------------|--|------------------------------|
| Pin 1       | Brown                                  | 5                            |
| Pin 2       | White                                  | 6                            |
| Pin 3       | Blue                                   | 7                            |
| Pin 4       | Black                                  | 8                            |

### Wire assignment, connection cable

## 5.7 Housing IP66/IP68 (1 bar)

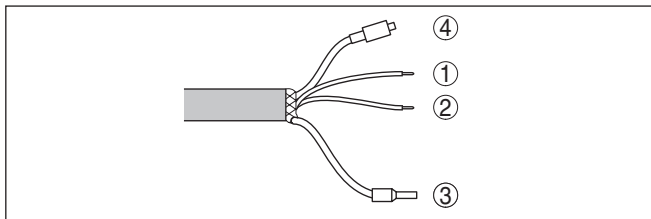


Fig. 27: Wire assignment, connection cable

- 1 Brown (+): to voltage supply or to the processing system
- 2 Blue (-): to voltage supply or to the processing system
- 3 Shielding
- 4 Breather capillaries with filter element

### Overview

## 5.8 External housing with version IP68 (25 bar)

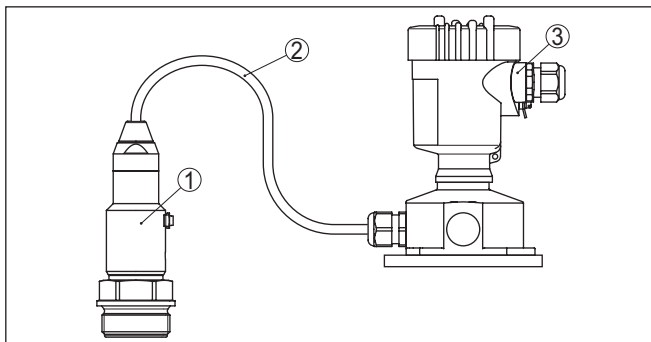


Fig. 28: VEGABAR 83 in IP68 version 25 bar with axial cable outlet, external housing

- 1 Transmitter
- 2 Connection cable
- 3 External housing

### Electronics and connection compartment for power supply

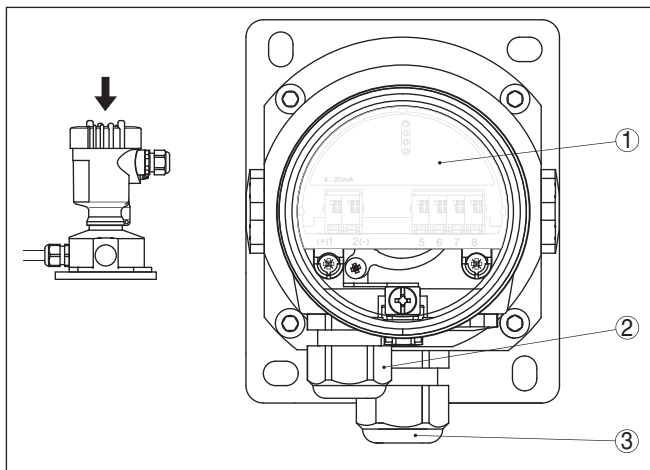


Fig. 29: Electronics and connection compartment

- 1 Electronics module
- 2 Cable gland for voltage supply
- 3 Cable gland for connection cable, transmitter

### Terminal compartment, housing socket

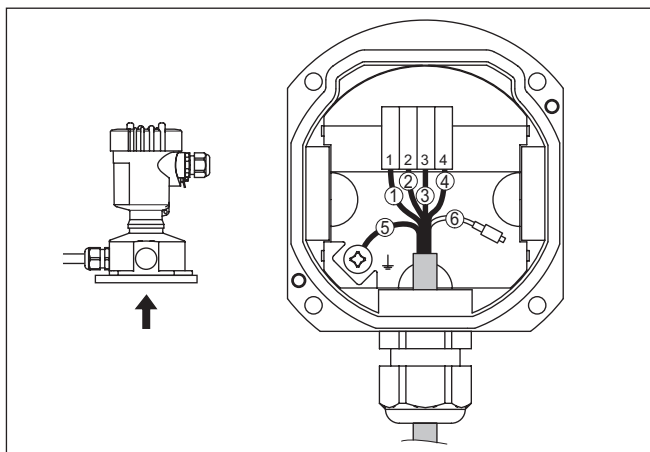


Fig. 30: Connection of the process component in the housing base

- 1 Yellow
- 2 White
- 3 Red
- 4 Black
- 5 Shielding
- 6 Breather capillaries



### Electronics and connection compartment

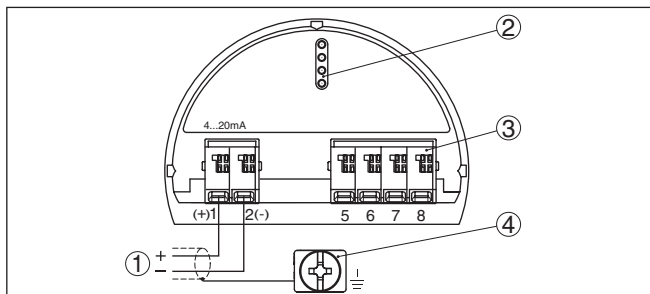


Fig. 31: Electronics and connection compartment - single chamber housing

- 1 Voltage supply, signal output
- 2 For display and adjustment module or interface adapter
- 3 For external display and adjustment unit or Secondary sensor
- 4 Ground terminal for connection of the cable screening

## 5.9 Connection example

### Connection example, additional current output

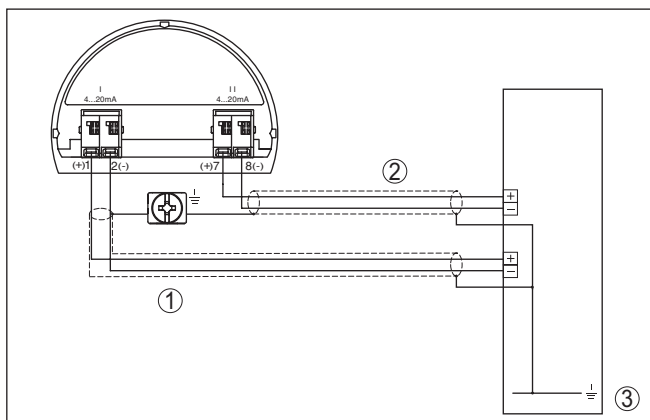


Fig. 32: Connection example VEGABAR 83 additional current output

- 1 Supply and signal circuit, sensor
- 2 Signal circuit, additional current output
- 3 Input card PLC

| Sensor                  | Circuit                                   | Input card PLC              |
|-------------------------|---|-----------------------------|
| Terminal 1 (+) pas-sive | Supply and signal circuit, sensor         | Input 1 terminal (+) active |
| Terminal 2 (-) pas-sive | Supply and signal circuit, sensor         | Input 1 terminal (-) active |
| Terminal 7 (+) pas-sive | Signal circuit, additional current output | Input 2 terminal (+) active |
| Terminal 8 (-) pas-sive | Signal circuit, additional current output | Input 2 terminal (-) active |

### 5.10 Switch-on phase

After connecting the instrument to power supply or after a voltage recurrence, the instrument carries out a self-check:

- Internal check of the electronics
- Indication of a status message on the display or PC
- The output signal jumps to the set fault current

Then the actual measured value is output to the signal cable. The value takes into account settings that have already been carried out, e.g. default setting.

## 6 Functional safety (SIL)

### 6.1 Objective

#### Background

In case of dangerous failures, processing facilities and machines can cause risks for persons, environment and property. The risk of such failures must be judged by the plant operator. Dependent thereon are measures for risk reduction through error prevention, error detection and fault control.

#### Plant safety by risk reduction

The part of plant safety depending on the correct functioning of safety-related components for risk reduction is called functional safety. Components used in such safety-instrumented systems (SIS) must therefore execute their intended function (safety function) with a defined high probability.

#### Standards and safety levels

The safety requirements for such components are described in the international standards IEC 61508 and 61511, which set the standard for uniform and comparable judgement of instrument and plant (or machine) safety and hence contribute to worldwide legal certainty. We distinguish between four safety levels, from SIL1 for low risk to SIL4 for very high risk (SIL = Safety Integrity Level), depending on the required degree of risk reduction.

### 6.2 SIL qualification

#### Properties and requirements

When developing instruments that can be used in safety-instrumented systems, the focus is on avoiding systematical errors as well as determining and controlling random errors.

Here are the most important characteristics and requirements from the perspective of functional safety according to IEC 61508 (Edition 2):

- Internal monitoring of safety-relevant circuit parts
- Extended standardization of the software development
- In case of failure, switching of the safety-relevant outputs to a defined safe state
- Determination of the failure probability of the defined safety function
- Reliable parameterization with non-safe user environment
- Proof test

#### Safety Manual

The SIL qualification of components is specified in a manual on functional safety (Safety Manual). Here, you can find all safety-relevant characteristics and information the user and the planner need for planning and operating the safety-instrumented system. This document is attached to each instrument with SIL rating and can be also found on our homepage via the search.

### 6.3 Application area

The instrument can be used, for example, for process pressure and hydrostatic level measurement of liquids in safety-instrumented sys-

tems (SIS) acc. to IEC 61508 and IEC 61511. Note the specifications in the Safety Manual.

The following inputs/outputs are permitted:

- 4 ... 20 mA current output

#### Tool for operation and parameterization

The following tools are permitted for parameterization of the safety function:

- The integrated display and adjustment unit for on-site adjustment
- The DTM suitable for the device in conjunction with an adjustment software according to the FDT/DTM standard, e. g. PACTware



#### Note:

For operation of the VEGABAR 83 an actual DTM Collection is required. The modification of safety-relevant parameters is only possible with active connection to the instrument (online mode).

#### Safe parameterization

To avoid possible errors during parameter adjustment in a non-safe user environment, a verification procedure is used that makes it possible to detect parameter adjustment errors reliably. For this, safety-relevant parameters must be verified after they are stored in the device. In normal operating condition, the instrument is also locked against parameter changes through unauthorized access.

#### Safety-relevant parameters

To prevent unintentional or unauthorized adjustment, the set parameters must be protected from unauthorized access. For this reason the instrument is shipped in locked condition. The PIN in delivery status is "0000".

When shipped with a specific parameter adjustment, the instruments are accompanied by a list with the values deviating from the basic setting.

All safety-relevant parameters must be verified after a change.

The parameter settings of the measurement loop must be documented. You can find a list of all safety-relevant parameters in the delivery status in chapter " *Setup with the display and adjustment module*" under " *Additional adjustments - Reset*". In addition, a list of the safety-relevant parameters can be stored and printed via PACTware/DTM.

#### Unlock adjustment

For each parameter change, the instrument must be unlocked via a PIN (see chapter " *Parameter adjustment, setup steps - Lock adjustment*" ). The device status is indicated in the DTM by the symbol of an unlocked or locked padlock.

In delivery status, the PIN is **0000**.

#### Unsafe device status



#### Warning:

If adjustment is enabled, the safety function must be considered as unreliable. This applies until the parameterisation is terminated correctly. If necessary, other measures must be taken to maintain the safety function.

## Change parameters

All parameters changed by the operator are automatically stored temporarily so that they can be verified in the next step.

## Verify parameters/Lock adjustment

After setup, the modified parameters must be verified (confirm the correctness of the parameters). To do this, you first have to enter the PIN or the device code depending on the device. Here the adjustment is locked automatically. Then you carry out a comparison of two character strings. You must confirm that the character strings are identical. This is used to check the character presentation.

Then you confirm that the serial number of your instrument has been carried over correctly. This is used to check device communication.

Then, all modified parameters that have to be confirmed are listed. After this process is terminated, the safety function is again ensured.

## Incomplete process



### Warning:

If the described process was not carried out completely or correctly (e.g. due to interruption or voltage loss), the instrument remains in an unlocked, and thus unsafe, status.

## Instrument reset



### Warning:

In case of a reset to basic settings, all safety-relevant parameters will also be reset to default. Therefore all safety-relevant parameters must be checked or readjusted.

## 7 Set up with the display and adjustment module

### 7.1 Insert display and adjustment module

The display and adjustment module can be inserted into the sensor and removed again at any time. You can choose any one of four different positions - each displaced by 90°. It is not necessary to interrupt the power supply.

Proceed as follows:

1. Unscrew the housing lid
2. Place the display and adjustment module on the electronics in the desired position and turn it to the right until it snaps in.
3. Screw housing lid with inspection window tightly back on

Disassembly is carried out in reverse order.

The display and adjustment module is powered by the sensor, an additional connection is not necessary.



Fig. 33: Installing the display and adjustment module in the electronics compartment of the single chamber housing

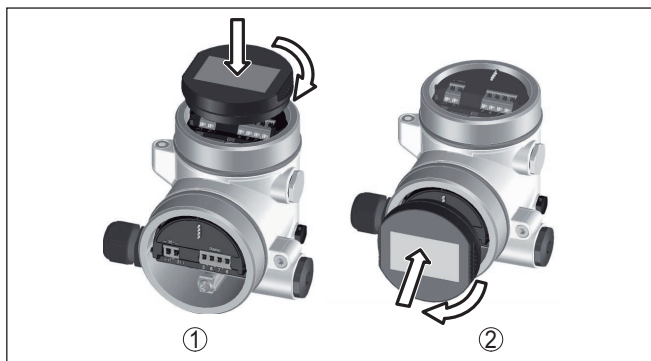


Fig. 34: Installing the display and adjustment module in the double chamber housing

- 1 In the electronics compartment
- 2 In the connection compartment



**Note:**

If you intend to retrofit the instrument with a display and adjustment module for continuous measured value indication, a higher lid with an inspection glass is required.

## 7.2 Adjustment system

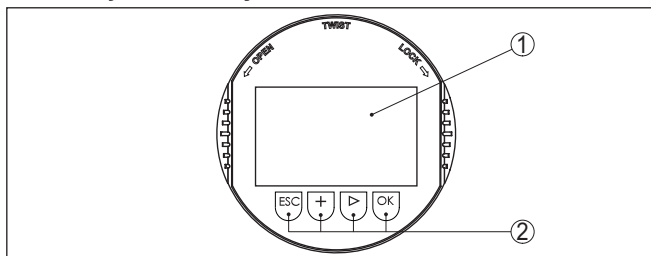


Fig. 35: Display and adjustment elements

- 1 LC display
- 2 Adjustment keys

### Key functions

- **[OK]** key:
  - Move to the menu overview
  - Confirm selected menu
  - Edit parameter
  - Save value
- **[>]** key:
  - Change measured value presentation
  - Select list entry
  - Select menu items
  - Select editing position
- **[+]** key:

- Change value of the parameter
- **[ESC]** key:
  - Interrupt input
  - Jump to next higher menu

### Adjustment system

The instrument is operated via the four keys of the display and adjustment module. The individual menu items are shown on the LC display. You can find the function of the individual keys in the previous illustration.

### Adjustment system - keys via magnetic pen

With the Bluetooth version of the display and adjustment module you can also adjust the instrument with the magnetic pen. The pen operates the four keys of the display and adjustment module right through the closed lid (with inspection window) of the sensor housing.

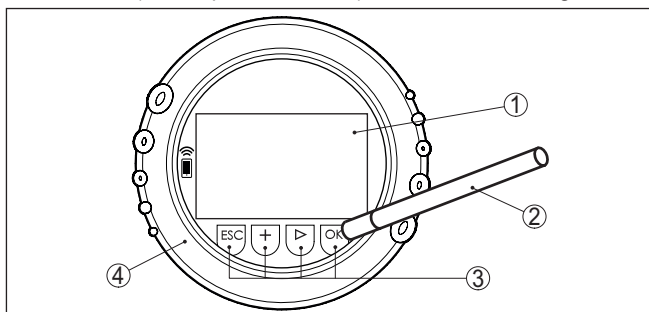


Fig. 36: Display and adjustment elements - with adjustment via magnetic pen

- 1 LC display
- 2 Magnetic pen
- 3 Adjustment keys
- 4 Lid with inspection window

### Time functions

When the **[+]** and **[>]** keys are pressed quickly, the edited value, or the cursor, changes one value or position at a time. If the key is pressed longer than 1 s, the value or position changes continuously.

When the **[OK]** and **[ESC]** keys are pressed simultaneously for more than 5 s, the display returns to the main menu. The menu language is then switched over to "English".

Approx. 60 minutes after the last pressing of a key, an automatic reset to measured value indication is triggered. Any values not confirmed with **[OK]** will not be saved.

## 7.3 Measured value indication

### Measured value indication

With the **[>]** key you can move between three different indication modes.

In the first view, the selected measured value is displayed in large digits.

In the second view, the selected measured value and a respective bargraph presentation are displayed.



In the third view, the selected measured value as well as a second selectable value, e.g. the temperature, are displayed.



With the "OK" key you move (during the initial setup of the instrument) to the selection menu "Language".

### Selection language

In this menu item, you can select the national language for further parameterization.



 
With the "[->]" button, you can select the requested language, with "OK" you confirm the selection and move to the main menu.

You can change your selection afterwards with the menu item "Setup - Display, Menu language".

## 7.4 Parameter adjustment

### Main menu

The main menu is divided into five sections with the following functions:



**Setup:** Settings e. g. for measurement loop name, application, units, position correction, adjustment, signal output, disable/enable operation

**Display:** Settings, e.g., for language, measured value display, lighting

**Diagnostics:** Information, for example, of device status, peak value, simulation

**Additional adjustments:** date/time, reset, copy function

**Info:** Instrument name, hardware and software version, calibration date, sensor features



#### Note:

For optimum setting of the measuring point, the individual submenu items in the main menu item "Setup" should be selected one after the other and provided with the correct parameters. If possible, go through the items in the given sequence.

The submenu points are described below.

### Operating sequence

A parameter change with SIL qualified instruments must always be carried out as follows:

- Unlock adjustment
- Change parameters

- Lock adjustment and verify modified parameters

 
This ensures that all modified parameters have been deliberately changed.

### Unlock adjustment

The instrument is shipped in locked condition.

To prevent unintentional or unauthorized adjustment, the instrument is protected (locked) against all parameter changes while in normal operating condition.

For each parameter change you have to enter the PIN of the instrument. In delivery status, the PIN is "0000".



### Change parameters

You can find a description below the respective parameter.

### Lock adjustment and verify modified parameters

You can find a description below the parameter " *Setup - Lock adjustment*".

## 7.4.1 Setup

 
### Measurement loop name

In the menu item " *Sensor TAG*" you edit a twelve-digit measurement loop designation.

You can enter an unambiguous designation for the sensor, e.g. the measurement loop name or the tank or product designation. In digital systems and in the documentation of larger plants, a singular designation must be entered for exact identification of individual measuring points.

The available digits include:

- Letters from A ... Z
- Numbers from 0 ... 9
- Special characters +, -, /, -



### Application

In this menu item you activate/deactivate the Secondary Device for electronic differential pressure and select the application.

VEGABAR 83 can be used for process pressure and level measurement. The setting in the delivery status is process pressure measurement. The mode can be changed in this adjustment menu.

If you have connected **no** Secondary Device, you confirm this with " *Deactivate*".

Depending on the selected application, different subchapters in the following adjustment steps are important. There you can find the individual adjustment steps.

|   |  |   |
|---|--|---|
| <b>Setup</b><br>Measurement loop name<br><b>Application</b><br>Units<br>Sensor mounting correction<br>Adjustment<br>Damping | Second Device for e1. differential pressure<br><b>Disabled!</b><br>Application<br><b>Level</b> | Second Device for e1. differential pressure<br>Disable<br><input checked="" type="checkbox"/> <b>Enable</b> |
|---|--|---|

Enter the requested parameters via the appropriate keys, save your settings with **[OK]** and jump to the next menu item with the **[ESC]** and the **[→]** key.

## Units

In this menu item, the adjustment units of the instrument are determined. The selection determines the unit displayed in the menu items "Min. adjustment (Zero)" and "Max. adjustment (Span)".

### Unit of measurement:

|  |   |   |
|--|---|---|
| <b>Units of measurement</b><br><b>m</b><br>Temperature unit<br><b>°C</b> | <b>Units of measurement</b><br>mbar<br><input checked="" type="checkbox"/> <b>bar</b><br>Pa<br>kPa<br>MPa | <b>Units of measurement</b><br>psi<br>mmH2O<br><input checked="" type="checkbox"/> <b>mmHg</b><br>inH2O<br>inHg |
|--|---|---|

If the level should be adjusted in a height unit, the density of the medium must also be entered later during the adjustment.

In addition, the temperature unit of the instrument is specified. The selection determines the unit displayed in menu items "Peak value, temperature" and "in the variables of the digital output signal".

### Temperature unit:

|  |   |
|--|---|
| <b>Units of measurement</b><br><b>m</b><br>Temperature unit<br><b>°C</b> | <b>Temperature unit</b><br><input checked="" type="checkbox"/> <b>°C</b><br>K<br>°F |
|--|---|

Enter the requested parameters via the appropriate keys, save your settings with **[OK]** and jump to the next menu item with the **[ESC]** and the **[→]** key.

## Position correction

Especially with chemical seal systems, the installation position of the instrument can shift (offset) the measured value. Position correction compensates this offset. In the process, the actual measured value is taken over automatically. With relative pressure measuring cells a manual offset can also be carried out.

|  |  |  |
|--|--|--|
| <b>Setup</b><br>Application<br>Units<br><b>Sensor mounting correction</b><br>Adjustment<br>Damping | <b>Sensor mounting correction</b><br><b>Offset</b><br><b>= -0.0003 bar</b><br>0.0001 bar | <b>Sensor mounting correction</b><br>Auto.correction<br>Edit |
|--|--|--|



### Note:

If the current measured value is automatically accepted, it must not be falsified by medium coverage or static pressure.

With the manual position correction, the offset value can be determined by the user. Select for this purpose the function "Edit" and enter the requested value.

Save your settings with **[OK]** and move with **[ESC]** and **[->]** to the next menu item.

After the position correction is carried out, the actual measured value is corrected to 0. The corrective value appears with an inverse sign as offset value in the display.

The position correction can be repeated as often as necessary. However, if the sum of the corrective values exceeds 20 % of the nominal measuring range, then no position correction is possible.

## Adjustment

VEGABAR 83 always measures pressure independently of the process variable selected in the menu item "Application". To output the selected process variable correctly, an allocation of the output signal to 0 % and 100 % must be carried out (adjustment).

With the application "Level", the hydrostatic pressure, e.g. with full and empty vessel, is entered for adjustment. See following example:

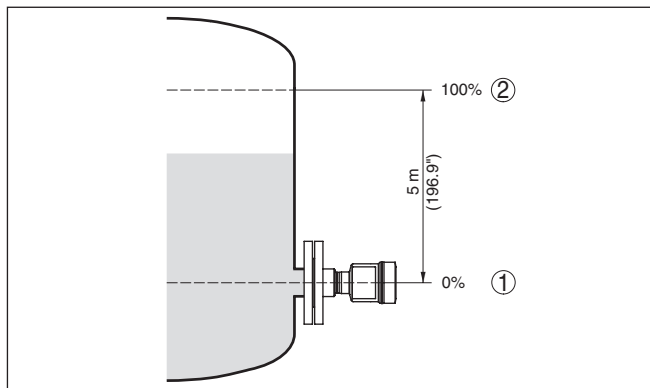


Fig. 37: Parameter adjustment example Min./max. adjustment, level measurement

- 1 Min. level = 0 % corresponds to 0.0 mbar
- 2 Max. level = 100 % corresponds to 490.5 mbar

If these values are not known, an adjustment with filling levels of e.g. 10 % and 90 % is also possible. By means of these settings, the real filling height is then calculated.

The actual product level during this adjustment is not important, because the min./max. adjustment is always carried out without changing the product level. These settings can be made ahead of time without the instrument having to be installed.



### Note:

 
If the adjustment ranges are exceeded, the entered value will not be accepted. Editing can be interrupted with **[ESC]** or corrected to a value within the adjustment ranges.

For the other process variables such as e.g. process pressure, differential pressure or flow, the adjustment is performed in like manner.


## Zero adjustment

Proceed as follows:

1. Select the menu item "Setup" with **[>]** and confirm with **[OK]**.  
Now select with **[>]** the menu item "Zero adjustment" and confirm with **[OK]**.



 2. Edit the mbar value with **[OK]** and set the cursor to the requested position with **[>]**.



3. Set the requested mbar value with **[+]** and store with **[OK]**.
  4. Go with **[ESC]** and **[>]** to the span adjustment
- The zero adjustment is finished.



### Information:

The Zero adjustment shifts the value of the span adjustment. The span, i.e. the difference between these values, however, remains unchanged.

 
For an adjustment with pressure, simply enter the actual measured value indicated at the bottom of the display.

If the adjustment ranges are exceeded, the message "Outside parameter limits" appears. The editing procedure can be aborted with **[ESC]** or the displayed limit value can be accepted with **[OK]**.


## Span adjustment

Proceed as follows:

1. Select with **[>]** the menu item Span adjustment and confirm with **[OK]**.



 2. Edit the mbar value with **[OK]** and set the cursor to the requested position with **[>]**.



3. Set the requested mbar value with **[+]** and store with **[OK]**.

For an adjustment with pressure, simply enter the actual measured value indicated at the bottom of the display.




If the adjustment ranges are exceeded, the message "Outside parameter limits" appears. The editing procedure can be aborted with **[ESC]** or the displayed limit value can be accepted with **[OK]**.

The span adjustment is finished.

**Min. adjustment - Level**

  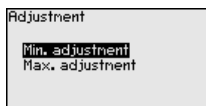Proceed as follows:

1. Select the menu item "Setup" with **[<->]** and confirm with **[OK]**.  
Now select with **[<->]** the menu item "Adjustment", then "Min. adjustment" and confirm with **[OK]**.



2. Edit the percentage value with **[OK]** and set the cursor to the requested position with **[<->]**.
3. Set the requested percentage value (e.g. 10 %) with **[+]** and save with **[OK]**. The cursor jumps now to the pressure value.
4. Enter the pressure value corresponding to the min. level (e.g. 0 mbar).
5. Save settings with **[OK]** and move with **[ESC]** and **[<->]** to the max. adjustment.




The min. adjustment is finished.

For an adjustment with filling, simply enter the actual measured value indicated at the bottom of the display.

**Max. adjustment - Level**

   Proceed as follows:

1. Select with **[<->]** the menu item Max. adjustment and confirm with **[OK]**.






2. Edit the percentage value with **[OK]** and set the cursor to the requested position with **[<->]**.
3. Set the requested percentage value (e.g. 90 %) with **[+]** and save with **[OK]**. The cursor jumps now to the pressure value.
4. Enter the pressure value for the full vessel (e.g. 900 mbar) corresponding to the percentage value.
5. Save settings with **[OK]**

The max. adjustment is finished.

For an adjustment with filling, simply enter the actual measured value indicated at the bottom of the display.

**Damping**

   
To damp process-dependent measured value fluctuations, set an integration time of 0 ... 999 s in this menu item. The increment is 0.1 s. The set damping is effective for level and process pressure measurement as well as for all applications of electronic differential pressure measurement.



The default setting is a damping of 0 s.

## Linearisation

 A linearization is necessary for all vessels in which the vessel volume does not increase linearly with the level - e.g. a horizontal cylindrical or spherical tank - and the indication or output of the volume is required. Corresponding linearization curves are preprogrammed for these vessels. They represent the correlation between the level percentage and vessel volume. The linearization applies to the measured value indication and the current output.



With flow measurement and selection " *Linear*" display and output (percentage/current) are linear to " **Differential pressure**". This can be used, for example, to feed a flow computer.

With flow measurement and selection " *Extraction by root*" display and output (percentage/current) are linear to " **Flow**". <sup>3)</sup>

With flow in two directions (bidirectional) a negative differential pressure is also possible. This must already be taken into account in menu item " *Min. adjustment flow*".



### Caution:

Note the following, if the respective sensor is used as part of an over-fill protection system according to WHG:

If a linearisation curve is selected, the measuring signal is no longer necessarily linear to the filling height. This must be considered by the user especially when setting the switching point on the limit signal transmitter.

## Current output

In the menu items " *Current output*" you determine the properties of the current output.

 
On instruments with integrated additional current output, the properties for each current output are adjusted individually. The following descriptions apply to both current outputs.



The additional current output cannot be used as an output in the sense of a safety-instrumented application (SIL).

## Current output (mode)

In the menu item " *Current output mode*" you determine the output characteristics and reaction of the current output in case of fault.




The default setting is output characteristics 4 ... 20 mA, fault mode < 3.6 mA.

<sup>3)</sup> The device assumes an approximately constant temperature and static pressure and converts the differential pressure into the flow rate via the characteristic curve extracted by root.

**Current output (min./max.)**

 In the menu item " *Current output Min./Max.* ", you determine the reaction of the current output during operation.



The default setting is min. current 3.8 mA and max. current 20.5 mA.

**Lock adjustment****SIL**

With this menu item you safeguard the sensor parameters against unauthorized or unintentional modifications.

To avoid possible errors during parameter adjustment in a non-safe environment, a verification procedure is used that enables reliable detection of parameter adjustment errors. In this procedure, safety-relevant parameters are verified before saving them in the instrument.

In addition, as a protection against unintentional or unauthorized adjustment, the instrument is locked against all parameter changes in normal operating condition.

 
**1. Enter PIN**

The instrument is shipped in locked condition. The PIN in the delivery status is "0000".

**2. Character string comparison**

You then have to carry out the character string comparison. This is used to check the character presentation.

Confirm if the two character strings are identical. The verification texts are provided in German and in the case of all other menu languages, in English.

**3. Serial number acknowledgement**

Afterwards you confirm that the serial number of your instrument was carried over correctly. This is used to check device communication.

**4. Verify parameters**

All safety-relevant parameters must be verified after a change:

- SIL parameter 1: Zero adjustment
- SIL parameter 2: Secondary on/off
- Non-SIL parameter 1: Measured value presentation



- Non-SIL parameter 2: Display value 1, unit of the application
- Non-SIL parameter 3: Menu language
- Non-SIL parameter 4: Lighting

Confirm the modified values one after the other.

|                          |                                |   |
|--------------------------|--------------------------------|---|
| SIL-Parameter<br>1 von 2 | Nicht-SIL-Parameter<br>1 von 4 | Acknowledgement<br>Are number and values<br>of the modified<br>parameters correct?<br>OK? |
| Parameter OK?            | Parameter OK?                  |   |

If the described process of parameter adjustment was run through completely and correctly, the instrument will be locked and hence ready for operation.

Bedienung

**Gesperrt**

Freigegeben?



Otherwise the instrument remains in the released and hence unsafe condition.



### Information:

As long as the VEGABAR 83 is powered, the display and adjustment module remains in the actually set adjustment menu. An automatic, time-controlled reset to the measured value indication is not carried out.

## 7.4.2 Display

### Language

This menu item enables the setting of the requested national language.

|   |  |
|---|--|
| Display<br>Menu language<br>Indication value 1<br>Indication value 2<br>Display format<br>Backlight | Menu language<br>Deutsch<br>✓ English<br>Francais<br>Español<br>Pyckuu |
|---|--|

 
The following languages are available:

- German
- English
- French
- Spanish
- Russian
- Italian
- Dutch
- Portuguese
- Japanese
- Chinese
- Polish
- Czech
- Turkish

In delivery status, the VEGABAR 83 is set to English.

### Display value 1 and 2


In this menu item, you define which measured value is displayed.



The setting in the delivery status for the display value is " *Lin. percent*".

## Display format 1 and 2

 
In this menu item you define the number of decimal positions with which the measured value is displayed.



The setting in the delivery status for the display format is " *Automatic*".

## Backlight

 The display and adjustment module has a backlight for the display. In this menu item you can switch on the lighting. You can find the required operating voltage in chapter " *Technical data*".




In delivery status, the lighting is switched on.

## 7.4.3 Diagnostics
 
### Device status

In this menu item, the device status is displayed.




In case of error, e.g. the error code F017, e.g. the error description " *Adjustment span too small*" and a four digit figure are displayed for service purposes. You can find the error codes with description, reason as well as rectification in chapter " *Asset Management*".

### Peak value, pressure

 The respective min. and max. measured values are saved in the sensor. The two values are displayed in menu item " *Peak values, pressure*".




In another window you can carry out a reset of the peak values separately.



### Peak value, temperature







The respective min. and max. measured values of the measuring cell and the electronics temperature are stored in the sensor. In menu item " *Peak value, temperature*", both values are displayed.

   In another window you can carry out a reset of the two peak values separately.



## Simulation

      In this menu item you can simulate measured values via the current output. This allows the signal path to be tested, e.g. through downstream indicating instruments or the input card of the control system.



Select the requested simulation variable and set the requested value.

To deactivate the simulation, you have to push the **[ESC]** key and confirm the message "Deactivate simulation" with the **[OK]** key.



### Caution:

During simulation, the simulated value is output as 4 ... 20 mA current value and digital HART signal.



 
 
### Information:

Without manual deactivation, the sensor terminates the simulation automatically after 60 minutes.

## 7.4.4 Additional adjustments



### Date/Time

In this menu item, you adjust the internal clock of the sensor. There is no adjustment for summer/winter (daylight saving) time.



### Reset

  After a reset, certain parameter adjustments made by the user are reset.



The following reset functions are available:

**Delivery status:** Restores the parameter settings at the time of shipment from the factory, incl. the order-specific settings. Any user-defined linearisation curve as well as the measured value memory are deleted.

 
**Basic settings:** Resets the parameter settings, incl. special parameters, to the default values of the respective instrument. Any programmed linearisation curve as well as the measured value memory are deleted.

**Copy instrument settings** The instrument settings are copied with this function. The following functions are available:

- **Read from sensor:** Read data from sensor and store into the display and adjustment module
- **Write into sensor:** Store data from the display and adjustment module back into the sensor

The following data or settings for adjustment of the display and adjustment module are saved:

- All data of the menu "Setup" and "Display"
- In the menu "Additional adjustments" the items "Reset, Date/Time"
- The user-programmable linearization curve



The copied data are permanently saved in an EEPROM memory in the display and adjustment module and remain there even in case of power failure. From there, they can be written into one or more sensors or kept as backup for a possible electronics exchange.




**Note:**

 Before the data are saved in the sensor, a safety check is carried out to determine if the data match the sensor. In the process the sensor type of the source data as well as the target sensor are displayed. If the data do not match, a fault message is outputted or the function is blocked. The data are saved only after release.


## Scaling (1)

In menu item "Scaling" you define the scaling variable and the scaling unit for the level value on the display, e.g. volume in l.



## Scaling (2)

 In menu item "Scaling (2)" you define the scaling format on the display and the scaling of the measured level value for 0 % and 100 %.



## Current output

In the menu items "Current output" you determine the properties of the current output.

 
On instruments with integrated additional current output, the properties for each current output are adjusted individually. The following descriptions apply to both current outputs.

**SIL** The additional current output cannot be used as an output in the sense of a safety-instrumented application (SIL).

## Current output 1 and 2 (size)

In menu item "Current output, variable" you specify which measured variable the current output refers to.


**SIL** For instruments with SIL qualification, the selection is limited to lin. percent.



## HART mode

The sensor is preset to the HART mode "Analogue current output".

 **SIL** For instruments with SIL qualification, this parameter cannot be modified.




The default setting is "Analogue current output" and the address 00.

## Special parameters

 In this menu item you gain access to the protected area where you can enter special parameters. In exceptional cases, individual parameters can be modified in order to adapt the sensor to special requirements.


Change the settings of the special parameters only after having contacted our service staff.



## 7.4.5 Info


### Device name

 In this menu item, you can read out the instrument name and the instrument serial number:




### Instrument version

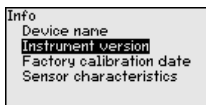
In this menu item, the hardware and software version of the sensor is displayed.

**Factory calibration date**

 In this menu item, the date of factory calibration of the sensor as well as the date of the last change of sensor parameters are displayed via the display and adjustment module or via the PC.

**Sensor characteristics**

 In this menu item, the features of the sensor such as approval, process fitting, seal, measuring range, electronics, housing and others are displayed.

**7.5 Menu overview**

The following tables show the adjustment menu of the instrument. Depending on the instrument version or application, all menu items may not be available or some may be differently assigned.



The safety-relevant menu items having to do with functional safety according to IEC 61508 (Edition 2) are marked with "SIL".

**Setup**

| Menu item                 | Parameter  | Default value   |
|---------------------------|--|---|
| Measurement loop name     | 19 alphanumeric characters/special characters                | Sensor  |
| Application (SIL)         | Application  | Level   |
|                           | Secondary sensor for electronic differential pressure        | Deactivated   |
| Units                     | Adjustment unit (m, bar, Pa, psi ... user-defined)           | mbar (with nominal measuring range $\leq 400$ mbar)<br>bar (with nominal measuring ranges $\geq 1$ bar) |
|                           | Temperature unit ( $^{\circ}\text{C}$ , $^{\circ}\text{F}$ ) | $^{\circ}\text{C}$  |
| Position correction (SIL) |  | 0.00 bar  |
| Adjustment (SIL)          | Zero/Min. adjustment   | 0.00 bar<br>0.00 %  |
|                           | Span/Max. adjustment   | Nominal measuring range in bar<br>100.00 %  |
| Damping (SIL)             | Integration time   | 1 s   |

| Menu item             | Parameter  | Default value |
|-----------------------|--|---------------|
| Linearisation         | Linear, cylindrical tank, ... user-defined                     | Linear        |
| Current output (SIL)  | Current output - Mode  |               |
|                       | Output characteristics: 4 ... 20 mA, 20 ... 4 mA               | 4 ... 20 mA   |
|                       | Failure mode: $\leq 3.6$ mA, $\geq 20$ mA, last measured value | $\leq 3.6$ mA |
|                       | Current output - Min./Max.                                     |               |
|                       | Min. current: 3.8 mA, 4 mA                                     | 3.8 mA        |
|                       | Max. current: 20 mA, 20.5 mA                                   | 20.5 mA       |
| Lock adjustment (SIL) | Blocked, released  | Last setting  |

### Display

| Menu item         | Default value  |
|-------------------|--|
| Menu language     | No reset   |
| Displayed value 1 | Pressure   |
| Displayed value 2 | Ceramic measuring cell: Measuring cell temperature in °C<br>Metallic measuring cell: Electronics temperature in °C |
| Backlight         | Switched off   |

### Diagnostics

| Menu item              | Parameter      | Default value                                    |
|------------------------|----------------|--|
| Device status          |                | No reset   |
| Peak value             | Pressure       | Current pressure measured value                  |
| Pointer function temp. | Temperature    | Actual measuring cell and electronic temperature |
| Simulation             | Measured value | Pressure   |
|                        | Simulations    | Not active                                       |
| Proof test             |                | No reset   |

### Additional adjustments

| Menu item                | Parameter                           | Default value   |
|--------------------------|-------------------------------------|---|
| Date/Time                |                                     | No reset  |
| Reset                    | Delivery status, basic settings     | No reset  |
| Copy instrument settings | Read from sensor, write into sensor | No reset  |
| Scaling                  | Scaling size                        | Volume in l   |
|                          | Scaling format                      | 0 % corresponds to 0 l<br>100 % corresponds to 0 l<br>Without decimal positions |

| Menu item               | Parameter                       | Default value                         |
|-------------------------|---------------------------------|---------------------------------------|
| Current output (SIL)    | Current output - Meas. variable | Lin. percent - Level                  |
|                         | Current output - Adjustment     | 0 ... 100 % correspond to 4 ... 20 mA |
| Current output 2        | Current output - Meas. variable | Measuring cell temperature            |
|                         | Current output - Adjustment     | 0 ... 100 % correspond to 4 ... 20 mA |
| HART mode               | HART address, current output    | Address 00, analogue current output   |
| Special parameter (SIL) | Service-Login                   | No reset                              |

## Info

| Menu item                | Parameter                      |
|--------------------------|--------------------------------|
| Device name              | VEGABAR 83                     |
| Instrument version       | Hardware and software version  |
| Factory calibration date | Date                           |
| Sensor characteristics   | Order-specific characteristics |

## 7.6 Save parameter adjustment data

### On paper

We recommend writing down the adjustment data, e.g. in this operating instructions manual, and archiving them afterwards. They are thus available for multiple use or service purposes.

### In the display and adjustment module

If the instrument is equipped with a display and adjustment module, the parameter adjustment data can be saved therein. The procedure is described in menu item "*Copy device settings*".



## 8 Setup with PACTware

### 8.1 Connect the PC

Via the interface adapter directly on the sensor

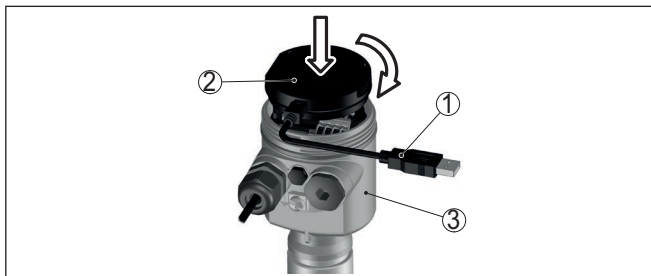


Fig. 38: Connection of the PC directly to the sensor via the interface adapter

- 1 USB cable to the PC
- 2 Interface adapter VEGACONNECT
- 3 Sensor

Via the interface adapter and HART

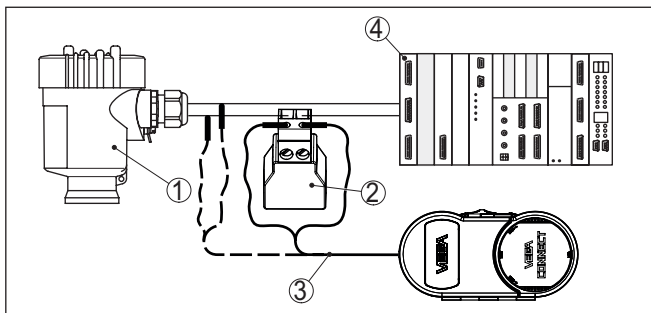


Fig. 39: Connecting the PC via HART to the signal cable

- 1 Sensor
- 2 HART resistance 250  $\Omega$  (optional depending on evaluation)
- 3 Connection cable with 2 mm pins and terminals
- 4 Processing system/PLC/Voltage supply
- 5 Interface adapter, for example VEGACONNECT 4



#### Note:

With power supply units with integrated HART resistance (internal resistance approx. 250  $\Omega$ ), an additional external resistance is not necessary. This applies, e.g. to the VEGA instruments VEGATRENN 149A, VEGAMET 381, VEGAMET 391. Common Ex separators are also usually equipped with a sufficient current limiting resistance. In such cases, the interface adapter can be connected parallel to the 4 ... 20 mA cable (dashed line in the previous illustration).

### 8.2 Parameterization

For parameter adjustment of the instrument via a Windows PC, the configuration software PACTware and a suitable instrument driver

#### Prerequisites

(DTM) according to FDT standard are required. The latest PACTware version as well as all available DTMs are compiled in a DTM Collection. The DTMs can also be integrated into other frame applications according to FDT standard.



### Note:

To ensure that all instrument functions are supported, you should always use the latest DTM Collection. Furthermore, not all described functions are included in older firmware versions. You can download the latest instrument software from our homepage. A description of the update procedure is also available in the Internet.

Further setup steps are described in the operating instructions manual "*DTM Collection/PACTware*" attached to each DTM Collection and which can also be downloaded from the Internet. Detailed descriptions are available in the online help of PACTware and the DTMs.

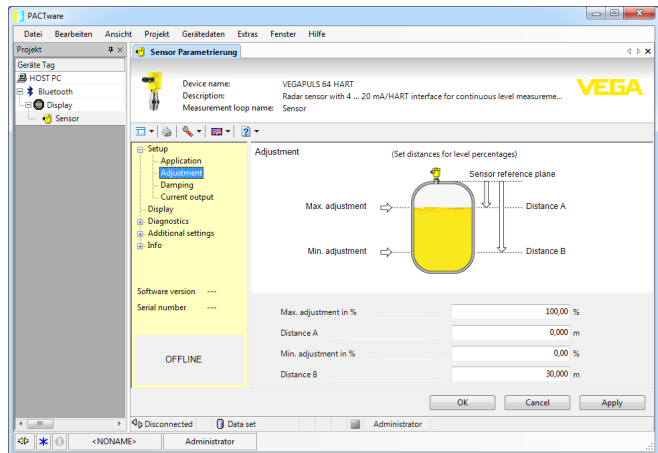


Fig. 40: Example of a DTM view

## Standard/Full version

All device DTMs are available as a free-of-charge standard version and as a full version that must be purchased. In the standard version, all functions for complete setup are already included. An assistant for simple project configuration simplifies the adjustment considerably. Saving/printing the project as well as import/export functions are also part of the standard version.

In the full version there is also an extended print function for complete project documentation as well as a save function for measured value and echo curves. In addition, there is a tank calculation program as well as a multiviewer for display and analysis of the saved measured value and echo curves.

The standard version is available as a download under [www.vega.com/downloads](http://www.vega.com/downloads) and "*Software*". The full version is available on CD from the agency serving you.

### 8.3 Save parameter adjustment data

We recommend documenting or saving the parameterisation data via PACTware. That way the data are available for multiple use or service purposes.

## 9 Set up with other systems

### 9.1 DD adjustment programs

Device descriptions as Enhanced Device Description (EDD) are available for DD adjustment programs such as, for example, AMS™ and PDM.

The files can be downloaded at [www.vega.com/downloads](http://www.vega.com/downloads) under "*Software*".

### 9.2 Field Communicator 375, 475

Device descriptions for the instrument are available as EDD for parameterisation with Field Communicator 375 or 475.

Integrating the EDD into the Field Communicator 375 or 475 requires the "Easy Upgrade Utility" software, which is available from the manufacturer. This software is updated via the Internet and new EDDs are automatically accepted into the device catalogue of this software after they are released by the manufacturer. They can then be transferred to a Field Communicator.

In the HART communication, the Universal Commands and a part of the Common Practice Commands are supported.

## 10 Diagnosis, asset management and service

### 10.1 Maintenance

#### Maintenance

If the device is used properly, no special maintenance is required in normal operation.

In some applications, product buildup on the diaphragm can influence the measuring result. Depending on the sensor and application, take precautions to ensure that heavy buildup, and especially a hardening thereof, is avoided.

#### Proof test

To identify possible undetected, dangerous failures, the safety function of the instrument must be checked in adequate intervals by a proof test.



During the function test, the safety function must be treated as unsafe. Keep in mind that the function test influences downstream connected devices.

If one of the tests proves negative, the entire measuring system must be switched out of service and the process held in a safe state by means of other measures.

You can find detailed information on the proof test in the Safety Manual (SIL).

### 10.2 Diagnosis memory

The instrument has several memories available for diagnostic purposes. The data remain there even in case of voltage interruption.

#### Measured value memory

Up to 100,000 measured values can be stored in the sensor in a ring memory. Each entry contains date/time as well as the respective measured value.

Depending on the instrument version, values that can be stored are for example:

- Level
- Process pressure
- Differential pressure
- Static pressure
- Percentage value
- Scaled values
- Current output
- Lin. percent
- Measuring cell temperature
- Electronics temperature

When the instrument is shipped, the measured value memory is active and stores pressure value and measuring cell temperature every 10 s, with electronic differential pressure also the static pressure.

The requested values and recording conditions are set via a PC with PACTware/DTM or the control system with EDD. Data are thus read out and also reset.

## Event memory

Up to 500 events are automatically stored with a time stamp in the sensor (non-deletable). Each entry contains date/time, event type, event description and value.

Event types are for example:

- Modification of a parameter
- Switch-on and switch-off times
- Status messages (according to NE 107)
- Error messages (according to NE 107)

The data are read out via a PC with PACTware/DTM or the control system with EDD.

## 10.3 Asset Management function

The instrument features self-monitoring and diagnostics according to NE 107 and VDI/VDE 2650. In addition to the status messages in the following tables, detailed error messages are available under menu item "Diagnostics" via the display and adjustment module, PACTware/DTM and EDD.

## Status messages

The status messages are divided into the following categories:

- Failure
- Function check
- Out of specification
- Maintenance required

and explained by pictographs:

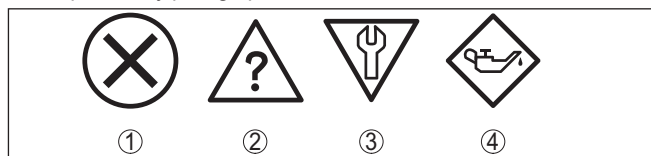


Fig. 41: Pictographs of the status messages

- 1 Failure - red
- 2 Out of specification - yellow
- 3 Function check - orange
- 4 Maintenance required - blue

### Malfunction (Failure):

Due to a malfunction in the instrument, a fault signal is output.

This status message is always active. It cannot be deactivated by the user.

### Function check:

The instrument is being worked on, the measured value is temporarily invalid (for example during simulation).

This status message is active by default. It can be deactivated by the user via PACTware/DTM or EDD.

### Out of specification:

The measured value is unreliable because an instrument specification was exceeded (e.g. electronics temperature).

This status message is inactive by default. It can be activated by the user via PACTware/DTM or EDD.

**Maintenance required:**

Due to external influences, the instrument function is limited. The measurement is affected, but the measured value is still valid. Plan in maintenance for the instrument because a failure is expected in the near future (e.g. due to buildup).

This status message is active by default. It can be deactivated by the user via PACTware/DTM or EDD.

**Failure**

| Code<br>Text message                            | Cause  | Rectification   | DevSpec<br>State in CMD 48       |
|---|--|---|----------------------------------|
| F013<br>No valid measured value available       | Gauge pressure or low pressure<br>Measuring cell defective                                     | Exchange measuring cell<br>Send instrument for repair   | Byte 5, Bit 0 of<br>Byte 0 ... 5 |
| F017<br>Adjustment span too small               | Adjustment not within specification  | Change the adjustment according to the limit values   | Byte 5, Bit 1 of<br>Byte 0 ... 5 |
| F025<br>Error in the linearization table        | Index markers are not continuously rising, for example illogical value pairs                   | Check linearization table<br>Delete table/Create new  | Byte 5, Bit 2 of<br>Byte 0 ... 5 |
| F036<br>no operable sensor software             | Failed or interrupted software update  | Repeat software update<br>Check electronics version<br>Exchanging the electronics<br>Send instrument for repair | Byte 5, Bit 3 of<br>Byte 0 ... 5 |
| F040<br>Error in the electronics                | Hardware defect  | Exchanging the electronics<br>Send instrument for repair  | Byte 5, Bit 4 of<br>Byte 0 ... 5 |
| F041<br>Communication error                     | No connection to the sensor electronics  | Check connection between sensor and main electronics (with separate version)                                    | -                                |
| F042<br>Communication error<br>Secondary sensor | No connection to the Secondary sensor  | Check connection between Primary and Secondary sensor   | -                                |
| F080<br>General software error                  | General software error   | Disconnect operating voltage briefly  | Byte 5, Bit 5 of<br>Byte 0 ... 5 |
| F105<br>Measured value is determined            | The instrument is still in the switch-on phase, the measured value could not yet be determined | Wait for the end of the switch-on phase   | Byte 5, Bit 6 of<br>Byte 0 ... 5 |
| F125<br>Impermissible electronics temperature   | Electronics temperature in the non-specified range   | Check ambient temperature<br>Insulate electronics<br>Use instrument with higher temperature range               | Byte 5, Bit 7 of<br>Byte 0 ... 5 |
| F260<br>Error in the calibration                | Error in the calibration carried out in the factory<br>Error in the EEPROM                     | Exchanging the electronics<br>Send instrument for repair  | Byte 4, Bit 0 of<br>Byte 0 ... 5 |

| Code<br>Text message                     | Cause  | Rectification   | DevSpec<br>State in CMD 48       |
|--|--|---|----------------------------------|
| F261<br>Error in the instrument settings | Error during setup<br>Error when carrying out a reset  | Repeat setup<br>Repeat reset  | Byte 4, Bit 1 of<br>Byte 0 ... 5 |
| F264<br>Installation/Setup error         | Inconsistent settings (e.g.: distance, adjustment units with application process pressure) for selected application<br><br>Invalid sensor configuration (e.g.: application electronic differential pressure with connected differential pressure measuring cell) | Modify settings<br><br>Modify connected sensor configuration or application | Byte 4, Bit 2 of<br>Byte 0 ... 5 |
| F265<br>Measurement function disturbed   | Sensor no longer carries out a measurement   | Carry out a reset<br>Disconnect operating voltage briefly                   | Byte 4, Bit 3 of<br>Byte 0 ... 5 |
| F266<br>Impermissible voltage supply     | Operating voltage below specified range  | Check electrical connection<br>If necessary, increase operating voltage     | Byte 4, Bit 6 of<br>Byte 0 ... 5 |

Tab. 8: Error codes and text messages, information on causes as well as corrective measures

**Function check**

| Code<br>Text message           | Cause                                  | Rectification  | DevSpec<br>State in CMD 48                     |
|--------------------------------|--|--|--|
| C700<br>Simulation active      | A simulation is active                 | Finish simulation<br>Wait for the automatic end after 60 mins. | "Simulation Active" in "Standardized Status 0" |
| C701<br>Parameter verification | Parameter verification was interrupted | Finish parameter verification                                  | Bit 13 of<br>Byte 14 ... 24                    |

**Out of specification**

| Code<br>Text message                          | Cause   | Rectification  | DevSpec<br>State in CMD 48          |
|---|---|--|-------------------------------------|
| S600<br>Impermissible electronics temperature | Temperature of the electronics in the non-specified range     | Check ambient temperature<br>Insulate electronics  | Byte 23, Bit 0 of<br>Byte 14 ... 24 |
| S603<br>Impermissible operating voltage       | Operating voltage below specified range                       | Check electrical connection<br>If necessary, increase operating voltage  | -                                   |
| S605<br>Impermissible pressure value          | Measured process pressure below or above the adjustment range | Check nominal measuring range of the instrument<br>If necessary, use an instrument with a higher measuring range | -                                   |



## Maintenance

| Code<br>Text message                                | Cause  | Rectification  | DevSpec<br>State in CMD 48 |
|---|--|--|----------------------------|
| M500<br>Error in the delivery status                | The data could not be restored during the reset to delivery status           | Repeat reset<br>Load XML file with sensor data into the sensor | Bit 0 of<br>Byte 14 ... 24 |
| M501<br>Error in the non-active linearisation table | Index markers are not continuously rising, for example illogical value pairs | Check linearization table<br>Delete table/Create new           | Bit 1 of<br>Byte 14 ... 24 |
| M502<br>Error in the event memory                   | Hardware error EEPROM  | Exchanging the electronics<br>Send instrument for repair       | Bit 2 of<br>Byte 14 ... 24 |
| M504<br>Error at a device interface                 | Hardware defect  | Exchanging the electronics<br>Send instrument for repair       | Bit 3 of<br>Byte 14 ... 24 |
| M507<br>Error in the instrument settings            | Error during setup<br>Error when carrying out a reset                        | Carry out reset and repeat setup                               | Bit 4 of<br>Byte 14 ... 24 |

## 10.4 Rectify faults

### Reaction when malfunction occurs

The operator of the system is responsible for taking suitable measures to rectify faults.

### Fault rectification

The first measures are:

- Evaluation of fault messages
- Checking the output signal
- Treatment of measurement errors

A smartphone/tablet with the adjustment app or a PC/notebook with the software PACTware and the suitable DTM offer you further comprehensive diagnostic possibilities. In many cases, the causes can be determined in this way and the faults eliminated.

### 4 ... 20 mA signal

Connect a multimeter in the suitable measuring range according to the wiring plan. The following table describes possible errors in the current signal and helps to eliminate them:

| Error   | Cause   | Rectification  |
|---|---|--|
| 4 ... 20 mA signal not stable                       | Fluctuating measured value                          | Set damping  |
| 4 ... 20 mA signal missing                          | Electrical connection faulty                        | Check connection, correct, if necessary                          |
|   | Voltage supply missing                              | Check cables for breaks; repair if necessary                     |
|   | Operating voltage too low, load resistance too high | Check, adapt if necessary  |
| Current signal greater than 22 mA, less than 3.6 mA | Sensor electronics defective                        | Replace device or send in for repair depending on device version |

**Reaction after fault rectification**

Depending on the reason for the fault and the measures taken, the steps described in chapter "Setup" must be carried out again or must be checked for plausibility and completeness.

**24 hour service hotline**

Should these measures not be successful, please call in urgent cases the VEGA service hotline under the phone no. **+49 1805 858550**.

The hotline is also available outside normal working hours, seven days a week around the clock.

Since we offer this service worldwide, the support is provided in English. The service itself is free of charge, the only costs involved are the normal call charges.

## 10.5 Exchange process module on version IP68 (25 bar)

On version IP68 (25 bar), the user can exchange the process module on site. Connection cable and external housing can be kept.

Required tools:

- Hexagon key wrench, size 2

**Caution:**

The exchange may only be carried out in the complete absence of line voltage.



In Ex applications, only a replacement part with appropriate Ex approval may be used.

**Caution:**

During exchange, protect the inner side of the parts against contamination and moisture.

Proceed as follows when carrying out the exchange:

1. Loosen the fixing screw with the hexagon key wrench
2. Carefully detach the cable assembly from the process module

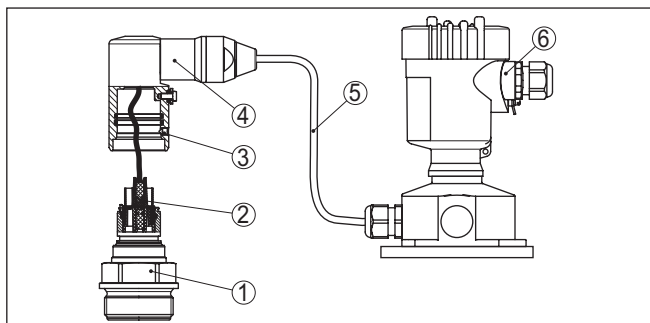


Fig. 42: VEGABAR 83 in IP68 version, 25 bar and lateral cable outlet, external housing

- 1 Process module
- 2 Plug connector
- 3 Fixing screw
- 4 Cable assembly
- 5 Connection cable
- 6 External housing

3. Loosen the plug connector
  4. Mount the new process module on the measuring point
  5. Plug the connector back in
  6. Mount the cable assembly on the process module and turn it to the desired position
  7. Tighten the fixing screw with the hexagon key wrench
- The exchange is finished.

## 10.6 Exchanging the electronics module

If the electronics module is defective, it can be replaced by the user.



With SIL qualified instrument, only a respective electronics module with SIL qualification must be used.



In Ex applications, only instruments and electronics modules with appropriate Ex approval may be used.

You can find detailed information on the electronics exchange in the booklet "Operating instructions for electronics module VEGABAR series 80".

## 10.7 Software update

The following components are required to update the instrument software:

- Instrument
- Voltage supply
- Interface adapter VEGACONNECT
- PC with PACTware
- Current instrument software as file

You can find the current instrument software as well as detailed information on the procedure in the download area of our homepage: [www.vega.com](http://www.vega.com).

You can find information about the installation in the download file.



Make sure that you are using the correct software with SIL qualification.

Instruments with SIL qualification can only be updated with a respective software. An accidental update with a wrong software version is impossible.



**Caution:**

Instruments with approvals can be bound to certain software versions. Therefore make sure that the approval is still effective after a software update is carried out.

You can find detailed information in the download area at [www.vega.com](http://www.vega.com).

## 10.8 How to proceed if a repair is necessary

You can find an instrument return form as well as detailed information about the procedure in the download area of our homepage. By doing this you help us carry out the repair quickly and without having to call back for needed information.

Proceed as follows in case of repair:

- Print and fill out one form per instrument
- Clean the instrument and pack it damage-proof
- Attach the completed form and, if need be, also a safety data sheet outside on the packaging
- Ask the agency serving you to get the address for the return shipment. You can find the agency on our homepage.

## 11 Dismount

### 11.1 Dismounting steps

To remove the device, carry out the steps in chapters " *Mounting*" and " *Connecting to power supply*" in reverse.



**Warning:**

When dismantling, pay attention to the process conditions in vessels or pipelines. There is a risk of injury, e.g. due to high pressures or temperatures as well as aggressive or toxic media. Avoid this by taking appropriate protective measures.

### 11.2 Disposal



Pass the instrument on to a specialised recycling company and do not use the municipal collecting points.

Remove any batteries in advance, if they can be removed from the device, and dispose of them separately.

If personal data is stored on the old device to be disposed of, delete it before disposal.

If you have no way to dispose of the old instrument properly, please contact us concerning return and disposal.

## 12 Supplement

### 12.1 Technical data

#### Note for approved instruments

The technical data in the respective safety instructions which are included in delivery are valid for approved instruments (e.g. with Ex approval). These data can differ from the data listed herein, for example regarding the process conditions or the voltage supply.

All approval documents can be downloaded from our homepage.

#### Materials and weights

##### Materials, wetted (piezoresistive/strain gauge measuring cell)

|   |   |
|---|---|
| Process fitting   | 316L, Alloy C276 (2.4819)   |
| Diaphragm   |   |
| – Front-flush   | 316L, Alloy C276 (2.4819) <sup>4)</sup>                                     |
| – Set back (measuring ranges up to and including 40 bar, from 1600 bar) | 316L  |
| – Set back (measuring ranges from 100 bar up to and including 1000 bar) | Elgiloy (2.4711)  |
| Seal ring, O-ring   | FKM (VP2/A), EPDM (A+P 70.10-02), FFKM (Perlast G74S), FEPM (Fluoraz SD890) |
| Seal for process fitting (in the scope of delivery)                     |   |
| – Thread G½ (EN 837), G1½ (DIN 3852-A)                                  | Aramid/NBR  |

##### Materials, wetted (ceramic/metallic measuring cell)

|   |  |
|---|--|
| Process fitting                                     | 316L   |
| Diaphragm   | Alloy C276 (2.4819), gold-coated 20 µ, gold/rhodium-coated 5 µ/1 µ <sup>5)</sup> |
| Seal for process fitting (in the scope of delivery) |  |
| – Thread G1½ (DIN 3852-A)                           | Klingersil C-4400  |
| – Thread M44 x 1.25 (DIN 13)                        | FKM, FFKM, EPDM  |
| Surface quality, hygienic process fittings, typ.    | R <sub>a</sub> < 0.8 µm  |

##### Materials, non-wetted parts

|   |   |
|---|---|
| Isolating liquid ceramic/metallic measuring cell        | KN 92 medical white oil (FDA conform)   |
| Internal isolating liquid piezoresistive measuring cell | Synthetic oil KN 77, Neobee M 20 KN 59 (FDA conform), Halocarbon oil 6.3 KN 21 <sup>6) 7)</sup> |

<sup>4)</sup> Alloy C276 (2.4819) with process fitting of Alloy C276 (2.4819)

<sup>5)</sup> Not on instruments with SIL qualification.

<sup>6)</sup> Isolating liquid with measuring ranges up to 40 bar. With measuring ranges from 100 bar dry measuring cell.

<sup>7)</sup> Halocarbon oil: Generally in oxygen applications, not with vacuum measuring ranges, not with absolute measuring ranges < 1 bar<sub>abs</sub>.

## Housing

|                                   |   |
|-----------------------------------|---|
| – Housing                         | Plastic PBT (Polyester), Aluminium AlSi10Mg (powder-coated, basis: Polyester), 316L |
| – Cable gland                     | PA, stainless steel, brass  |
| – Cable gland: Seal, closure      | NBR, PA   |
| – Seal, housing lid               | Silicone SI 850 R, NBR silicone-free  |
| – Inspection window housing cover | Polycarbonate (UL-746-C listed), glass <sup>8)</sup>                                |
| – Ground terminal                 | 316L  |

## External housing - deviating materials

|  |                                 |
|--|---------------------------------|
| – Housing and socket                           | Plastic PBT (Polyester), 316L   |
| – Socket seal                                  | EPDM                            |
| – Seal below wall mounting plate <sup>9)</sup> | EPDM                            |
| – Inspection window housing cover              | Polycarbonate (UL-746-C listed) |

Ground terminal 316Ti/316L

## Connection cable with IP68 (25 bar) version <sup>10)</sup>

|                               |         |
|-------------------------------|---------|
| – Cable cover                 | PE, PUR |
| – Type label support on cable | PE hard |

Connection cable with IP68 (1 bar) version <sup>11)</sup> PE, PUR

## Weights

Total weight VEGABAR 83 approx. 0.8 ... 8 kg (1.764 ... 17.64 lbs), depending on process fitting and housing

## Torques

### Max. torque, metric process fittings

|   |                       |
|---|-----------------------|
| – G¼, G½  | 50 Nm (36.88 lbf ft)  |
| – G½ front-flush, G1 front-flush                    | 40 Nm (29.50 lbf ft)  |
| – G1½ front-flush (piezoresistive measuring cell)   | 40 Nm (29.50 lbf ft)  |
| – G1½ front-flush (ceramic/metallic measuring cell) | 200 Nm (147.5 lbf ft) |

### Max. torque, non-metric process fittings

|  |                       |
|--|-----------------------|
| – ½ NPT, inside ¼ NPT<br>≤ 40 bar/500 psig | 50 Nm (36.88 lbf ft)  |
| – ½ NPT, inside ¼ NPT<br>> 40 bar/500 psig | 200 Nm (147.5 lbf ft) |
| – 7/16 NPT for tube ¼"                     | 40 Nm (29.50 lbf ft)  |
| – 9/16 NPT for tube 3/8"                   | 50 Nm (36.88 lbf ft)  |

<sup>8)</sup> Glass with Aluminium and stainless steel precision casting housing

<sup>9)</sup> Only for 316L with 3A approval

<sup>10)</sup> Between transmitter and external electronics housing.

<sup>11)</sup> Fix connected to the sensor.

Max. torque for NPT cable glands and Conduit tubes

- Plastic housing 10 Nm (7.376 lbf ft)
- Aluminium/Stainless steel housing 50 Nm (36.88 lbf ft)

### Input variable - Piezoresistive/Strain gauge measuring cell

The specifications are only an overview and refer to the measuring cell. Limitations due to the material and version of the process fitting as well as the selected pressure type are possible. The specifications on the nameplate apply. <sup>12)</sup>

### Nominal measuring ranges and overload capability in bar/kPa

| Nominal range                     | Overload capability |                  |
|-----------------------------------|---------------------|------------------|
|                                   | Maximum pressure    | Minimum pressure |
| Gauge pressure                    |                     |                  |
| 0 ... +0.4 bar/0 ... +40 kPa      | +1.2 bar/+120 kPa   | -1 bar/-100 kPa  |
| 0 ... +1 bar/0 ... +100 kPa       | +3 bar/+300 kPa     | -1 bar/-100 kPa  |
| 0 ... +2.5 bar/0 ... +250 kPa     | +7.5 bar/+750 kPa   | -1 bar/-100 kPa  |
| 0 ... +10 bar/0 ... +1000 kPa     | +30 bar/+3000 kPa   | -1 bar/-100 kPa  |
| 0 ... +25 bar/0 ... +2500 kPa     | +75 bar/+7500 kPa   | -1 bar/-100 kPa  |
| 0 ... +40 bar/0 ... +4000 kPa     | +120 bar/+12 MPa    | -1 bar/-100 kPa  |
| 0 ... +100 bar/0 ... +10 MPa      | +200 bar/+20 MPa    | -1 bar/-100 kPa  |
| 0 ... +250 bar/0 ... +25 MPa      | +500 bar/+50 MPa    | -1 bar/-100 kPa  |
| 0 ... +600 bar/0 ... +60 MPa      | +1200 bar/+120 MPa  | -1 bar/-100 kPa  |
| 0 ... +1000 bar/0 ... +100 MPa    | +1500 bar/+150 MPa  | -1 bar/-100 kPa  |
| -1 ... 0 bar/-100 ... 0 kPa       | +3 bar/+300 kPa     | -1 bar/-100 kPa  |
| -1 ... +1.5 bar/-100 ... +150 kPa | +7.5 bar/+750 kPa   | -1 bar/-100 kPa  |
| -1 ... +10 bar/-100 ... +1000 kPa | +30 bar/+3000 kPa   | -1 bar/-100 kPa  |
| -1 ... +25 bar/-100 ... +2500 kPa | +75 bar/+7500 kPa   | -1 bar/-100 kPa  |
| -1 ... +40 bar/-100 ... +4000 kPa | +120 bar/+12 MPa    | -1 bar/-100 kPa  |
| -0.2 ... +0.2 bar/-20 ... +20 kPa | +1.2 bar/+120 kPa   | -1 bar/-100 kPa  |
| -0.5 ... +0.5 bar/-50 ... +50 kPa | +3 bar/+300 kPa     | -1 bar/-100 kPa  |
| Absolute pressure                 |                     |                  |
| 0 ... 1 bar/0 ... 100 kPa         | 3 bar/300 kPa       | 0 bar abs.       |
| 0 ... 2.5 bar/0 ... 250 kPa       | 7.5 bar/750 kPa     | 0 bar abs.       |
| 0 ... 10 bar/0 ... 1000 kPa       | 30 bar/3000 kPa     | 0 bar abs.       |
| 0 ... 25 bar/0 ... 2500 kPa       | 75 bar/+7500 kPa    | 0 bar abs.       |
| 0 ... 40 bar/0 ... 4000 kPa       | 120 bar/+12 MPa     | 0 bar abs.       |

<sup>12)</sup> Data on overload capability apply for reference temperature.



## Nominal measuring ranges and overload capacity in psi

| Nominal range       | Overload capability |                  |
|---------------------|---------------------|------------------|
|                     | Maximum pressure    | Minimum pressure |
| Gauge pressure      |                     |                  |
| 0 ... +5 psig       | +15 psig            | -14.5 psig       |
| 0 ... +15 psig      | +45 psig            | -14.5 psig       |
| 0 ... +30 psig      | +90 psig            | -14.5 psig       |
| 0 ... +150 psig     | +450 psig           | -14.5 psig       |
| 0 ... +300 psig     | +900 psig           | -14.5 psig       |
| 0 ... +500 psig     | +1500 psig          | -14.5 psig       |
| 0 ... +1450 psig    | +3000 psig          | -14.5 psig       |
| 0 ... +3000 psig    | +6000 psig          | -14.5 psig       |
| 0 ... +9000 psig    | +18000 psig         | -14.5 psig       |
| 0 ... +15000 psig   | +22500 psig         | -14.5 psig       |
| -14.5 ... 0 psig    | +45 psig            | -14.5 psig       |
| -14.5 ... +20 psig  | +90 psig            | -14.5 psig       |
| -14.5 ... +150 psig | +450 psig           | -14.5 psig       |
| -14.5 ... +300 psig | +900 psig           | -14.5 psig       |
| -14.5 ... +600 psig | +1200 psig          | -14.5 psig       |
| -3 ... +3 psig      | +15 psig            | -14.5 psig       |
| -7 ... +7 psig      | +45 psig            | -14.5 psig       |
| Absolute pressure   |                     |                  |
| 0 ... 15 psi        | 45 psi              | 0 psi            |
| 0 ... 30 psi        | 90 psi              | 0 psi            |
| 0 ... 150 psi       | 450 psi             | 0 psi            |
| 0 ... 300 psi       | 600 psi             | 0 psi            |
| 0 ... 500 psi       | 1500 psi            | 0 psi            |

## Input variable - Ceramic/metallic measuring cell

The specifications are only an overview and refer to the measuring cell. Limitations due to the material and version of the process fitting are possible. The specifications on the nameplate apply. <sup>13)</sup>

## Nominal measuring ranges and overload capacity in bar/kPa

| Nominal range                | Overload capability |                  |
|------------------------------|---------------------|------------------|
|                              | Maximum pressure    | Minimum pressure |
| Gauge pressure               |                     |                  |
| 0 ... +0.1 bar/0 ... +10 kPa | +15 bar/+1500 kPa   | -1 bar/-100 kPa  |
| 0 ... +0.4 bar/0 ... +40 kPa | +30 bar/+3000 kPa   | -1 bar/-100 kPa  |

<sup>13)</sup> Data on overload capacity apply for reference temperature.

| Nominal range                     | Overload capability |                  |
|-----------------------------------|---------------------|------------------|
|                                   | Maximum pressure    | Minimum pressure |
| 0 ... +1 bar/0 ... +100 kPa       | +35 bar/+3500 kPa   | -1 bar/-100 kPa  |
| 0 ... +2.5 bar/0 ... +250 kPa     | +50 bar/+5000 kPa   | -1 bar/-100 kPa  |
| 0 ... +5 bar/0 ... +500 kPa       | +50 bar/+5000 kPa   | -1 bar/-100 kPa  |
| 0 ... +10 bar/0 ... +1000 kPa     | +50 bar/+5000 kPa   | -1 bar/-100 kPa  |
| 0 ... +25 bar/0 ... +2500 kPa     | +50 bar/+5000 kPa   | -1 bar/-100 kPa  |
| -1 ... 0 bar/-100 ... 0 kPa       | +35 bar/+3500 kPa   | -1 bar/-100 kPa  |
| -1 ... +1.5 bar/-100 ... +150 kPa | +50 bar/+5000 kPa   | -1 bar/-100 kPa  |
| -1 ... +5 bar/-100 ... +500 kPa   | +50 bar/+6500 kPa   | -1 bar/-100 kPa  |
| -1 ... +10 bar/-100 ... +1000 kPa | +50 bar/+5000 kPa   | -1 bar/-100 kPa  |
| -1 ... +25 bar/-100 ... +2500 kPa | +50 bar/+5000 kPa   | -1 bar/-100 kPa  |
| -0.05 ... +0.05 bar/-5 ... +5 kPa | +10 bar/+1000 kPa   | -1 bar/-100 kPa  |
| -0.2 ... +0.2 bar/-20 ... +20 kPa | +20 bar/+2000 kPa   | -1 bar/-100 kPa  |
| -0.5 ... +0.5 bar/-50 ... +50 kPa | +35 bar/+3500 kPa   | -1 bar/-100 kPa  |
| Absolute pressure                 |                     |                  |
| 0 ... 1 bar/0 ... 100 kPa         | 35 bar/3500 kPa     | 0 bar abs.       |
| 0 ... 2.5 bar/0 ... 250 kPa       | 50 bar/5000 kPa     | 0 bar abs.       |
| 0 ... 10 bar/0 ... 1000 kPa       | 50 bar/5000 kPa     | 0 bar abs.       |
| 0 ... 25 bar/0 ... 2500 kPa       | 50 bar/5000 kPa     | 0 bar abs.       |

### Nominal measuring ranges and overload capacity in psi

| Nominal range       | Overload capability |                  |
|---------------------|---------------------|------------------|
|                     | Maximum pressure    | Minimum pressure |
| Gauge pressure      |                     |                  |
| 0 ... +1.5 psig     | +225 psig           | -14.5 psig       |
| 0 ... +5 psig       | +375 psig           | -14.5 psig       |
| 0 ... +15 psig      | +525 psig           | -14.5 psig       |
| 0 ... +30 psig      | +720 psig           | -14.5 psig       |
| 0 ... +75 psig      | +720 psig           | -14.5 psig       |
| 0 ... +150 psig     | +720 psig           | -14.5 psig       |
| 0 ... +300 psig     | +720 psig           | -14.5 psig       |
| -14.5 ... 0 psig    | +510 psig           | -14.5 psig       |
| -14.5 ... +20 psig  | +720 psig           | -14.5 psig       |
| -14.5 ... +75 psig  | +975 psig           | -14.51 psig      |
| -14.5 ... +150 psig | +725 psig           | -14.5 psig       |
| -14.5 ... +300 psig | +725 psig           | -14.5 psig       |
| -0.7 ... +0.7 psig  | +225 psi            | -14.5 psig       |

| Nominal range     | Overload capability |                  |
|-------------------|---------------------|------------------|
|                   | Maximum pressure    | Minimum pressure |
| -3 ... +3 psig    | +190 psi            | -14.5 psig       |
| -7 ... +7 psig    | +525 psig           | -14.5 psig       |
| Absolute pressure |                     |                  |
| 0 ... 15 psi      | 525 psi             | 0 psi            |
| 0 ... 30 psi      | +720 psig           | 0 psi            |
| 0 ... 150 psi     | +720 psig           | 0 psi            |
| 0 ... 300 psi     | +720 psig           | 0 psi            |

### Adjustment ranges

Specifications refer to the nominal measuring range, pressure values lower than -1 bar cannot be set

Min./Max. adjustment:

- Percentage value -10 ... 110 %
- Pressure value -20 ... 120 %

Zero/Span adjustment:

- Zero -20 ... +95 %
- Span -120 ... +120 %
- Difference between zero and span max. 120 % of the nominal range

Max. permissible Turn Down Unlimited (recommended 20 : 1)

Max. permissible turn down with SIL applications 10 : 1

### Switch-on phase

Start-up time with operating voltage  $U_g$

- $\geq 12$  V DC  $\leq 9$  s
- $< 12$  V DC  $\leq 22$  s

Starting current (for run-up time)  $\leq 3.6$  mA

### Output variable

For details on the operating voltage see chapter "Voltage supply"

|   |   |
|---|---|
| Output signal                             | 4 ... 20 mA/HART  |
| Range of the output signal                | 3.8 ... 20.5 mA/HART (default setting)                          |
| Fulfilled HART specification              | 7.3   |
| Signal resolution                         | 0.3 $\mu$ A   |
| Fault signal, current output (adjustable) | $\leq 3.6$ mA, $\geq 21$ mA, last measured value <sup>14)</sup> |
| Max. output current                       | 21.5 mA   |
| Load                                      | See load resistance under Power supply                          |
| Starting current                          | $\leq 10$ mA for 5 ms after switching on, $\leq 3.6$ mA         |

<sup>14)</sup> Last measured value not possible with SIL.

|   |   |
|---|---|
| Damping (63 % of the input variable), adjustable                        | 0 ... 999 s   |
| HART output values according to HART 7 (default setting) <sup>15)</sup> |   |
| – First HART value (PV)   | Linear percentage value                             |
| – Second HART value (SV)  | Measuring cell temperature (ceramic measuring cell) |
| – Third HART value (TV)   | Pressure  |
| – Fourth HART value (QV)  | Electronics temperature                             |

### Output variable - Additional current output

|   |   |
|---|---|
| For details on the operating voltage see chapter "Voltage supply" |   |
| Output signal   | 4 ... 20 mA (passive)                                   |
| Range of the output signal  | 3.8 ... 20.5 mA (default setting)                       |
| Signal resolution   | 0.3 $\mu$ A   |
| Fault signal, current output (adjustable)                         | Last valid measured value, $\geq 21$ mA, $\leq 3.6$ mA  |
| Max. output current   | 21.5 mA   |
| Starting current  | $\leq 10$ mA for 5 ms after switching on, $\leq 3.6$ mA |
| Load  | Load resistor, see chapter "Voltage supply"             |
| Damping (63 % of the input variable), adjustable                  | 0 ... 999 s   |

### Dynamic behaviour output

Dynamic characteristics depending on medium and temperature

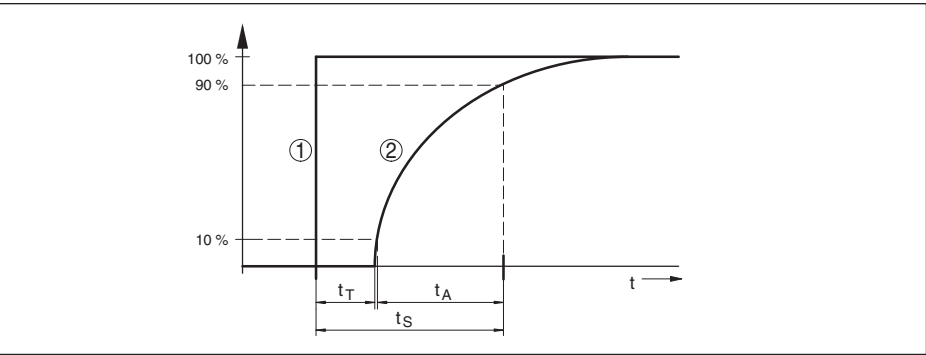


Fig. 43: Behaviour in case of sudden change of the process variable.  $t_T$ : dead time;  $t_A$ : rise time;  $t_S$ : jump response time

- 1 Process variable  
2 Output signal

|                         | VEGABAR 83   | VEGABAR 83, IP68 (25 bar), connection cable > 25 m (82.01 ft) |
|-------------------------|--------------|---|
| Dead time               | $\leq 25$ ms | $\leq 50$ ms  |
| Rise time (10 ... 90 %) | $\leq 55$ ms | $\leq 150$ ms   |

<sup>15)</sup> The output values can be assigned individually.

|   | VEGABAR 83 | VEGABAR 83, IP68 (25 bar), connection cable > 25 m (82.01 ft) |
|---|------------|---|
| Step response time (ti: 0 s, 10 ... 90 %) | ≤ 80 ms    | ≤ 200 ms  |

Damping (63 % of the input variable) 0 ... 999 s, adjustable via menu item "Damping"

### Reference conditions and influencing variables (according to DIN EN 60770-1)

Reference conditions according to DIN EN 61298-1

|   |  |
|---|--|
| – Temperature   | +18 ... +30 °C (+64 ... +86 °F)                        |
| – Relative humidity   | 45 ... 75 %  |
| – Air pressure  | 860 ... 1060 mbar/86 ... 106 kPa (12.5 ... 15.4 psi)   |
| Determination of characteristics  | Limit point adjustment according to IEC 61298-2        |
| Characteristic curve  | Linear   |
| Reference installation position   | upright, diaphragm points downward                     |
| Influence of the installation position  |  |
| – Piezoresistive/strain gauge measuring cell  | depending on the process fitting and the chemical seal |
| – Ceramic/metallic measuring cell   | < 5 mbar/0.5 kPa (0.07 psig)                           |
| Deviation in the current output due to strong, high-frequency electromagnetic fields acc. to EN 61326-1 | < ±150 µA  |

### Deviation (according to IEC 60770-1)

Applies to the **digital** signal output (HART, Profibus PA, Foundation Fieldbus) as well as to the **analogue** current output 4 ... 20 mA and refers to the set span. Turn down (TD) is the ratio "nominal measuring range/set span".

The deviation corresponds to the value  $F_{kl}$  in chapter "Calculation of the total deviation". The value results out of the accuracy class and the respective turn down.

| Accuracy class <sup>16)</sup> | Non-linearity, hysteresis and repeatability with TD 1 : 1 up to 5 : 1 | Non-linearity, hysteresis and repeatability with 5 : 1 |
|-------------------------------|---|--|
| 0.075 %                       | < 0.075 %   | < 0.015 % x TD   |
| 0.1 %                         | < 0.1 %   | < 0.02 % x TD  |
| 0.2 %                         | < 0.2 %   | < 0.04 % x TD  |

### Influence of the medium or ambient temperature

#### Thermal change zero signal and output span through product temperature

Applies to the **digital** signal output (HART, Profibus PA, Foundation Fieldbus) as well as to the **analogue** current output 4 ... 20 mA and refers to the set span. Turn down (TD) is the ratio "nominal measuring range/set span".

The thermal change of the zero signal and output span corresponds to the value  $F_T$  in chapter "Calculation of the total deviation (according to DIN 16086)".

#### Piezoresistive/strain gauge measuring cell

<sup>16)</sup> Different availability depending on measuring range and process fitting

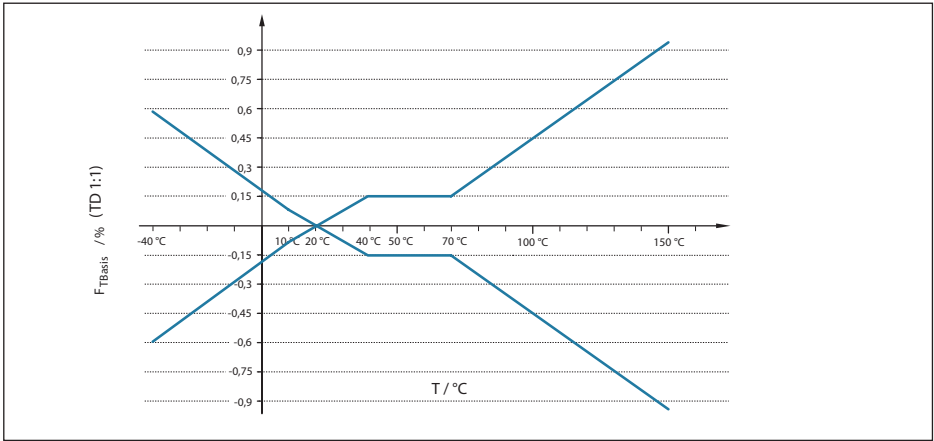


Fig. 44: Basic temperature error  $F_{TBasis}$  at TD 1 : 1

The basic temperature error in % from the above graphic can increase due to the additional factors such as accuracy class (factor FMZ) and Turn Down (factor FTD). The additional factors are listed in the following tables.

Additional factor through accuracy class

|                |                |       |
|----------------|----------------|-------|
| Accuracy class | 0.075 %, 0.1 % | 0.2 % |
| Factor FMZ     | 1              | 3     |

Additional factor through Turn Down

The additional factor FTD through Turn down is calculated according to the following formula:

$F_{TD} = 0.5 \times TD + 0.5$

In the table, example values for typical Turn downs are listed.

|            |          |            |          |           |           |
|------------|----------|------------|----------|-----------|-----------|
| Turn Down  | TD 1 : 1 | TD 2.5 : 1 | TD 5 : 1 | TD 10 : 1 | TD 20 : 1 |
| Factor FTD | 1        | 1.75       | 3        | 5.5       | 10.5      |

# Ceramic/Metal measuring cell - Standard

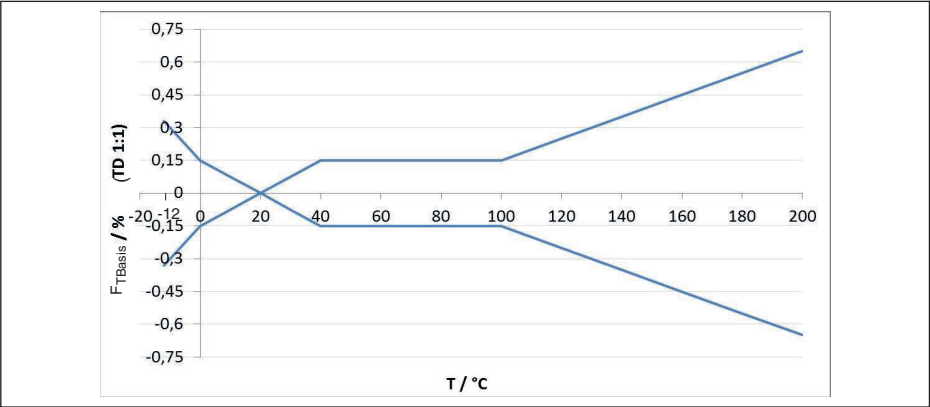


Fig. 45: Basic temperature error  $F_{TBasis}$  at TD 1:1

The basic temperature error in % from the above graphic can increase due to the additional factors, depending on the measuring cell version (factor FMZ) and the Turn Down (factor FTD). The additional factors are listed in the following tables.

## Additional factor through measuring cell version

| Measuring cell version | Measuring cell - Standard |       |
|------------------------|---------------------------|-------|
|                        | 0.075 %, 0.1 %            | 0.2 % |
| Factor FMZ             | 1                         | 3     |

## Additional factor through Turn Down

The additional factor FTD through Turn down is calculated according to the following formula:

$$F_{TD} = 0.5 \times TD + 0.5$$

In the table, example values for typical Turn downs are listed.

| Turn Down  | TD 1 : 1 | TD 2.5 : 1 | TD 5 : 1 | TD 10 : 1 | TD 20 : 1 |
|------------|----------|------------|----------|-----------|-----------|
| Factor FTD | 1        | 1.75       | 3        | 5.5       | 10.5      |

## Thermal change current output through ambient temperature

Applies also to the **analogue 4 ... 20 mA** current output and refers to the set span.

Thermal change, current output < 0.05 %/10 K, max. < 0.15 %, each with -40 ... +80 °C (-40 ... +176 °F)

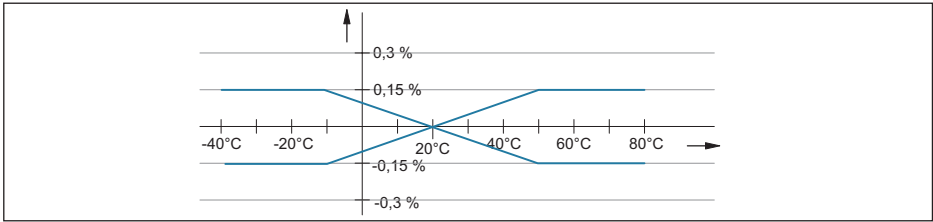


Fig. 46: Thermal change, current output

### Long-term stability (according to DIN 16086)

Applies to the respective **digital** signal output (e.g. HART, Profibus PA) as well as to **analogue** current output 4 ... 20 mA under reference conditions. Specifications refer to the set span. Turn down (TD) is the ratio nominal measuring range/set span. <sup>17)</sup>

### Long-term stability - Ceramic/metallic measuring cell

| Time period |               |
|-------------|---------------|
| One year    | < 0.05 % x TD |
| Five years  | < 0.1 % x TD  |
| Ten years   | < 0.2 % x TD  |

### Long-term stability - Piezoresistive/Strain gauge measuring cell

| Version   |                    |
|---|--------------------|
| Measuring ranges > 1 bar  | < 0.1 % x TD/year  |
| Measuring ranges > 1 bar, isolating liquid, synthetic oil, diaphragm Elgiloy (2.4711) | < 0.15 % x TD/year |
| Measuring range 1 bar   | < 0.15 % x TD/year |
| Measuring range 0.4 bar   | < 0.35 % x TD/year |

### Ambient conditions

| Version  | Ambient temperature              | Storage and transport temperature |
|--|----------------------------------|-----------------------------------|
| Standard version                                 | -40 ... +80 °C (-40 ... +176 °F) | -60 ... +80 °C (-76 ... +176 °F)  |
| Version IP66/IP68 (1 bar)                        | -20 ... +80 °C (-4 ... +176 °F)  | -20 ... +80 °C (-4 ... +176 °F)   |
| Version IP68 (25 bar), with connection cable PUR | -20 ... +80 °C (-4 ... +176 °F)  | -20 ... +80 °C (-4 ... +176 °F)   |
| Version IP68 (25 bar), connection cable PE       | -20 ... +60 °C (-4 ... +140 °F)  | -20 ... +60 °C (-4 ... +140 °F)   |

### Process conditions - Piezoresistive/Strain gauge measuring cell

#### Process temperature

<sup>17)</sup> With ceramic/metallic measuring cell with gold-coated diaphragm, the values must be multiplied with factor 3.



| Seal   | Sensor version                              |                                     |                                    |                                     |                                    |
|--|---|-------------------------------------|------------------------------------|-------------------------------------|------------------------------------|
|  | Standard                                    | Extended temperature range          | Hygienic fittings                  |                                     | Version for oxygen applications    |
|  | $p_{abs} \geq 1 \text{ mbar}$               |                                     | $p_{abs} \geq 1 \text{ mbar}$      | $p_{abs} \geq 10 \text{ mbar}$      | $p_{abs} \geq 10 \text{ mbar}$     |
| Without consideration of the seal <sup>18)</sup> | -20/-40 ... +105 °C<br>(-4/-40 ... +221 °F) | –                                   | –                                  | –                                   | -20 ... +60 °C<br>(-4 ... +140 °F) |
| FKM (VP2/A)                                      | -20 ... +105 °C<br>(-4 ... +221 °F)         | -20 ... +150 °C<br>(-4 ... +302 °F) | -20 ... +85 °C<br>(-4 ... +185 °F) | -20 ... +150 °C<br>(-4 ... +302 °F) | -20 ... +60 °C<br>(-4 ... +140 °F) |
| EPDM (A+P 70.10-02)                              |   |                                     |                                    |                                     |                                    |
| FFKM (Perlast G74S)                              | -15 ... +105 °C<br>(+5 ... +221 °F)         | -15 ... +150 °C<br>(+5 ... +302 °F) | -15 ... +85 °C<br>(+5 ... +185 °F) | -15 ... +150 °C<br>(+5 ... +302 °F) | -15 ... +60 °C<br>(+5 ... +140 °F) |
| FEPM (Fluoraz SD890)                             | -5 ... +105 °C<br>(+23 ... +221 °F)         | –                                   | –                                  | –                                   | -5 ... +60 °C<br>(+23 ... +140 °F) |

## Temperature derating

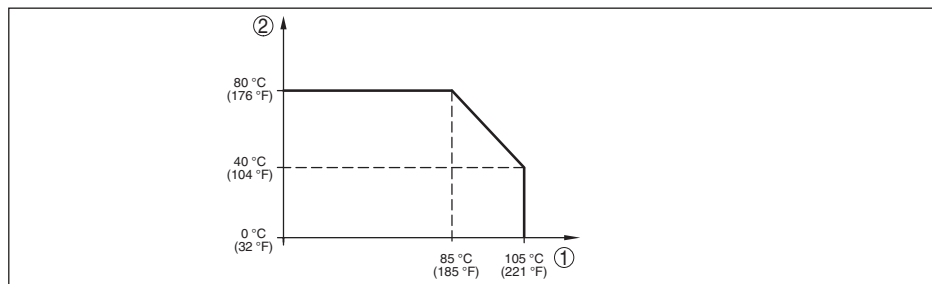


Fig. 47: Temperature derating VEGABAR 83, version up to +105 °C (+221 °F)

- 1 Process temperature
- 2 Ambient temperature

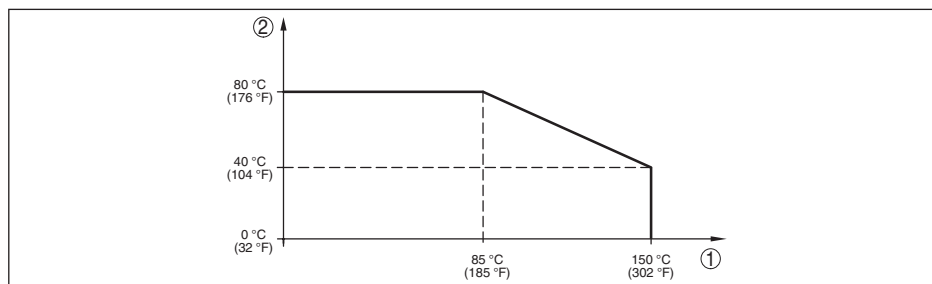


Fig. 48: Temperature derating VEGABAR 83, version up to +150 °C (+302 °F)

- 1 Process temperature
- 2 Ambient temperature

**SIP process temperature** (SIP = Sterilization in place)

<sup>18)</sup> Process fittings acc. to DIN 3852-A, EN 837

Vapour stratification for 2 h <sup>19)</sup> +150 °C (+302 °F)

Process pressure

Permissible process pressure see specification " *Process pressure*" on the type label

Mechanical stress

| Version  | Without cooling zone       |  | With cooling zone          |  |
|--|----------------------------|--|----------------------------|--|
|  | All housing versions       | Double chamber stainless steel housing | All housing versions       | Double chamber stainless steel housing |
| Vibration resistance 1 to 4 g at 5 ... 200 Hz according to EN 60068-2-6 (vibration with resonance) | 4 g (GL characteristics 2) | 0.7 g (GL characteristics 1)           | 4 g (GL characteristics 2) | 0.7 g (GL characteristics 1)           |
| Shock resistance 2.3 ms according to EN 60068-2-27 (mechanical shock)                              | 50 g                       |  | 50 g                       | 20 g                                   |

Process conditions - Ceramic/metallic measuring cell

Process temperature

| Version                    | Temperature range                 |                                   |                                   |
|----------------------------|-----------------------------------|-----------------------------------|-----------------------------------|
|                            | p <sub>abs</sub> ≥ 50 mbar        | p <sub>abs</sub> ≥ 10 mbar        | p <sub>abs</sub> ≥ 1 mbar         |
| Standard                   | -12 ... +150 °C (+10 ... +284 °F) |                                   | -12 ... +120 °C (+10 ... +248 °F) |
| Extended temperature range | -12 ... +180 °C (+10 ... +356 °F) | -12 ... +160 °C (+10 ... +320 °F) |                                   |
|                            | -12 ... +200 °C (+10 ... +392 °F) |                                   |                                   |

Temperature derating

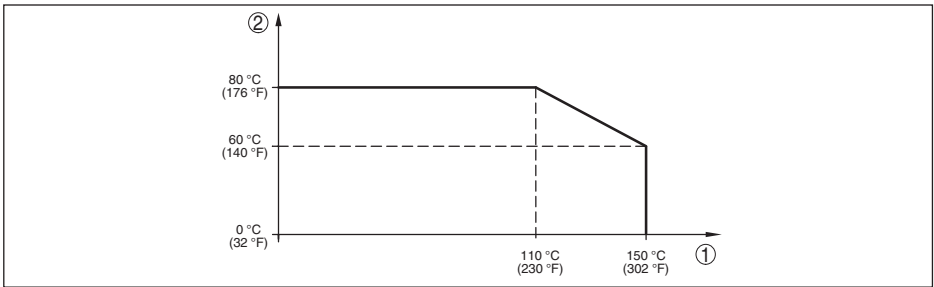


Fig. 49: Temperature derating VEGABAR 83, version up to +150 °C (+302 °F)

- 1 Process temperature
- 2 Ambient temperature

<sup>19)</sup> Instrument configuration suitable for vapour

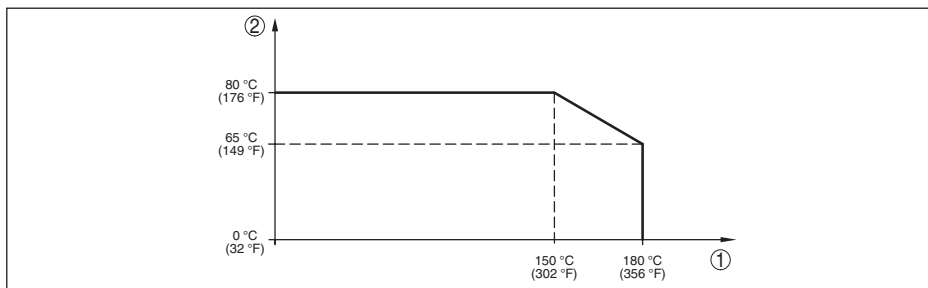


Fig. 50: Temperature derating VEGABAR 83, version up to +180 °C (+356 °F)

- 1 Process temperature  
2 Ambient temperature

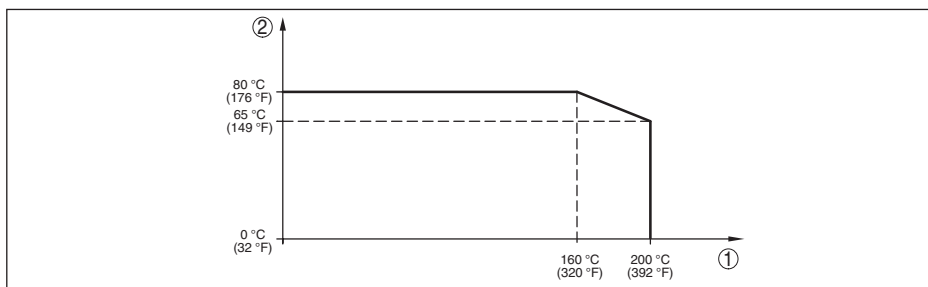


Fig. 51: Temperature derating VEGABAR 83, version up to +200 °C (+392 °F)

- 1 Process temperature  
2 Ambient temperature

### Process pressure

Permissible process pressure

see specification "Process pressure" on the type label

### Mechanical stress<sup>20)</sup>

Vibration resistance 1 to 4 g at  
5 ... 200 Hz according to EN 60068-2-6  
(vibration with resonance)

4 g

Shock resistance

50 g, 2.3 ms according to EN 60068-2-27 (mechanical shock)<sup>21)</sup>

### Electromechanical data - version IP66/IP67 and IP66/IP68 (0.2 bar)<sup>22)</sup>

Options of the cable entry

- |               |  |
|---------------|--|
| – Cable entry | M20 x 1.5; ½ NPT                           |
| – Cable gland | M20 x 1.5, ½ NPT (cable ø see below table) |
| – Blind plug  | M20 x 1.5; ½ NPT                           |
| – Closing cap | ½ NPT                                      |

<sup>20)</sup> Depending on the instrument version.

<sup>21)</sup> 2 g with housing version stainless steel double chamber

<sup>22)</sup> IP66/IP68 (0.2 bar), only with absolute pressure.

| Material cable gland/Seal insert | Cable diameter |             |             |              |
|----------------------------------|----------------|-------------|-------------|--------------|
|                                  | 5 ... 9 mm     | 6 ... 12 mm | 7 ... 12 mm | 10 ... 14 mm |
| PA/NBR                           | ●              | ●           | –           | ●            |
| Brass, nickel-plated/NBR         | ●              | ●           | –           | –            |
| Stainless steel/NBR              | –              | –           | ●           | –            |

Wire cross-section (spring-loaded terminals)

- Massive wire, stranded wire 0.2 ... 2.5 mm<sup>2</sup> (AWG 24 ... 14)
- Stranded wire with end sleeve 0.2 ... 1.5 mm<sup>2</sup> (AWG 24 ... 16)

### Electromechanical data - version IP66/IP68 (1 bar)

Connection cable, mechanical data

- Configuration Wires, strain relief, breather capillaries, screen braiding, metal foil, mantle
- Standard length 5 m (16.4 ft)
- Min. bending radius (at 25 °C/77 °F) 25 mm (0.984 in)
- Diameter approx. 8 mm (0.315 in)
- Colour - version PE Black
- Colour - version PUR Blue

Connection cable, electrical data

- Wire cross-section 0.5 mm<sup>2</sup> (AWG 20)
- Wire resistance R 0.037 Ω/m (0.012 Ω/ft)

### Electromechanical data - version IP68 (25 bar)

Connection cable transmitter - external housing, mechanical data

- Configuration Wires, strain relief, breather capillaries, screen braiding, metal foil, mantle <sup>23)</sup>
- Standard length 5 m (16.40 ft)
- Max. length 180 m (590.5 ft)
- Min. bending radius at 25 °C/77 °F 25 mm (0.985 in)
- Diameter approx. 8 mm (0.315 in)
- Material PE, PUR
- Colour Black, blue

Connection cable transmitter - external housing, electrical data

- Wire cross-section 0.5 mm<sup>2</sup> (AWG 20)
- Wire resistance 0.037 Ω/m (0.012 Ω/ft)

### Interface to the external display and adjustment unit

|                   |                                |
|-------------------|--------------------------------|
| Data transmission | Digital (I <sup>2</sup> C-Bus) |
| Connection cable  | Four-wire                      |

<sup>23)</sup> Breather capillaries not with Ex-d version.

| Sensor version                           | Configuration, connection cable |          |
|--|---------------------------------|----------|
|  | Max. cable length               | Shielded |
| 4 ... 20 mA/HART<br>4 ... 20 mA/HART SIL | 50 m                            | ●        |
| Profibus PA, Foundation Fieldbus         | 25 m                            | ●        |

### Interface to the Secondary sensor

|                                 |                                |
|---------------------------------|--------------------------------|
| Data transmission               | Digital (I <sup>2</sup> C-Bus) |
| Configuration, connection cable | 4-wire, shielded               |
| Max. cable length               | 25 m                           |

### Integrated clock

|                            |                |
|----------------------------|----------------|
| Date format                | Day.Month.Year |
| Time format                | 12 h/24 h      |
| Time zone, factory setting | CET            |
| Max. rate deviation        | 10.5 min/year  |

### Additional output parameter - Electronics temperature

|  |                                       |
|--|---------------------------------------|
| Range                                  | -40 ... +85 °C (-40 ... +185 °F)      |
| Resolution                             | < 0.1 K                               |
| Deviation                              | ± 3 K                                 |
| Availability of the temperature values |                                       |
| – Indication                           | Via the display and adjustment module |
| – Output                               | Via the respective output signal      |

### Voltage supply

|  |   |
|--|---|
| Operating voltage $U_B$                                      | 9.6 ... 35 V DC   |
| Operating voltage $U_B$ with lighting switched on            | 16 ... 35 V DC  |
| Reverse voltage protection                                   | Integrated  |
| Permissible residual ripple                                  |   |
| – for $U_N$ 12 V DC ( $9.6 \text{ V} < U_B < 14 \text{ V}$ ) | $\leq 0.7 V_{\text{eff}}$ (16 ... 400 Hz)                     |
| – for $U_N$ 24 V DC ( $18 \text{ V} < U_B < 35 \text{ V}$ )  | $\leq 1.0 V_{\text{eff}}$ (16 ... 400 Hz)                     |
| Load resistor  |   |
| – Calculation  | $(U_B - U_{\text{min}})/0.022 \text{ A}$                      |
| – Example - with $U_B = 24 \text{ V DC}$                     | $(24 \text{ V} - 9.6 \text{ V})/0.022 \text{ A} = 655 \Omega$ |

### Potential connections and electrical separating measures in the instrument

|                                  |  |
|----------------------------------|--|
| Electronics                      | Not non-floating                                     |
| Reference voltage <sup>24)</sup> | 500 V AC   |
| Conductive connection            | Between ground terminal and metallic process fitting |

<sup>24)</sup> Galvanic separation between electronics and metal housing parts

### Electrical protective measures <sup>25)</sup>

| Housing material                    | Version                                    | Protection acc. to IEC 60529                     | Protection acc. to NEMA |
|-------------------------------------|--|--|-------------------------|
| Plastic                             | Single chamber                             | IP66/IP67  | Type 4X                 |
|                                     | Double chamber                             |  |                         |
| Aluminium                           | Single chamber                             | IP66/IP67<br>IP66/IP68 (0.2 bar)<br>IP68 (1 bar) | Type 4X<br>Type 6P<br>- |
|                                     | Double chamber                             | IP66/IP67<br>IP66/IP68 (0.2 bar)                 | Type 4X<br>Type 6P      |
| Stainless steel (electro-polished)  | Single chamber                             | IP66/IP67<br>IP69K                               | Type 4X                 |
| Stainless steel (precision casting) | Single chamber                             | IP66/IP67<br>IP66/IP68 (0.2 bar)<br>IP68 (1 bar) | Type 4X<br>Type 6P<br>- |
|                                     | Double chamber                             | IP66/IP67<br>IP66/IP68 (0.2 bar)                 | Type 4X<br>Type 6P      |
| Stainless steel                     | Transmitter, version with external housing | IP68 (25 bar)                                    | -                       |

Connection of the feeding power supply unit      Networks of overvoltage category III

Altitude above sea level

- by default up to 2000 m (6562 ft)
- with connected overvoltage protection up to 5000 m (16404 ft)

Pollution degree <sup>26)</sup> 2

Protection rating (IEC/EN 61010-1) II

## 12.2 Calculation of the total deviation

The total deviation of a pressure transmitter indicates the maximum measurement error to be expected in practice. It is also called maximum practical deviation or operational error.

According to DIN 16086, the total deviation  $F_{\text{total}}$  is the sum of the basic deviation  $F_{\text{perf}}$  and the long-term stability  $F_{\text{stab}}$ :

$$F_{\text{total}} = F_{\text{perf}} + F_{\text{stab}}$$

The basic deviation  $F_{\text{perf}}$  in turn consists of the thermal change of the zero signal and the output span  $F_T$  (temperature error) as well as the deviation  $F_{\kappa_1}$ :

$$F_{\text{perf}} = \sqrt{((F_T)^2 + (F_{kl})^2)}$$

The thermal change of zero signal and output span  $F_T$  is specified in chapter " *Technical data*". The basic temperature error  $F_T$  is shown in a graphic. Depending on the measuring cell version and Turn down, this value must be multiplied with the additional factors FMZ and FTD:

F<sub>T</sub> x FMZ x FTD

<sup>25)</sup> Protection rating IP66/IP68 (0.2 bar) only in conjunction with absolute pressure.

<sup>26)</sup> When used with fulfilled housing protection.

Also these values are specified in chapter " *Technical data*".

This applies initially to the digital signal output through HART, Profibus PA, Foundation Fieldbus or Modbus.

With 4 ... 20 mA output, the thermal change of the current output  $F_a$  must be added:

$$F_{\text{perf}} = \sqrt{((F_T)^2 + (F_{Kl})^2 + (F_a)^2)}$$

To provide a better overview, the formula symbols are listed together below:

- $F_{\text{total}}$ : Total deviation
- $F_{\text{perf}}$ : Basic deviation
- $F_{\text{stab}}$ : Long-term stability
- $F_T$ : Thermal change of zero signal and output span (temperature error)
- $F_{Kl}$ : Deviation
- $F_a$ : Thermal change of the current output
- FMZ: Additional factor measuring cell version
- FTD: Additional factor Turn down

## 12.3 Calculation of the total deviation - Practical example

### Data

Pressure measurement in the pipeline **4 bar** (400 KPa), product temperature 40 °C

VEGABAR 83 with measuring range **10 bar**, deviation < 0.1 %, process fitting G1 (piezoresistive measuring cell)

The required values for the temperature error  $F_T$ , deviation  $F_{Kl}$  and long-term stability  $F_{\text{stab}}$  are available in the technical data.

### 1. Calculation of the Turn down

TD = 10 bar/4 bar, TD = **2.5 : 1**

### 2. Determination temperature error $F_T$

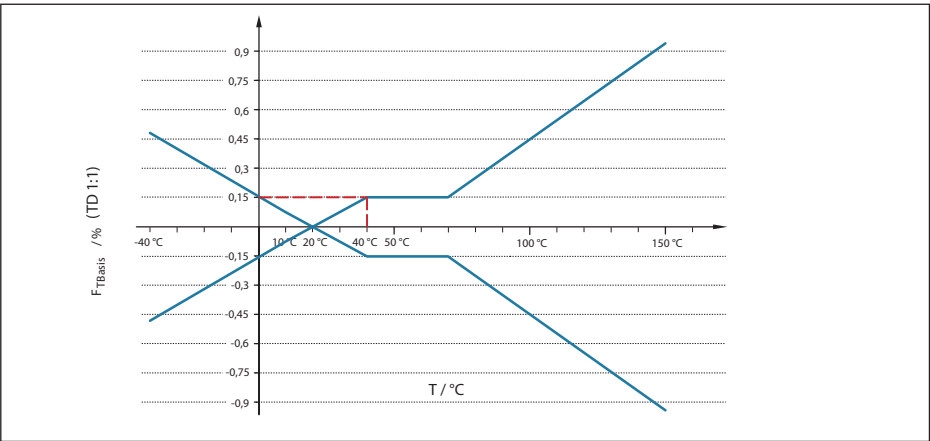


Fig. 52: Determination of the basic temperature error for the above example:  $F_{TBasis} = 0.15 \%$

|                |                |       |
|----------------|----------------|-------|
| Accuracy class | 0.075 %, 0.1 % | 0.2 % |
| Factor FMZ     | <b>1</b>       | 3     |

Tab. 32: Determination of the additional factor measuring cell for above example:  $F_{Mz} = 1$ 

| Turn Down  | TD 1 : 1 | TD 2.5 : 1 | TD 5 : 1 | TD 10 : 1 | TD 20 : 1 |
|------------|----------|------------|----------|-----------|-----------|
| Factor FTD | 1        | 1.75       | 3        | 5.5       | 10.5      |

Tab. 33: Determination of the additional factor "turn down" for the above example:  $F_{TD} = 1.75$ 

$$F_T = F_{TBasis} \times F_{Mz} \times F_{TD}$$

$$F_T = 0.15 \% \times 1 \times 1.75$$

$$F_T = 0.26 \%$$

### 3. Determination of deviation and long-term stability

| Accuracy class | Non-linearity, hysteresis and non-repeatability |                |
|----------------|---|----------------|
|                | TD ≤ 5 : 1                                      | TD > 5 : 1     |
| 0.075 %        | < 0.075 %                                       | < 0.015 % x TD |
| 0.1 %          | < 0.1 %   | < 0.02 % x TD  |
| 0.2 %          | < 0.2 %   | < 0.04 % x TD  |

Tab. 34: Determination of the deviation from table:  $F_{Kl} = 0.1 \%$ 

| Version   |                    |
|---|--------------------|
| Measuring ranges > 1 bar  | < 0.1 % x TD/year  |
| Measuring ranges > 1 bar, isolating liquid, synthetic oil, diaphragm Elgiloy (2.4711) | < 0.15 % x TD/year |
| Measuring range 1 bar   | < 0.15 % x TD/year |
| Measuring range 0.4 bar   | < 0.35 % x TD/year |

Tab. 35: Determination of the long-term stability from the table, consideration for one year:  $F_{stab} = 0.1 \% \times TD/year$ 

### 4. Calculation of the total deviation - HART signal

#### - 1. step: Basic deviation $F_{perf}$

$$F_{perf} = \sqrt{(F_T)^2 + (F_{Kl})^2}$$

$$F_T = 0.26 \%$$

$$F_{Kl} = 0.1 \%$$

$$F_{perf} = \sqrt{(0.26 \%)^2 + (0.1 \%)^2}$$

$$F_{perf} = 0.28 \%$$

#### - 2. step: Total deviation $F_{total}$

$$F_{total} = F_{perf} + F_{stab}$$

$$F_{perf} = 0.28 \% \text{ (result of step 1)}$$

$$F_{stab} = (0.1 \% \times TD)$$

$$F_{stab} = (0.1 \% \times 2.5)$$

$$F_{stab} = 0.25 \%$$

$$F_{total} = 0.28 \% + 0.25 \% = 0.53 \%$$

### 5. Calculation of the total deviation - 4 ... 20 mA signal

#### - 1. step: Basic deviation $F_{perf}$



$$F_{\text{perf}} = \sqrt{((F_T)^2 + (F_{Kl})^2 + (F_a)^2)}$$

$$F_T = 0.26 \%$$

$$F_{Kl} = 0.1 \%$$

$$F_a = 0.15 \%$$

$$F_{\text{perf}} = \sqrt{(0.26 \%)^2 + (0.1 \%)^2 + (0.15 \%)^2}$$

$$F_{\text{perf}} = 0.32 \%$$

## - 2. step: Total deviation $F_{\text{total}}$

$$F_{\text{total}} = F_{\text{perf}} + F_{\text{stab}}$$

$$F_{\text{stab}} = (0.05 \% \times \text{TD})$$

$$F_{\text{stab}} = (0.1 \% \times 2.5)$$

$$F_{\text{stab}} = 0.25 \%$$

$$F_{\text{total}} = 0.32 \% + 0.25 \% = 0.57 \%$$

The total deviation of the measurement is hence 0.57 %.

Deviation in bar: 0.57 % of 4 bar = 0.23 mbar

The example shows that the measurement error in practice can be considerably higher than the basic deviation. Reasons are temperature influence and Turn down.

## 12.4 Dimensions

The following dimensional drawings represent only an extract of the possible versions. Detailed dimensional drawings can be downloaded at [www.vega.com](http://www.vega.com) under "Downloads" and "Drawings".

### Plastic housing

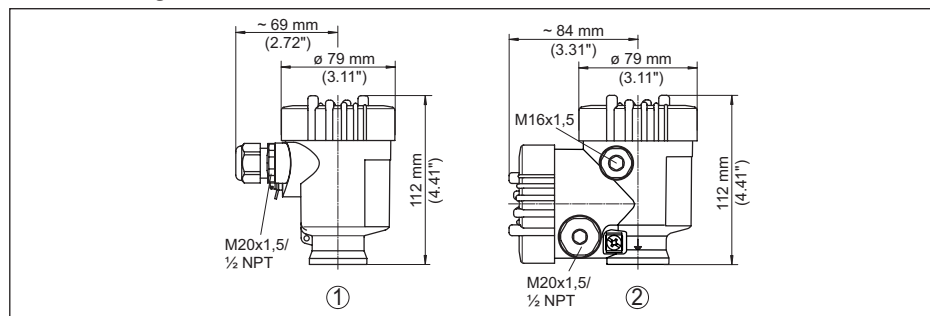


Fig. 53: Housing versions in protection IP66/IP67 (with integrated display and adjustment module the housing is 9 mm/0.35 in higher)

- 1 Plastic single chamber
- 2 Plastic double chamber

## Aluminium housing

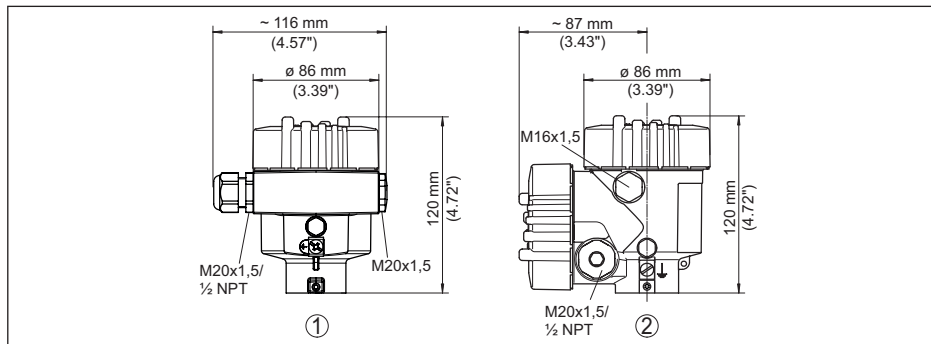


Fig. 54: Housing versions with protection rating IP66/IP68 (0.2 bar), (with integrated display and adjustment module the housing is 18 mm/0.71 in higher)

- 1 Aluminium - single chamber
- 2 Aluminium - double chamber

## Aluminium housing with protection rating IP66/IP68 (1 bar)

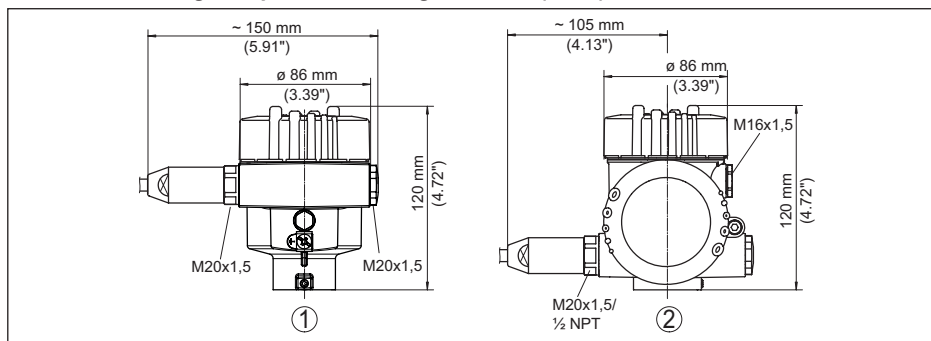


Fig. 55: Housing version with protection rating IP66/IP68 (1 bar), (with integrated display and adjustment module the housing is 18 mm/0.71 in higher)

- 1 Aluminium - single chamber
- 2 Aluminium - double chamber

## Stainless steel housing

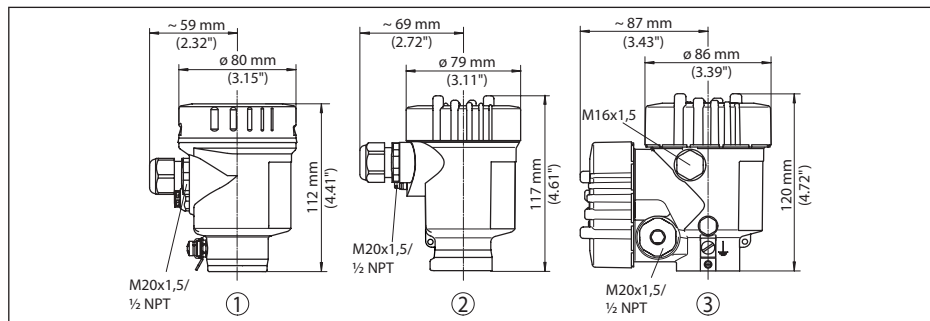


Fig. 56: Housing versions in protection rating IP66/IP68 (0.2 bar), (with integrated display and adjustment module the housing is 9 mm/0.35 in or 18 mm/0.71 in higher)

- 1 Stainless steel single chamber (electropolished)
- 2 Stainless steel single chamber (precision casting)
- 2 Stainless steel double chamber housing (precision casting)

## Stainless steel housing with protection rating IP66/IP68 (1 bar)

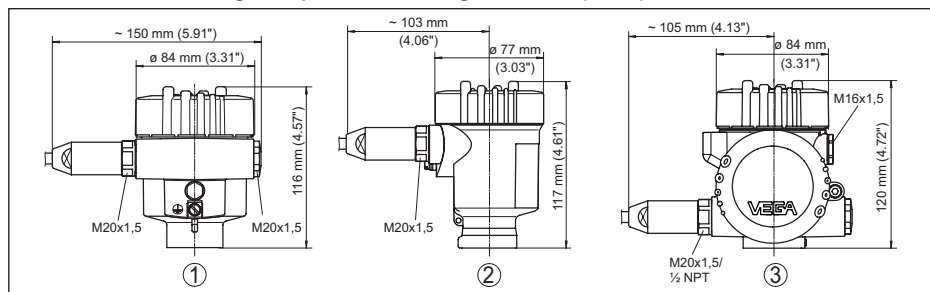


Fig. 57: Housing versions in protection rating IP66/IP68 (1 bar), (with integrated display and adjustment module the housing is 9 mm/0.35 in or 18 mm/0.71 in higher)

- 1 Stainless steel single chamber (electropolished)
- 2 Stainless steel single chamber (precision casting)
- 3 Stainless steel double chamber housing (precision casting)

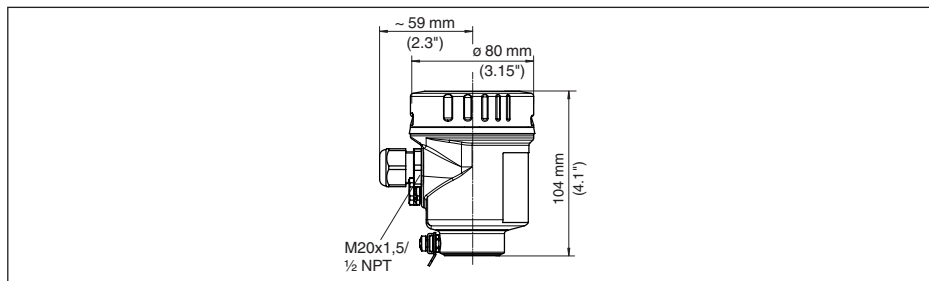
**Stainless steel housing with protection rating IP69K**

Fig. 58: Housing version with protection rating IP69K (with integrated display and adjustment module the housing is 9 mm/0.35 in higher)

- 1 Stainless steel single chamber (electropolished)

# External housing on IP68 version

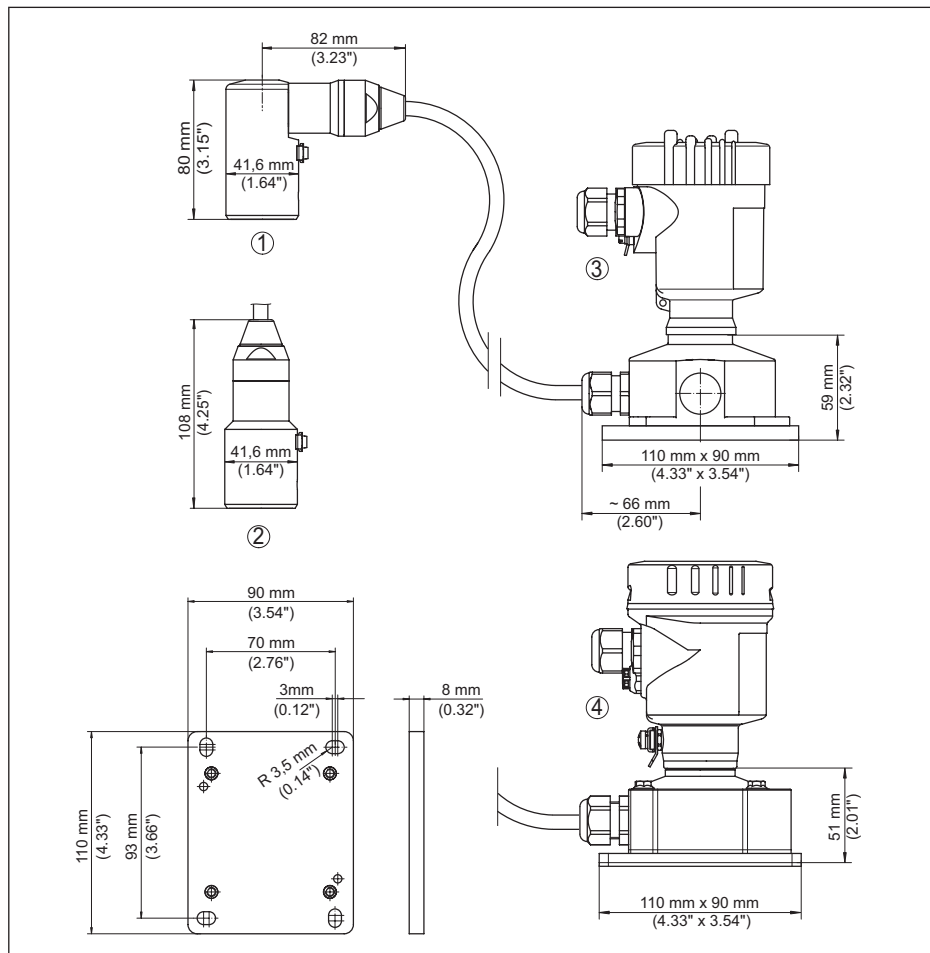


Fig. 59: VEGABAR 83, IP68 version with external housing

- 1 Lateral cable outlet
- 2 Axial cable outlet
- 3 Plastic single chamber
- 4 Stainless steel single chamber
- 5 Seal 2 mm (0.079 in), (only with 3A approval)


**VEGABAR 83, threaded fitting not front-flush**

Fig. 60: VEGABAR 83, threaded fitting not front-flush

DU  $G\frac{1}{2}$ , EN 837; manometer connectionC2  $M20 \times 1.5$  EN 837; manometer connectionDN  $G\frac{1}{2}$ , inside  $G\frac{1}{4}$ , ISO 228-1LF  $\frac{1}{2} \text{ NPT}$ , inside  $\frac{1}{4} \text{ NPT}$ , ASME B1.20.1LY  $\frac{1}{2} \text{ NPT}$  PN 1000

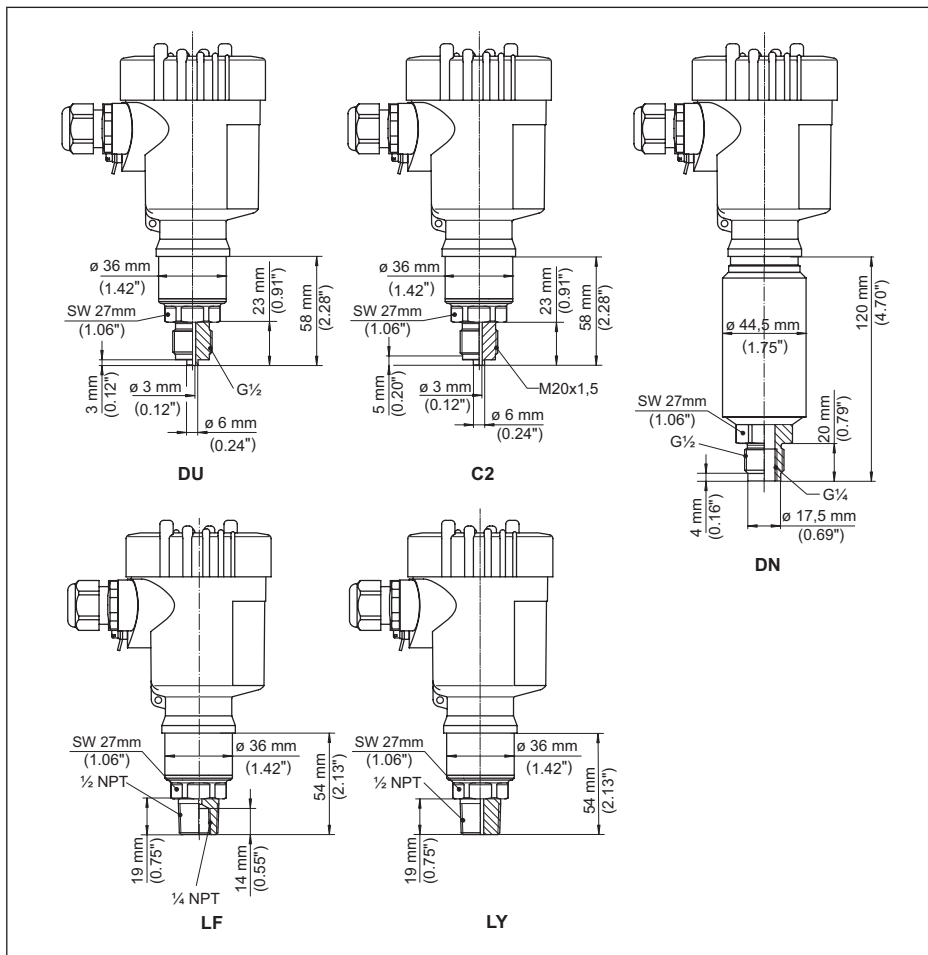For the version with "Second Line of Defense", the measure of length increases by 17 mm (0.67 in).

# VEGABAR 83, threaded fitting front-flush

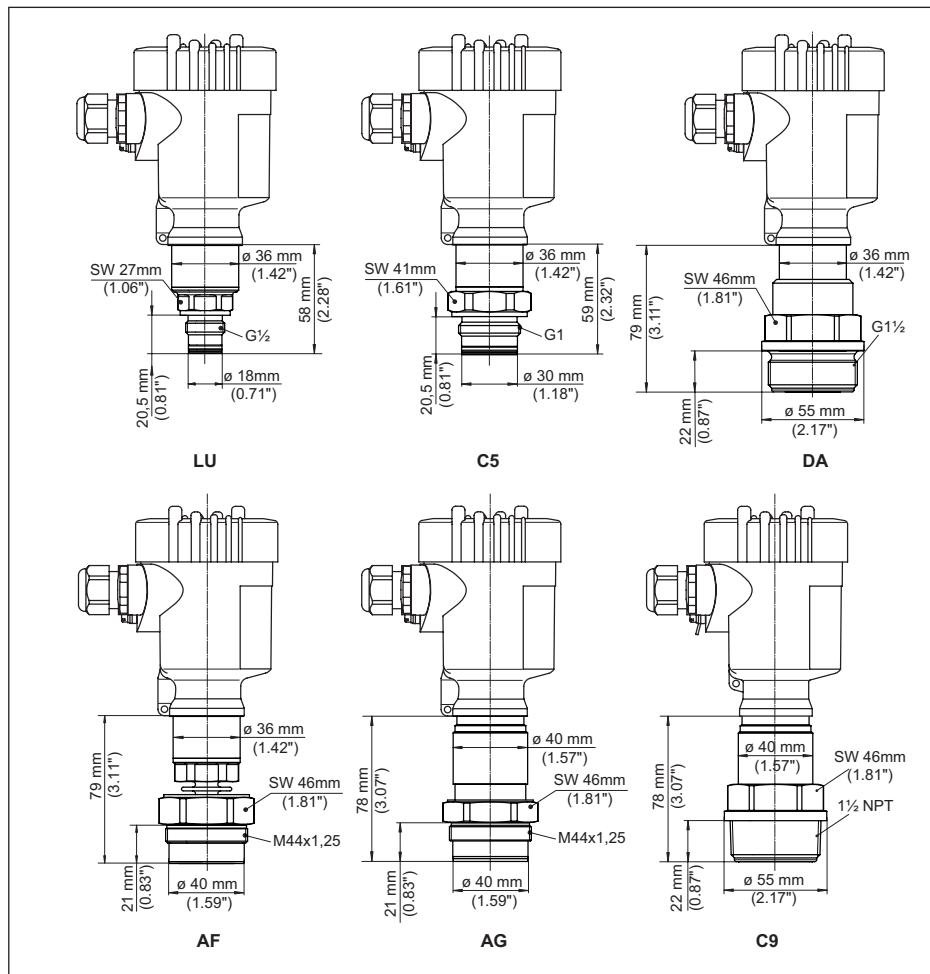


Fig. 61: VEGABAR 83, threaded fitting front-flush

- LU  $G\frac{1}{2}$ , ISO 228-1; front-flush; with O-ring
- C5  $G1$ , ISO 228-1
- DA  $G1\frac{1}{2}$ , DIN 3852-A
- AF M44 x 1.25 DIN 13; pressure screw: Aluminium
- AG M44 x 1.25 DIN 13; pressure screw: 316L
- C9 1½ NPT, ASME B1.20.1

For the version with "Second Line of Defense", the measure of length increases by 17 mm (0.67 in).

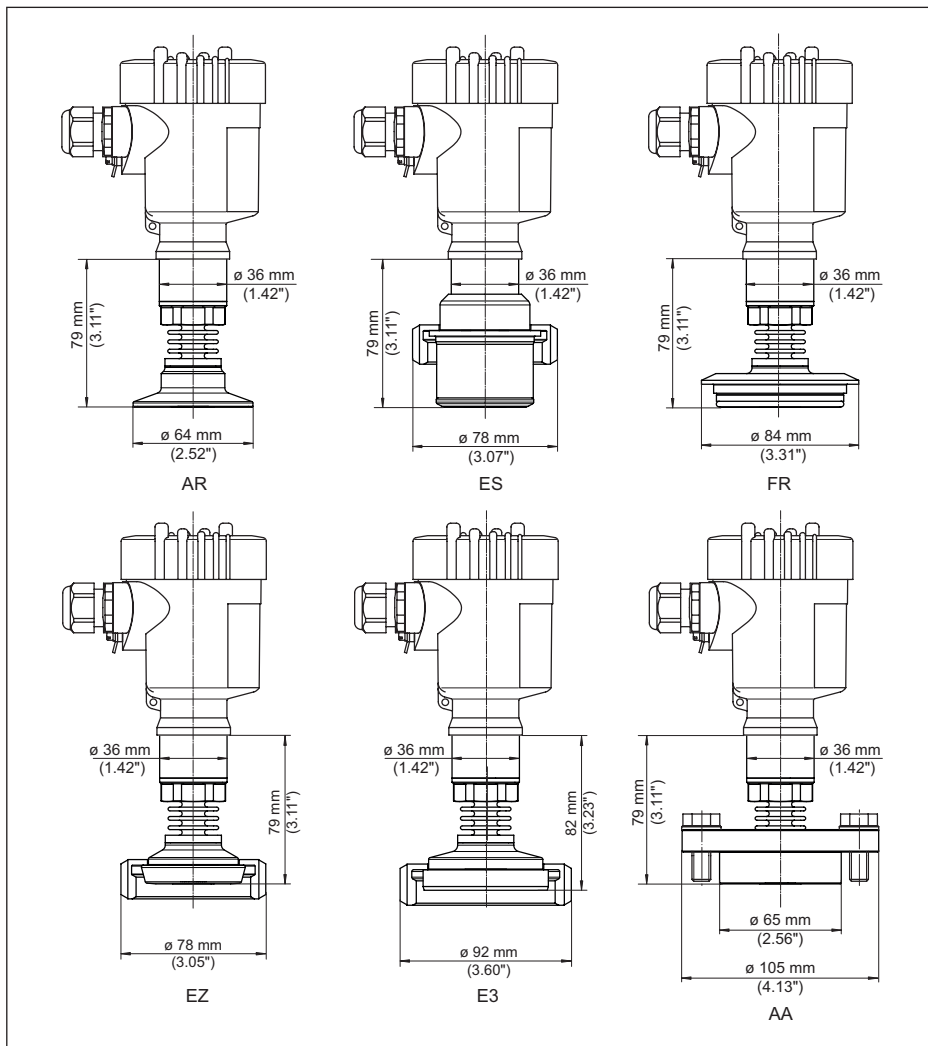
**VEGABAR 83, hygienic fitting 150 °C (piezoresistive/strain gauge measuring cell)**

Fig. 62: VEGABAR 83, hygienic fitting 150 °C (piezoresistive/strain gauge measuring cell)

AR Clamp 2" PN 16 (ø 64 mm) DIN 32676, ISO 2852

ES Hygienic connection with compression nut F40 PN 25

FR Varivent N50-40 PN 25

EZ Collar socket DN 40 PN 40, DIN 11851

E3 Collar socket DN 50 PN 25 Form A, DIN 11864; for tube 53 x 1.5

AA DRD PN 40

For the version with "Second Line of Defense", the measure of length increases by 17 mm (0.67 in).



**VEGABAR 83, hygienic fitting 150 °C (METEC® measuring cell)**

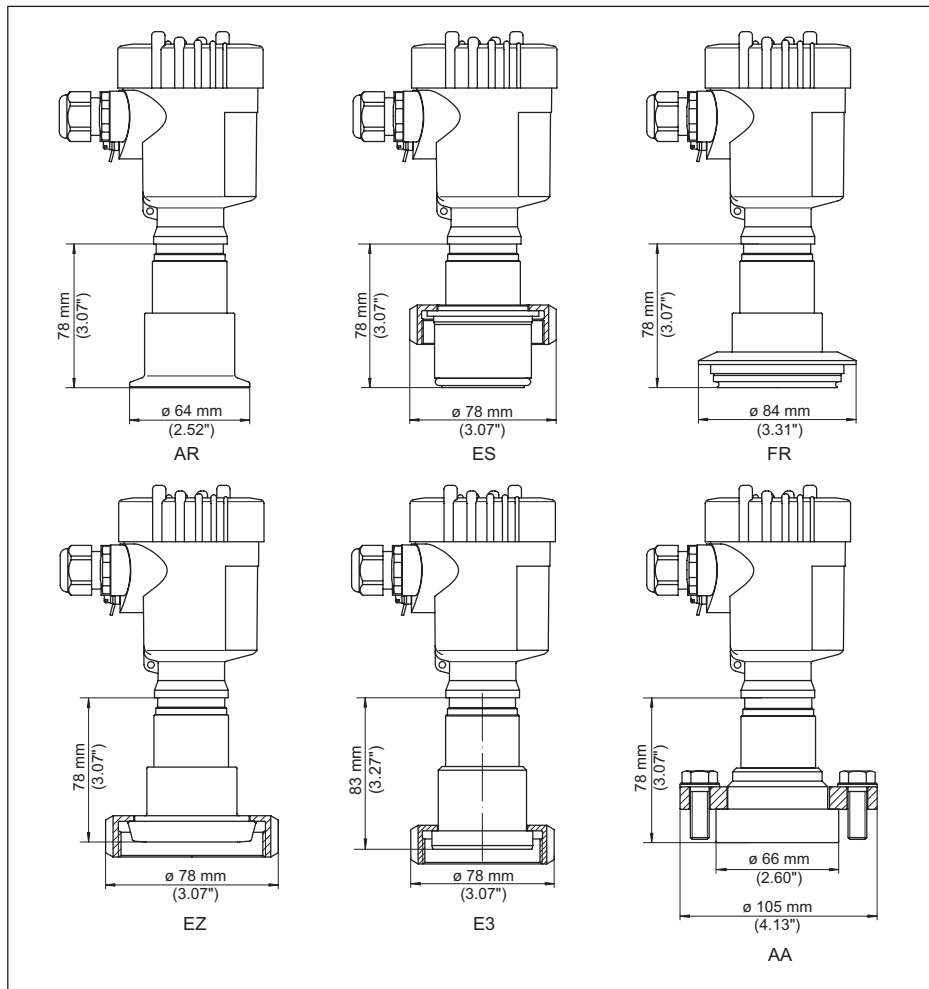


Fig. 63: VEGABAR 83, hygienic fitting 150 °C (METEC® measuring cell)

AR Clamp 2" PN 16 ( $\varnothing 64$  mm) DIN 32676, ISO 2852

ES Hygienic fitting with compression nut F 40 PN 25

FR Varivent N50-40 PN 25

EZ Collar socket DN 40 PN 40, DIN 11851

E3 Collar socket DN 50 PN 25 Form A, DIN 11864; for tube 53 x 1.5

AA DRD PN 40

For the version with "Second Line of Defense", the measure of length increases by 17 mm (0.67 in).

VEGABAR 83, flange connection 150 °C (piezoresistive/strain gauge measuring cell)


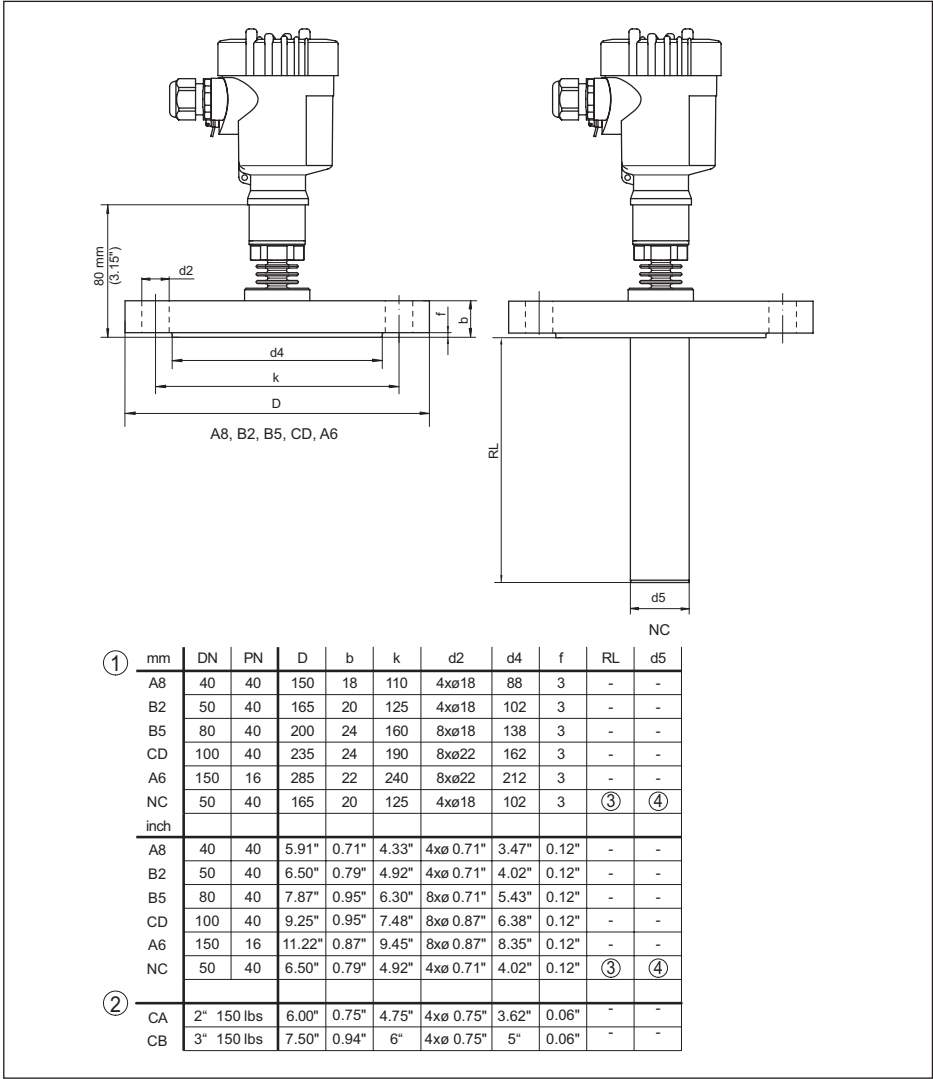


Fig. 64: VEGABAR 83, flange connection 150 °C (piezoresistive/strain gauge measuring cell)

- 1 Flange connection according to DIN 2501
- 2 Flange connection according to ASME B16.5
- 3 Order-specific
- 4 Order-specific

For the version with " Second Line of Defense", the measure of length increases by 17 mm (0.67 in).

**VEGABAR 83, flange connection 180 °C/200 °C (ceramic/metallic measuring cell)**

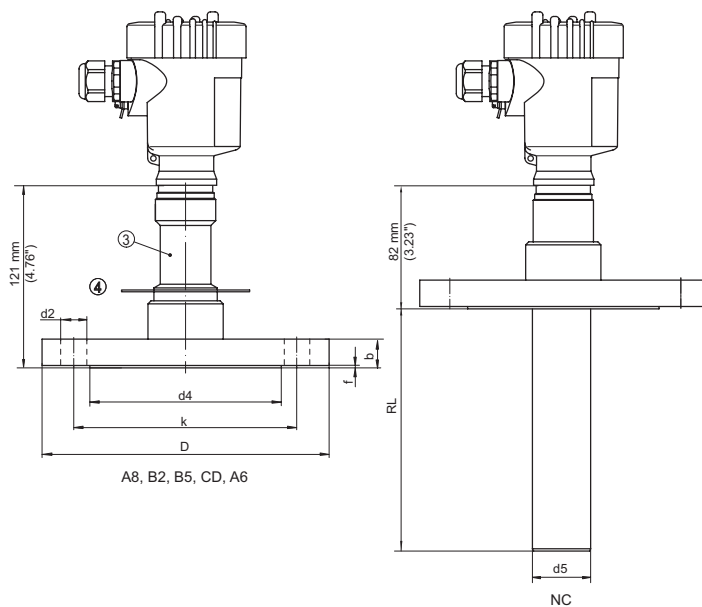

| ①    | mm         | DN | PN     | D     | b     | k         | d2    | d4    | f | RL | d5 |
|------|------------|----|--------|-------|-------|-----------|-------|-------|---|----|----|
| A8   | 40         | 40 | 150    | 18    | 110   | 4xø18     | 88    | 3     | - | -  | -  |
| B2   | 50         | 40 | 165    | 20    | 125   | 4xø18     | 102   | 3     | - | -  | -  |
| B5   | 80         | 40 | 200    | 24    | 160   | 8xø18     | 138   | 3     | - | -  | -  |
| CD   | 100        | 40 | 235    | 24    | 190   | 8xø22     | 162   | 3     | - | -  | -  |
| A6   | 150        | 16 | 300    | 28    | 250   | 8xø26     | 218   | 3     | - | -  | -  |
| NC   | 50         | 40 | 165    | 20    | 125   | 4xø18     | 102   | 3     | ⑤ | ⑥  | -  |
| inch |            |    |        |       |       |           |       |       |   |    |    |
| A8   | 40         | 40 | 5.91"  | 0.71" | 4.33" | 4xø 0.71" | 3.47" | 0.12" | - | -  | -  |
| B2   | 50         | 40 | 6.50"  | 0.79" | 4.92" | 4xø 0.71" | 4.02" | 0.12" | - | -  | -  |
| B5   | 80         | 40 | 7.87"  | 0.95" | 6.30" | 8xø 0.71" | 5.43" | 0.12" | - | -  | -  |
| CD   | 100        | 40 | 9.25"  | 0.95" | 7.48" | 8xø 0.87" | 6.38" | 0.12" | - | -  | -  |
| A6   | 150        | 16 | 11.81" | 1.10" | 9.84" | 8xø 1.02" | 8.58" | 0.12" | - | -  | -  |
| NC   | 50         | 40 | 6.50"  | 0.79" | 4.92" | 4xø 0.71" | 4.02" | 0.12" | ⑤ | ⑥  | -  |
| ②    |            |    |        |       |       |           |       |       |   |    |    |
| CA   | 2" 150 lbs |    | 5.91"  | 0.77" | 4.75" | 4xø 0.75" | 3.62" | 0.12" | - | -  | -  |
| CB   | 3" 150 lbs |    | 7.48"  | 0.96" | 6"    | 4xø 0.75" | 5"    | 0.12" | - | -  | -  |

Fig. 65: VEGABAR 83, flange connection 180 °C/200 °C (ceramic/metallic measuring cell)

- 1 Flange connection according to DIN 2501
- 2 Flange connection according to ASME B16.5
- 3 Temperature adapter up to 180 °C
- 4 Temperature screen sheet up to 200 °C
- 5 Order-specific
- 6 Order-specific

For the version with " Second Line of Defense", the measure of length increases by 17 mm (0.67 in).

## 12.5 Industrial property rights

VEGA product lines are global protected by industrial property rights. Further information see [www.vega.com](http://www.vega.com).

VEGA Produktfamilien sind weltweit geschützt durch gewerbliche Schutzrechte.

Nähere Informationen unter [www.vega.com](http://www.vega.com).

Les lignes de produits VEGA sont globalement protégées par des droits de propriété intellectuelle. Pour plus d'informations, on pourra se référer au site [www.vega.com](http://www.vega.com).

VEGA lineas de productos están protegidas por los derechos en el campo de la propiedad industrial. Para mayor información revise la pagina web [www.vega.com](http://www.vega.com).

Линии продукции фирмы ВЕГА защищаются по всему миру правами на интеллектуальную собственность. Дальнейшую информацию смотрите на сайте [www.vega.com](http://www.vega.com).

VEGA系列产品在全球享有知识产权保护。

进一步信息请参见网站 < [www.vega.com](http://www.vega.com)。

## 12.6 Trademark

All the brands as well as trade and company names used are property of their lawful proprietor/originator.

## INDEX

### A

- Adjust Date/Time 51
- Adjustment 41, 46
  - Process pressure 44, 45
  - System 40
  - Unit 43
- Adjustment system 40
- Adjust the current output 47, 53

### C

- Change the language 49
- Copy sensor settings 52
- Current output 47, 48

### D

- Damping 46
- Differential pressure measurement 10
- Display lighting 50

### E

- EDD (Enhanced Device Description) 60
- Electrical connection 24, 25
- Error codes 63, 64, 65
- Event memory 62

### F

- Fault rectification 65
- Functional principle 10

### G

- Grounding 24

### H

- HART
  - Mode 53

### L

- Linearisation 47

### M

- Maintenance 61
- Measured value memory 61
- Measurement setup 20, 21, 22

### N

- NAMUR NE 107 62
  - Function check 64

### O

- Oxygen applications 17

### P

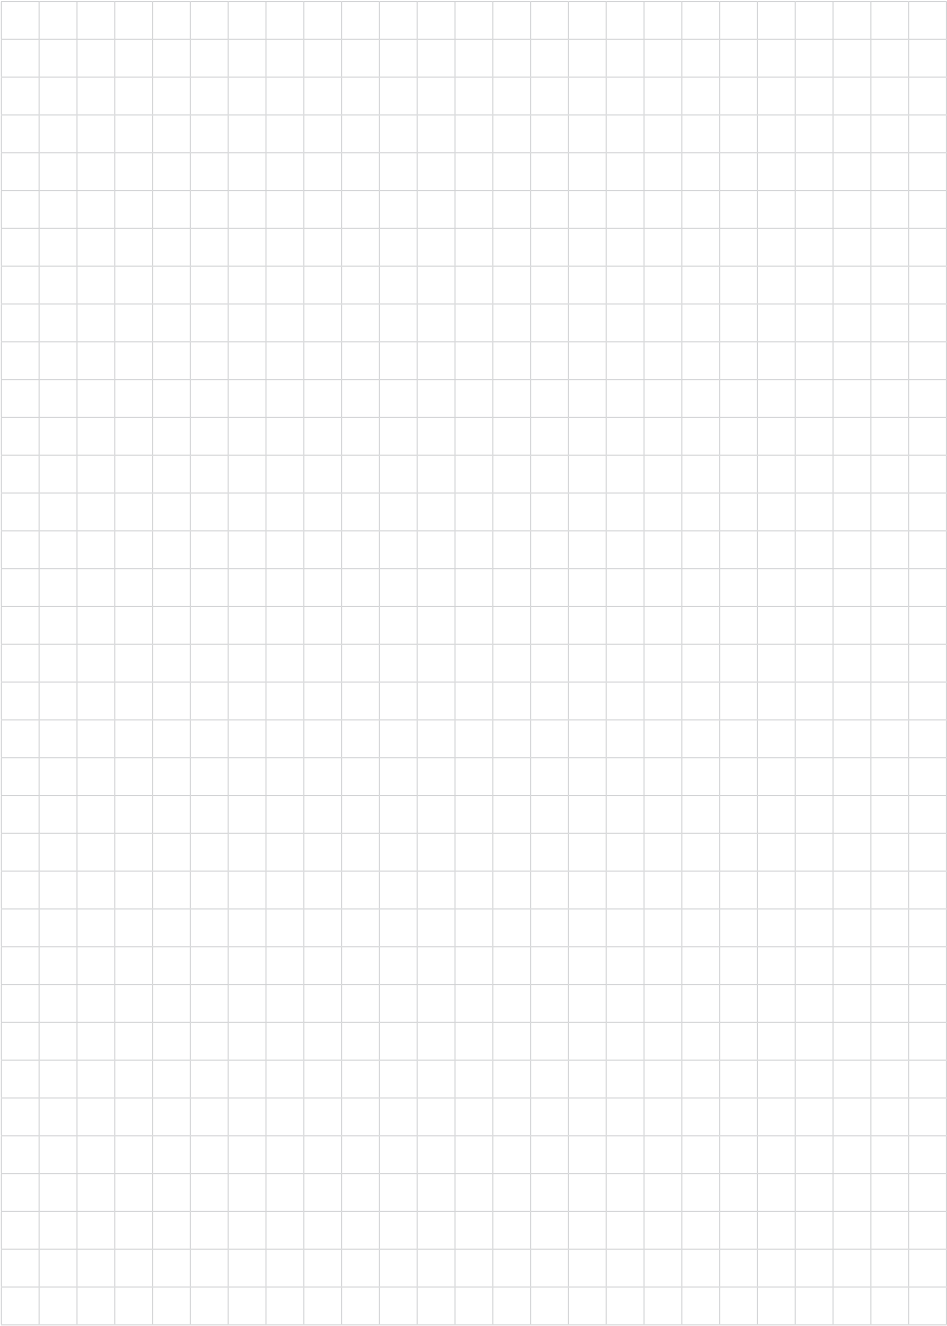
- Parameterization example 44
- Peak value
  - Pressure 50
  - Temperature 50
- PIN 36
- Position correction 43
- Pressure compensation 19, 20
  - Ex d 19
- Process pressure measurement 21

### R

- Repair 68
- Reset 51

### S

- Safety Integrity Level (SIL)
  - Lock adjustment 48
  - Operating sequence 41
- Seal concept 12
- Service access 53
- Service hotline 66
- Set display parameters 49, 50
- Simulation 51





Printing date:

# VEGA

All statements concerning scope of delivery, application, practical use and operating conditions of the sensors and processing systems correspond to the information available at the time of printing.

Subject to change without prior notice

© VEGA Grieshaber KG, Schiltach/Germany 2022



45036-EN-220624

VEGA Grieshaber KG  
Am Hohenstein 113  
77761 Schiltach  
Germany

Phone +49 7836 50-0  
E-mail: [info.de@vega.com](mailto:info.de@vega.com)  
[www.vega.com](http://www.vega.com)